Firma C L A A S Service and Parts GmbH KUNDENDIENST 33416 Harsewinkel

Data card

machine serial no.: 57600039 LEXION 580R CAT supporting workshop: 3945 Nebraska Harvest Center Inc. - United States

configuration:

comiguration.	
MD B04 0020	AUTO CONTOUR cutterbar control
MD B05 0050	Autopilot fitted (on machine)
MD B06 0020	Front attachment drive 120 kW, variable 284-425 rpm
MD_B08 0011	Cutterbar cylinder with hydraulic damping
MD_B09 0020	3. cutterbar cylinder with mechanical lock
	Feeder housing
MD_B10 0030	
MD_B12 0010	Without dust extraction
MD_B16 0020	Without Instant Stop header brake
MD_C02 0030	Threshing system Maize
MD_C04 0040	Drum drive variator, two-step
MD_D06 0020	ROTO PLUS variator drive
MD_D08 0030	Blind concaves fitted, seperate package for maize
MD_E04 0020	3D cleaning system
MD_E05 0021	Chaff spreader CoL
MD_E08 0020	Sieve adjustment, electric
MD_E10 0030	GRAINMETER incl. returns volume measurement with CEBIS d
MD_F02 0316	Grain tank 11,500 litres top unloading HD
MD_F06 0100	Grain tank unloading tube XXL axial HD
MD_G02 0120	Straw chopper maize / grain COL
MD_G06 0030	With drive for hydr. straw / chaff spreader COL
MD N02 0220	Drive axle for wheels 24t
	Spacer for duals; T-A Dia 23,1-26 14PR R1 TT F20
	Tyres, T-A Rad Duals 20,8 R42 155A8 R1
	Steering axle 10t 10 holes for Autopilot
MD_N08 0212	Steering axle tyres, 500/85 R24 x 225 IMP, 10-hole
MD_N10 0374	
MD_P02 0600	CAT C12 299kW(SAE)292kVV(EVVG)273kVV(ECE)
MD_P03 0090	Fuel consumption measurement
MD_P06 0020	Fuel pre-filter
MD_P08 0020	Radiator cleaning system, fan
MD_P12 0020	Air cleaner, special
MD_Q02 0070	A/C-MATIC - automatic climate control with heating
MD_Q03 0010	Prepared for radio incl. antenna and speakers
MD_Q03 0011	Radio fitted
MD_Q03 0050	Work lights
MD_Q03 0120	Icebox
MD_Q08 0011	QUANTIMETER yield measurement
MD Q10 0030	Comfort seat, air-suspended
MD_R04 0010	Rear view mirrors, electrically adjustable
MD_S02 0060	Legal equipment USA
MD_S03 0010	Rotating beacons, 2 units
MD S04 0040	Tool box universal
MD_S06 0020	Technical documents English
MD_S07 0110	Fire extinguisher bracket
	Dispatch version USA / Canada
	Crane tackles to unload the machine
_	
MD_T03 0020	Dispatch accessories for overseas
MD_T03 0070	Dispatch accessories for overseas

925 280th Street Seward, NE 68434 US

Phone: (402) 643-4050 Fax: () -Email: inquiry@nebharv.com Web site: www.nebharv.com

Bill To: George Schmidt 72981 620th Ave

Tecumseh, NE 68450

US

SERVICE INVOICE

Invoice: 01-21505 Date: 9/21/2014 PO

CustId: SCHMIDT GEORGE

Cust Email:

GLSCHMIDT@WINDSTREAM.NET (402) 335-2514

Phone: Salesperson: User:

J.Othmer B.Paulsen

Ship To:

George Schmidt

Opened: Work Order No:

9/5/2014 er No: 01-21895

Pickup Date: Unit No: Unit Serial:

57600039

Unit Desc: 580R SysCare
Unit Meter: 1,960.0 Hours

Ü

57600039 580R SysCare Until 1855 EngHrs Responsible Tech:

My Ref: Delivery Date: Unit Make:

Unit Make: Unit Model: Unit Tag: N.Emons 580R 57600039

Lexion 580R NU11-11

Field

4	Typo	Description	Qty	Tax	Price	Discount	Net Price
em 1 Service	Type	Description					
1 Service		The engine was do for a service. I changed the engine oil and	filters and blow out the ai	r filters. Lal	so changed the	e fuel filters	
		The engine was do for a service. I changed the engine on and primed the system.	lillers and blew out the di	, more, res			100000000000000000000000000000000000000
	SL	Field Service					\$385.0
474830	PA	CLA - AGRIMOT ULTRATEC 10W-40	2.0000		\$90.14		\$180.2
	PA	OTH - Fuel Filter TIER 3	1.0000		\$27.49		\$27.4
1R-0762	*	OTH - Oil Filter	1.0000		\$32.96		\$32.9
IR-1808	PA	OTH - F/W SEPERATOR TIER 3	1.0000		\$22.51		\$22.5
P551065	PA	CLA - SEAL RING	2.0000		\$0.69		\$1.3
2164650	PA		1.0000		\$56.03		\$56.0
7615831	PA	CLA - LIMITATION VALVE	1,0000		Seg	ment Total:	\$705.6
	SL	Field Service			Seg	ment Total:	\$330.0 \$330.0
05 Park Brake							
00 Tark Brake		The park brake didn't lock to keep the paddel in the cab down dissasembled the park brake and removed the broke piece. I brake back on the machine.	n. I found the teeth on the I then installed a new lock	ock were s and reasse	tripped out. I re mbled and inst	emove and alled the park	\$220.0
	SL	Field Service					\$25.0
Freight-Parts	MC	Freight Parts	1.0000		\$25.00		
r reigner area					Seg	gment Total:	\$245.0
06 Rotary Coupl							
		The rotary coupler for the feeder house variator was leaking installed a new coupler.	oil on the side of the mach	nine. I remo	ved the leaky o	oupler and	
							\$55.0
	SL	Field Service					\$55. 0

925 280th Street

Seward, NE 68434 US

Phone: (402) 643-4050 Fax: () -Email: inquiry@nebharv.com Web site: www.nebharv.com SERVICE INVOICE

Invoice: 01-21505 Date: 9/21/2014 PO:

Custld: SCHMIDT GEORGE

Cust Email:

GLSCHMIDT@WINDSTREAM.NET

Phone: Salesperson: (402) 335-2514 J.Othmer

User:

B.Paulsen

Bill To: George Schmidt 72981 620th Ave

72981 620th Ave Tecumseh, NE 68450 US Ship To: George Schmidt

			1.0000	\$219.74	\$219.74
099750	PA	CLA - ROTARY CONNECTION	1.0000	Segment Total:	\$274.74
7 Tensioner		The main engagement belt tensioner bearings were noisey	when you spun them by hand. I rem	oved the belt tensioner pulley	
		The main engagement belt tensioner bearings were noisey from the machine and removed the old bearings. I then instru	alled new bearings and installed pul	ley back on machine.	
					\$110.00
	SL	Field Service	2.0000	\$14.84	\$29.68
155360	PA	CLA - GRVD.BALL BEARING		Segment Total:	\$139.68
9 Latch	-			the week inst	
		The rear right hand door latch wouldn't open. I found that th to turn. I removed the old latch and installed a new one and	ere was a stop on the latch that was adjusted it so the door opened and	s broke causing the wrench just closed properly.	2442.04
7	01	Field Service			\$110.00
	SL	CLA - LOCK	2.0000	\$72.09	\$144.18
7842433	PA	CLA - LOCK		Segment Total:	\$254.18
10 Weld		The chopper pan and stage 2 brace was cracked. I ground the weld.	the paint off around the cracks ther	welded them and then painted	\$110.00
10 Weld	SL	The chopper pan and stage 2 brace was cracked. I ground the weld. Field Service	the paint off around the cracks ther	welded them and then painted Segment Total:	
10 Weld	SL	the weld.	the paint off around the cracks ther		
10 Weld	SL	Field Service	e ground. I removed the motor from	Segment Total:	
	SL	the weld. Field Service	e ground. I removed the motor from	Segment Total:	\$110.00 \$110.00
	SL	Field Service	ground. I removed the motor from the machine.	Segment Total: the machine and dissassembled	\$110.00 \$220.0
		The right hand chaff spreader motor was leaking oil on the it. I then installed a new seal kit in it and installed it back o	e ground. I removed the motor from	Segment Total: the machine and dissassembled \$29.76	\$110.00
11 Chaff Spread	SL	The right hand chaff spreader motor was leaking oil on the it. I then installed a new seal kit in it and installed it back of Field Service	ground. I removed the motor from the machine.	Segment Total: the machine and dissassembled	\$110.00 \$220.0 \$29.7
11 Chaff Spread	SL	The right hand chaff spreader motor was leaking oil on the it. I then installed a new seal kit in it and installed it back of Field Service CLA - SEAL KIT	e ground. I removed the motor from the machine.	Segment Total: the machine and dissassembled \$29.76 Segment Total:	\$110.00 \$220.0 \$29.7
11 Chaff Spread 3513720	SL	The right hand chaff spreader motor was leaking oil on the it. I then installed a new seal kit in it and installed it back of Field Service CLA - SEAL KIT	e ground. I removed the motor from the machine. 1.0000	Segment Total: the machine and dissassembled \$29.76 Segment Total:	\$110.00 \$220.0 \$29.7
11 Chaff Spread 3513720	SL	The right hand chaff spreader motor was leaking oil on the it. I then installed a new seal kit in it and installed it back of Field Service CLA - SEAL KIT	e ground. I removed the motor from the machine. 1.0000	Segment Total: the machine and dissassembled \$29.76 Segment Total:	\$110.00 \$220.0 \$29.7
11 Chaff Spread 3513720	SL	The right hand chaff spreader motor was leaking oil on the it. I then installed a new seal kit in it and installed it back of Field Service CLA - SEAL KIT The quantimeter cylinder was leaking oil out of the shaft steen installed a new seal kit in the cylinder and installed it. Field Service	e ground. I removed the motor from the machine. 1.0000 eal. I removed the cylinder from the back on the machine.	Segment Total: the machine and dissassembled \$29.76 Segment Total: machine and dissassembled it. I	\$220.0 \$29.7 \$249.7
11 Chaff Spread 3513720	SL PA	The right hand chaff spreader motor was leaking oil on the it. I then installed a new seal kit in it and installed it back of Field Service CLA - SEAL KIT The quantimeter cylinder was leaking oil out of the shaft sthen installed a new seal kit in the cylinder and installed it Field Service CLA - O-RING	e ground. I removed the motor from the machine. 1.0000 eal. I removed the cylinder from the back on the machine. 1.0000	Segment Total: the machine and dissassembled \$29.76 Segment Total: machine and dissassembled it. I	\$220.0 \$29.7 \$249.7 \$220.0 \$2.0
11 Chaff Spread 3513720 12 Quantimeter	SL PA	The right hand chaff spreader motor was leaking oil on the it. I then installed a new seal kit in it and installed it back of Field Service CLA - SEAL KIT The quantimeter cylinder was leaking oil out of the shaft sthen installed a new seal kit in the cylinder and installed it Field Service CLA - O-RING CLA - PISTON SEAL	e ground. I removed the motor from the machine. 1.0000 eal. I removed the cylinder from the back on the machine. 1.0000 1.0000	\$29.76 \$egment Total: \$29.76 Segment Total: machine and dissassembled it. I \$2.05 \$15.30	\$220.0 \$29.7 \$249.7 \$220.0 \$2.0 \$15.3
11 Chaff Spread 3513720 12 Quantimeter	SL PA	The right hand chaff spreader motor was leaking oil on the it. I then installed a new seal kit in it and installed it back of Field Service CLA - SEAL KIT The quantimeter cylinder was leaking oil out of the shaft sthen installed a new seal kit in the cylinder and installed it Field Service CLA - O-RING	e ground. I removed the motor from the machine. 1.0000 eal. I removed the cylinder from the back on the machine. 1.0000	Segment Total: the machine and dissassembled \$29.76 Segment Total: machine and dissassembled it. I	\$110.00 \$220.0 \$29.7 \$249.7

925 280th Street Seward, NE 68434 US

Phone: (402) 643-4050 Fax: () -Email: inquiry@nebharv.com Web site: www.nebharv.com

Bill To: George Schmidt 72981 620th Ave Tecumseh, NE 68450

US

SERVICE INVOICE

Invoice: 01-21505 Date: 9/21/2014

CustId: SCHMIDT GEORGE

Cust Email:

GLSCHMIDT@WINDSTREAM.NET

Phone: Salesperson: User:

(402) 335-2514 J.Othmer B.Paulsen

Ship To:

George Schmidt

				Segment Total:	\$260.46
3 Rotor VS			walk and the door from the	machine to gain access to it. I	
		The rotor driven variator had side to side play in it. I removed the cat then removed the belt and varitator from the machine and installed rethe machine.	ew bushings and thrust wa	shers in it. I then reassembled	
		Field Coming			\$220.0
	SL	Field Service	2,0000	\$13.07	\$26.1
5032710	PA	CLA - BEARING BUSH	2.0000	\$2.48	\$4.9
6032700	PA	CLA - THRUST WASHER	1.0000	\$1.28	\$1.2
2344140	PA	CLA - SHIM	1.0000	\$1.28	\$1.2
2344250	PA	CLA - SHIMS	1.0000	Segment Total:	\$253.6
14 Line		The engine fan shield was bent and rubbing on the air to air line. I re	emoved the shield from ma	chine and straightened the	
		shield and installed it back on the machine.			6440
					\$110.0
	SL	Field Service		Segment Total:	\$110.0
15 CS Flaps	SL	Field Service		Segment Total:	\$110.0
15 CS Flaps	SL		e old flapps and installed n		\$110.0
15 CS Flaps		The rubber flaps on the main countershaft were broke. I removed the	e old flapps and installed n		
15 CS Flaps	SL	The rubber flaps on the main countershaft were broke. I removed the Field Service		ew ones.	\$110.
15 CS Flaps 7958791		The rubber flaps on the main countershaft were broke. I removed the Field Service CLA - PADDLE	2.0000	ew ones. \$51.71	\$110.0 \$103.4
	SL	The rubber flaps on the main countershaft were broke. I removed the Field Service CLA - PADDLE CLA - HEXAGONAL BOLT	2.0000 18.0000	ew ones. \$51.71 \$0.13	\$110.0 \$110.0 \$103.4 \$2.3 \$1.0
7958791	SL PA	The rubber flaps on the main countershaft were broke. I removed the Field Service CLA - PADDLE CLA - HEXAGONAL BOLT CLA - CONTACT WASHER	2.0000 18.0000 18.0000	\$51.71 \$0.13 \$0.06	\$110.\ \$103.\ \$2.\ \$1.\
7958791 2380940	SL PA PA	The rubber flaps on the main countershaft were broke. I removed the Field Service CLA - PADDLE CLA - HEXAGONAL BOLT	2.0000 18.0000	ew ones. \$51.71 \$0.13	\$110.0 \$103.4 \$2.0
7958791 2380940 2393860	SL PA PA	The rubber flaps on the main countershaft were broke. I removed the Field Service CLA - PADDLE CLA - HEXAGONAL BOLT CLA - CONTACT WASHER	2.0000 18.0000 18.0000	\$51.71 \$0.13 \$0.06 \$0.13	\$110. \$103. \$2. \$1. \$2.
7958791 2380940 2393860 2379830	SL PA PA	The rubber flaps on the main countershaft were broke. I removed the Field Service CLA - PADDLE CLA - HEXAGONAL BOLT CLA - CONTACT WASHER CLA - SECURING NUT	2.0000 18.0000 18.0000	\$51.71 \$0.13 \$0.06 \$0.13	\$110.0 \$103.4 \$2.5 \$1.0 \$2.1 \$2.19.1
7958791 2380940 2393860 2379830	SL PA PA PA	The rubber flaps on the main countershaft were broke. I removed the Field Service CLA - PADDLE CLA - HEXAGONAL BOLT CLA - CONTACT WASHER CLA - SECURING NUT I inspected the machine and made a estimate for repairs.	2.0000 18.0000 18.0000	\$51.71 \$0.13 \$0.06 \$0.13 Segment Total:	\$110.0 \$103.4 \$2.0 \$1.0 \$2.1 \$219.1
7958791 2380940 2393860 2379830	SL PA PA	The rubber flaps on the main countershaft were broke. I removed the Field Service CLA - PADDLE CLA - HEXAGONAL BOLT CLA - CONTACT WASHER CLA - SECURING NUT	2.0000 18.0000 18.0000	\$51.71 \$0.13 \$0.06 \$0.13	\$110. \$103. \$2. \$1. \$2. \$219. \$450.
7958791 2380940 2393860 2379830	SL PA PA PA	The rubber flaps on the main countershaft were broke. I removed the Field Service CLA - PADDLE CLA - HEXAGONAL BOLT CLA - CONTACT WASHER CLA - SECURING NUT I inspected the machine and made a estimate for repairs.	2.0000 18.0000 18.0000	\$51.71 \$0.13 \$0.06 \$0.13 Segment Total:	\$110. \$103. \$2. \$1. \$2. \$219. \$450. \$2,650.
7958791 2380940 2393860 2379830	SL PA PA PA	The rubber flaps on the main countershaft were broke. I removed the Field Service CLA - PADDLE CLA - HEXAGONAL BOLT CLA - CONTACT WASHER CLA - SECURING NUT I inspected the machine and made a estimate for repairs.	2.0000 18.0000 18.0000 18.0000	\$51.71 \$0.13 \$0.06 \$0.13 Segment Total:	\$110. \$103. \$2. \$1. \$2. \$219. \$450. \$450. \$2,650. \$927.
7958791 2380940 2393860 2379830	SL PA PA PA	The rubber flaps on the main countershaft were broke. I removed the Field Service CLA - PADDLE CLA - HEXAGONAL BOLT CLA - CONTACT WASHER CLA - SECURING NUT I inspected the machine and made a estimate for repairs.	2.0000 18.0000 18.0000 18.0000	\$51.71 \$0.13 \$0.06 \$0.13 Segment Total:	\$110. \$103. \$2. \$1. \$2. \$219. \$450.

925 280th Street Seward, NE 68434 US

Phone: (402) 643-4050 Fax: () -Email: inquiry@nebharv.com Web site: www.nebharv.com

Bill To: George Schmidt 72981 620th Ave Tecumseh, NE 68450

US

SERVICE INVOICE

Invoice: 01-21505 Date: 9/21/2014 PO:

CustId: SCHMIDT GEORGE

Cust Email:

GLSCHMIDT@WINDSTREAM.NET (402) 335-2514

Phone: Salesperson: User:

J.Othmer B.Paulsen

Ship To:

George Schmidt

 Sub Total:
 \$3,602.31

 Total Tax:
 \$0.00

 Invoice Total:
 \$3,602.31

Forms of Payment		Amount	
Туре	Description		
Cust Open Acct	Customer Id: SCHMIDT GEORGE	\$3,602.31	
Construction of the Constr	ON Account		
	Signature:	Total Forms of Payment:	\$3,602.31

Balance Due On This Invoice: \$3,602.31

925 280th Street Seward, NE 68434 US

Phone: (402) 643-4050 Fax: () -Email: inquiry@nebharv.com Web site: www.nebharv.com

Bill To: George Schmidt 72981 620th Ave Tecumseh, NE 68450

US

SERVICE INVOICE

Invoice: 01-41984 Date: 10/27/2016

Custld: SCHMIDT GEORGE

Cust Email:

GLSCHMIDT@WINDSTREAM.NET

Phone: Salesperson: (402) 335-2514

J.Othmer B.Paulsen

User: Ship To:

George Schmidt

Opened: Work Order No:

Pickup Date: Unit No: Unit Serial:

Unit Desc: Unit Meter: 10/25/2016 01-44981

57600039

580R SysCare Until 1855 EngHrs

2,162.0 Hours

Responsible Tech:

My Ref: Delivery Date: Unit Make:

Unit Model: Unit Tag:

N.Emons 580R 57600039

Lexion 580R NU11-11

			Oty	Tax	Price	Discount	Net Price
tem	Type	Description	Qty	IdA	11100		
totor Speed			SAME AND THOUSAND AND AND AND AND AND AND AND AND AND			in the	
*		Customer called and said the rotor speed wouldn't adjust. I went electrical compartment and chewed some wires. I repaired the variated to work but not all the time. I installed new inserts and it loosened the variable speed belt and found the big bearing on the cat walk and the driven variator. I then noticed the side wall bearing and took the bearing to a machine shop and had them rethen went back to customers and welded the plate on the mach walk. I then ran the machine and it still had a slight vibration. I in again	worked fine. It also had be driven shaft was bad. of the machine was crac nake a plate so I could r	a vibration I went backed out. I re inforce to	at higher spee k down there a finished removi he side of the n	ds. I nd removed ng the nachine. I ator and cat	\$2,242.5
	SL	Field Service					\$114.3
0404430	PA	CLA - SOLENOID	1.0000		\$114.31		\$121.1
	PA	CLA - INSERT	1.0000		\$121.17		\$38.7
394211	PA	CLA - INSERT	1.0000		\$38.74		\$195.0
)555970	PA	CLA - BEARING SPHERICAL ROLLER	1.0000		\$195.03		\$474.8
2130510	PA	CLA - V-BELT, BROAD	1.0000		\$474.87		\$5.5
6672480	PA	CLA - THRUST WASHER	2.0000	Υ	\$2.77		\$97.4
6032700		CLA - PRESSURE RING	1.0000		\$97.45		\$321.
6449790	PA PA	CLA - BEARING UNIT	1.0000	Y	\$321.34		100000000000000000000000000000000000000
6612370		CLA - BEARING BUSH	2.0000	Y	\$14.52		\$29.
6032710	PA	CLA - TAPERED SCREW	2.0000	Y	\$46.60		\$93.
6287003	PA	Outside Labor	1.0000	Y	\$77.25		\$77.
Outside Labor	МС	Plate that the machine shop made to be welded in					
Remark	RE	Plate that the machine shop made to be well as			Se	gment Total:	\$3,810.
*			Labor:				\$2,242.
			Parts:				\$1,490.
			Misc Cl	hardes.			\$77.
			IVIISC CI	lalyes.			

925 280th Street Seward, NE 68434 US

Phone: (402) 643-4050 Fax: () -Email: inquiry@nebharv.com Web site: www.nebharv.com

Bill To: George Schmidt 72981 620th Ave Tecumseh, NE 68450

US

SERVICE INVOICE

Invoice: 01-41984 Date: 10/27/2016 PO:

CustId: SCHMIDT GEORGE

Cust Email:

GLSCHMIDT@WINDSTREAM.NET

Phone: Salesperson: User: (402) 335-2514 J.Othmer

.

B.Paulsen

Ship To: George Schmidt

 Sub Total:
 \$3,810.44

 Total Tax:
 \$86.24

 Invoice Total:
 \$3,896.68

Forms of Payment		Amount	
Туре	Description	\$3,896.68	
Cust Open Acct	Customer Id: SCHMIDT GEORGE		- 125
•	ON Account		
	Signature:	Total Forms of Payment:	\$3,896.68

Balance Due On This Invoice: \$3,896.68

925 280th Street Seward, NE 68434 US

Phone: (402) 643-4050 Fax: () -Email: inquiry@nebharv.com Web site: www.nebharv.com

Bill To: George Schmidt 72981 620 AVE

TECUMSEH, NE 68450

US

SERVICE INVOICE

Invoice: 01-60881 Date: 10/31/2017

CustId: SCHMIDT GEORGE

Cust Email:

GLSCHMIDT@WINDSTREAM.NET

Phone:

(402) 335-2514

Salesperson: User:

J.Othmer B.Paulsen

Ship To:

George Schmidt

Opened: Work Order No: Pickup Date:

Unit No:

Unit Serial: Unit Desc: 10/26/2017 01-54484

215 57600039

580R SysCare Until 1855 EngHrs

Responsible Tech:

My Ref: Delivery Date:

Unit Make: Unit Model: Unit Tag:

CTobin 580 57600039

Lexion 580R NU11-11

Field

			Qty	Tax	Price	Discount	Net Price
em	Type	Description	u.y	1 44.7			
ylinder Drive					taraianad tha	poring	
		Removed threshing variator belt. Removed the 2 speed belt, Replaced accelerator, stage 2 chopper and feederhouse belt drum and impeller drum. Started off digging out weeds by ha gearbox and ran machine till part of the plugged weeds starte the machine frequently to remove excess build up of weeds of to the blown belt Installed new belt and the rest of the plug ce build up of weeds. Then ran the machine at full throttle to ent to the weeds and a log. Installed two new slats on gathering	nd. Then installed two speces of unplugging themselves for om concave and feederho ame out of machine. Double sure that the seperation sys	ed bolts in common the intuse. Impelled checked to the checked to	corn on the two ernals of mach er drum wasn't the combine fo	speed ine. Stopped moving due r any more	
							\$2,643.3
	SL	Field Service	1.0000		\$270.40		\$270.40
1764421	PA	CLA - POWER BAND BELT	1.0000		\$13.73		\$13.73
HY04-08RU14A	PA	OTH - METRIC FEMALE SWV	1.0000		\$18.91		\$18.9
HY04-08RU14A90T	PA	OTH - 14X1.5 FEMALE 90 SWL	4.0000		\$1.50		\$6.00
h42504	PA	OTH - hose/ft	1.0000		\$103.67		\$103.6
6672490	PA	CLA - POWER BAND BELT	1.0000		\$119.43		\$119.4
6448900	PA	CLA - POWER BAND BELT	1.0000		\$354.38		\$354.3
6675512	PA	CLA - 2 PIECE-BELT SET	2.0000		\$21.94		\$43.8
6306422	PA	CLA - CONVEYOR BAR	2.0000			gment Total:	\$3,573.7
FH Countershaft							
rn Countershalt		LH countershaft bearing was in pieces on shaft and remove any damage. Checked the countershaft for damage and inst Tightened flanges and made sure reverser sprocket and fee engagement for operation.	nd the RH bearing. Remove- talled new bearings and loc eder house pulley were in li	d the old fla k collars or ne. Checke	anges and cheon LH and RH s d reverser and	cked them for ides of shaft. feederhouse	*****
	SL	Field Service					\$260.0
5000404	PA	CLA - BEARING LOCK COLLAR	2.0000		\$36.19		\$72.3
5602121	PA	CLA - TENSION RING	2.0000	1	\$8.42		\$16.8

925 280th Street Seward, NE 68434 US

Phone: (402) 643-4050 Fax: () -Email: inquiry@nebharv.com Web site: www.nebharv.com

Bill To: George Schmidt 72981 620 AVE

TECUMSEH, NE 68450

US

SERVICE INVOICE

Invoice: 01-60881 Date: 10/31/2017 PO:

Custld: SCHMIDT GEORGE

Cust Email:

GLSCHMIDT@WINDSTREAM.NET

Phone: Salesperson: User: (402) 335-2514 J.Othmer

B.Paulsen

Ship To:

George Schmidt

		Segment Total:	\$349.22
		Labor: Parts:	\$2,903.33 \$1,019.62
Totals		Sub Total: Total Tax: Invoice Total:	\$3,922.95 \$0.00 \$3,922.95
Forms of Payment		Amount	
Туре	Description Customer Id: SCHMIDT GEORGE	\$3,922.95	
	Customer Id. Schwild I GEORGE		
Cust Open Acct	ON Account		

Balance Due On This Invoice: \$3,922.95

925 280th Street Seward, NE 68434 US

Phone: (402) 643-4050 Fax: () -Email: inquiry@nebharv.com Web site: www.nebharv.com

Bill To: GEORGE SCHMIDT 72981 620 AVE

TECUMSEH, NE 68450 US

SERVICE INVOICE

Invoice: 01-70190 Date: 10/30/2018

CustId: SCHMIDT GEORGE

Cust Email:

GLSCHMIDT@WINDSTREAM.NET

Phone: Salesperson: (402) 335-2514 BVaughn B.Paulsen

User: Ship To:

GEORGE SCHMIDT

Opened: Work Order No:

Pickup Date: Unit No:

Unit Serial:

Unit Desc: Unit Meter:

10/28/2018 01-64717

57600039

2,406.0 Hours

580R SysCare Until 1855 EngHrs

Responsible Tech: My Ref:

Delivery Date: Unit Make: Unit Model: Unit Tag:

N.Emons 580 57600039

Lexion 580R NU11-11

			Qty	Tax	Price	Discount	Net Price
em	Туре	Description	Qty	IdA	71.00		
6447001 2151361 2166050 2339480 2151350 6097780 6297730 2151341 6448590 2166060 2393480	SL PA PA PA PA PA PA PA PA	Customer called and said the left hand impeller bearing w feeder house belts. I then removed the reel pump belt and pulley came lose and ruin the key, spacer, and wedges. I installed new parts on pulley and installed new bearings in machine. I then ran machine to varify fix. Field Service CLA - BEARING UNIT CLA - INNER RING CLA - SHAFT SEAL RING CLA - SNAP RING CLA - SNAP RING CLA - INT.SPACER SLEEVE CLA - INTERMEDIATE RING CLA - ANG. BALL BEARING CLA - ANG. BALL BEARING CLA - THRUST WASHER CLA - SOCKET HEAD SCREW CLA - PARALLEL KEY	(IIC ICCOCK IIIC III COCK III CO	to Kearner installed v	and back with	parts. I then	\$1,152.75 \$413.65 \$39.21 \$49.35 \$1.77 \$67.66 \$40.44 \$66.44 \$56.00 \$4.5 \$2.7 \$118.2
7448871	PA	CLA - TAPERED RING	1.0000		\$143.67		\$143.6
6672490	PA	CLA - POWER BAND BELT	1.0000		\$31.59		\$31.5
6673191	PA	CLA - SPACER RING			Se	gment Total:	\$2,251.5
			Labor: Parts:				\$1,152.7 \$1,098.7
rotals				Sub To			\$2,251.5 \$0.0

925 280th Street Seward, NE 68434 US

Phone: (402) 643-4050 Fax: () -Email: inquiry@nebharv.com Web site: www.nebharv.com

Bill To: GEORGE SCHMIDT 72981 620 AVE TECUMSEH, NE 68450

US

SERVICE INVOICE

Invoice: 01-70190 Date: 10/30/2018 PO:

Custld: SCHMIDT GEORGE

Cust Email:

GLSCHMIDT@WINDSTREAM.NET

Phone: Salesperson: User: (402) 335-2514 BVaughn

B.Paulsen

Ship To:

GEORGE SCHMIDT

		Invoice Total:	\$2,251.50
Forms of Payment		Amount	
Туре	Description	\$2,251.50	
Cust Open Acct	Customer Id: SCHMIDT GEORGE	Ψ2,201.00	
	ON Account		
	Signature:	Total Forms of Payment:	\$2,251.50
		Balance Due On This Ir	voice: \$2,251.50

925 280th Street Seward, NE 68434

Phone: (402) 643-4050 Fax: () -Email: inquiry@nebharv.com Web site: www.nebharv.com

Bill To: GEORGE SCHMIDT 72981 620 AVE

TECUMSEH, NE 68450

US

SERVICE INVOICE

Invoice: 01-80596 Date: 11/1/2019

Custld: SCHMIDT GEORGE

Cust Email:

GLSCHMIDT@WINDSTREAM.NET

Phone: Salesperson: (402) 335-2514 BVaughn

B.Paulsen

Ship To:

User:

GEORGE SCHMIDT

Opened: Work Order No:

Pickup Date:

Unit No: Unit Serial:

Unit Desc: Unit Meter: 215 57600039

10/29/2019

01-75795

580R SysCare Until 1855 EngHrs

2,502.0 Hours

Responsible Tech:

My Ref: Delivery Date: Unit Make:

Unit Model: Unit Tag:

N.Emons 580R 57600039

Lexion 580R NU11-11

Field

			Qty	Tax	Price	Discount	Net Price
tem	Type	Description					
Clean Grain		Customer called and said part of the lower clean grai went to customers and found it was the center divided turned the clean grain backwards and got the piece u	n auger flighting was broke off and r of the clean grain housing was br nwedged. I then ran machine to tig	wedged in oke off and then the o	n the clean grai d wedged in spi chain.	n chain. I ocket. I	\$528.74
	SL	Field Service	2.0000		\$0.49		\$0.98
2365520	PA	CLA - THREADED PIN	1.0000		\$100.00		\$100.00
Field Service	MC	Field Service Call Fee	1.0000			ment Total:	\$629.72
			Labor: Parts: Misc Ch	arges:			\$528.7 \$0.9 \$100.0
Totals				Sub Tot Total Ta	ax:		\$629.7 \$0.0 \$629.7

Forms of Payment		Amount		
Туре	Description	\$629.72		
Cust Open Acct	Customer Id: SCHMIDT GEORGE			
	ON Account			
	Signature:	Total Forms of Payment:	\$629.72	
			D. James Due On This Invoice: \$629.7	

Balance Due On This Invoice: \$629.72