Unit#

Apex Truck and Tractor Repair 302 W 61st Street N. PARK CITY, KS 67204 ruth@apextruck.com C:3163041808,O:3169430774



Invoice:

504494

Date:

10/21/2022

Bill To

Rohloff Trucking 1030 North Washington Street Wichita, KS 67214 P: 316-789-3575

Remit Payment To Apex Truck & Tractor Repair, Inc.

302 W 61st Street N.

Service Writer

PARK CITY, KS 67204

Customer PO

Servi	ce Order	Terms	Due Date	Authorizer	Customer PC) Se	rvice writer	Onit #
4494		COD	10/21/2022	Dylan Hyll	R8	Ва	shore, Ruth	R8
Item	Description	n				Quantity	Rate	Amount
Compla	aint: Make R	epairs						
Cause:	Engine mis	S						
Labor	fuel leak. F	Chassis / Diag e ound injector le stors, Rorcker, F	eaking. Remove all inj Run overhead. Install	duct off. Remove valv ectors. Brakes. Rocke brakes and adjust bra nge oil - Completed: 1	ers. Reseal. ake and	12.40000	\$129.99	\$1,611.88
Parts		lube filter - LF6				1.00000	\$30.54647	\$30.55
Parts	seal o ring					1.00000	\$11.7425	\$11.74
Parts		s - 2481394				6.00000	\$31.275	\$187.65
Parts	pump gp f					1.00000	\$312.242	\$312.24
Parts		0000004634				48.00000	\$5.50074	\$264.04
							Subtotal	\$2,418.10

Unit: R8 VIN: 1XPFDB0X8YN513694

2000 Peterbilt 378 Chassis: 1 Miles

Labor \$1,611.88

Parts

\$806.22

Shop Supplies

\$60.00

Pre-Charge Subtotal \$2,478.10

Wichita \$185.86

(7.5000% of \$2,478.10)

Total \$2,663.96

Payments & Credits

\$0.00

Balance Due \$2,663.96

2000 Pete

D&G Machine, LLC

770 N. Grace Hill Rd Newton, KS 67114



Invoice

Date 04/17/23 Invoice No. 1706

Bill To

Dick Rohloff 1030 N Washington St Wichita, KS 67214

Item	Description	Amount
Labor	Blue Pete Semi- Replace PTO and install pump support kit	400.00
Parts	New PTO	1,158.08
Parts	Support kit	53.50
Parts	Trans oil	85.74
Labor	White Freightliner- Diagnose air in fuel and seal filter housing; Install fuel check valve	300.00
	Subtotal	\$1,997.32

Sales Tax (8.5%) \$169.77

Total \$2,167.09

Pete



H st. CITY

Wichita Kenworth

5115 N. Broadway Wichita, KS 67219 (316) 838-0867

Invoice: 01S13221

Date / Hour: 5/9/2022 12:03:07PM

Repair Order: 13221 Customer: 10124 Branch: Wichita

Total Invoice: \$ 9,089.72 ***COD***

Page 1 of 7



Bill To:

Rohloff Construction 1030 N Washington **Cash Acct** Wichita, KS 67214

U/M

Ship To: Rohloff Construction 1030 N Washington **Cash Acct** Wichita, KS 67214

Work: (316) 641-8095

Shop: 316-641-8095

Customer P/O

Supp.

Dena Sampson

Description / Ref Number

Orig R/O: 0

Completion Date: 5/6/2022

Unit Number: 7 Type: Truck

Model Year: 2000

VIN: 1XPFDB0X8YN513694

Make/Model: Peterbilt 378 Meter: 1376654 Kilometers

Department: Service

Task: 1 CVI

Commercial Vehicle Inspection Complaint: CVI INSPECTION

Extended Price Quantity List Price

Part Coupon 050922-NAVGY

CVI coupon

CVI Coupon

Coupon

Task 1 Subtotals

-1.0 \$0.00 Parts

Task 1 Subtotals

\$0.00

\$13.00 (\$13.00)\$0.00

(\$12.00)

\$0.00

Labor: \$25.00 Miscellaneous: (\$25.00)

\$12.00

Task: 000000 General Accessories

Complaint: Cruise control will speed up on its own and then slow down or shut off.

Department: Service

Correction; Hooked up and pulled codes. Check speedometer parameters, Remove driveline and pulled yoke. Used cut off wheel and removed carrier bearing off in sections. Cleaned up surface. Cleaned yoke in solvent tank. Inspected and it is ok for reuse. Applied anti-seize to surface. Installed new carrier bearing. Installed yoke, washer and new nut and tightened. Installed driveline and torqued to spec. Greased u-joints.

Supp. Pa	art	Description / Ref Number	U/M	Quantity	List	Price	Extended Price
PC	231502	NUT-STUB SHAFT	EA	1.0	\$18.25	\$12.17	\$12.17
DUJNT	6.5-70-18X	KIT-STRAP	EA	3.0	\$14.98	\$9.48	\$28.44
LP	6200	1/8 STRAIGHT GREASE ZERK	EA	1.0	\$0.57	\$0.35	\$0.35
LP	662	1/2-13 X 1-1/2 GRD 8 BOLT	EA	2.0	\$1.41	\$0.87	\$1.74
LP	80931	1/2-13 GRADE C LOCK NUT	EA	2.0	\$1.09	\$0.67	\$1.34
LP	88439	1/2 SAE EXTRA THICK F/WASHR	EA	4.0	\$0.61	\$0.37	\$1.48
DUJNT	DS210661-1X	KIT-CENTER BEARING	EA	1.0	\$68.34	\$50.73	\$50.73
PC	K4122	KIT-HEX FLANGE CRIMPED NUT	EA	1.0	\$49.69	\$34.63	\$34.63
	Shop Sup	Shop Supplies		1.0	\$0.00	\$59.54	\$59.54
		Task 2 Su	ibtotals	Pa	irts:		\$130.88
				Lai	bor:		\$661.50
				Miscellaneo	ous:		\$59.54
				Task 2 Subto	tals		\$851.92

Task: 3 020000

Complaint: Check for fuel leak at filter, truck has been losing prime.

Fuel System - Fuel Filters - Diagnose

Department: Service



WKI Wichita Kenworth

5115 N. Broadway Wichita, KS 67219 (316) 838-0867 Invoice: 01S13221

Date / Hour: 5/9/2022 12:03:07PM

Repair Order: 13221 Customer: 10124 Branch: Wichita Total Invoice: \$ 9,089.72

COD
Page 2 of 7

Bill To:

Rohloff Construction 1030 N Washington **Cash Acct** Wichita, KS 67214

Ship To: Rohloff Construction

1030 N Washington **Cash Acct** Wichita, KS 67214

Work: (316) 641-8095

Shop: 316-641-8095

Customer P/O:

Dena Sampson

Orig R/O: 0

Completion Date: 5/6/2022

Correction: Inspected unit. Found hand primer pump leaking and fuel pressure drain back check valve needs replaced. Removed hand primer pump and cleaned up surface. Installed new primer pump, gasket and tightened down. Removed and replace fuel pressure leak back check valve with new or ring. Primed system with hand primer.

Supp.	Part	Description / Ref Number	U/M	Quantity	List	Price	Extended Price
CT	1052508	PUMP AS	PC	1.0	\$183.45	\$119.66	\$119.66
LP	11186-14	O'RING NO.116 3/4 I.D.	EA	1.0	\$1.15	\$0.71	
CT	1P0436	GASKET	PC	1.0	\$2.07	\$1.34	\$0.71
СТ	2812725	VALVE GP	PC	1.0	\$47.44		\$1.34
	Shop Sup	Shop Supplies	10			\$30.95	\$30.95
		and asking		1.0	\$0.00	\$27.22	\$27.22
			Task 3 Subtotals	Parts: Labor:			\$152.66
							\$302.40
				Miscellaneo	ous:		\$27.22
				Task 3 Subto	tals		\$482.28

Task: 4 000000 Engine System

Complaint: Truck starts up and jerks like the timing is off.

Correction: Looked into customer complaint. Addressed on task 3 with hand priming pump.

_	De	par	tmei	nt:	Sen	vice
		bear.			001	1100

Supp. Part	Description / Ref Number	U/M	Quantity	List	Price	Extended Price
Shop Sup	Shop Supplies		1.0	\$0.00	\$8.51	\$8.51
	Task	Task 4 Subtotals	Par	ts:		\$0.00
			Lab	or:		\$94.50
			Miscellaneou	IS:		\$8.51
			Task 4 Subtota	als		\$103.01

Task: 5 000001 Electronic Tool Hook up Complaint: Check for HP uprate options.

Department: Service

Correction: Check for uprate options. Can be uprated to 550. Advised customer. Get download off SIS Web and install 270 7085. Uprate to 550 HP at 1850ftlb. Set fuel settings for uprate.

Supp.	Part	Description / Ref Number	U/M	Quantity	List	Price	Price
	Shop Sup	Shop Supplies		1.0	\$0.00	\$34.02	\$34.02
	Sublet	HP Uprate		1.0	\$0.00		\$500.00
			Task 5 Subtotals	Parts	i.		\$0.00
				Labor			\$378.00
				Miscellaneous	c c		\$534.02
				Task 5 Subtotals	s		\$912.02

Task: 6 000000 Express Lube - CAT, N14, M11, S-60

Department: Service

Complaint: Express lube service.
Correction: Performed service per sheet.

Supp.		Description / Ref Number	 U/M	Quantity	List	Price	Extended Price
HA	105841EXX	GREASE XHP 222	EA	3.0	\$4.99	\$3,46	\$10.38



WKI Wichita Kenworth

5115 N. Broadway Wichita, KS 67219 (316) 838-0867 Invoice: 01S13221

Date / Hour: 5/9/2022 12:03:07PM

Repair Order: 13221 Customer: 10124 Branch: Wichita Total Invoice: \$ 9,089.72

Page 3 of 7

Bill To:

Rohloff Construction 1030 N Washington

Cash Acct
Wichita, KS 67214

Ship To: Rohloff Construction

1030 N Washington **Cash Acct** Wichita, KS 67214

Work: (316) 641-8095

Shop: 316-641-8095

Custom	er P/O:	Dena Sampson	Orig R/O	. 0	Complet	ion Date: 5/	6/2022
СТ	1R0749	FILTER AS FU	PC	1.0	\$33.41	\$21.79	\$21.79
CT	1R1808	FILTER-OIL HIGH EFF	PC	1.0	\$53.24	\$34.72	\$34.72
CT	2568753	FILTER AS SE	PC	1.0	\$38.96	\$25.42	\$25.42
UN	7880	BULK ECO ULTRA 15W40	QT	44.0	\$6.16	\$6.00	\$264.00
XX	COUPON	CREDIT	EA	-1.0	\$0.02	\$12.31	(\$12.31)
UN	R2299	OIL SAMPLE BOTTLE	EA	1.0	\$0.02	\$0.01	\$0.01
PC	TS200	STRIP-UNIVERSAL 3 WAY TEST (25 STRIPS)	EA	1.0	\$7.77	\$0.99	\$0.99
	Shop Sup	Shop Supplies		1.0	\$0.00	\$9.45	\$9.45
		Task 6 Subtotals		Pa	irts: \$34		\$345.00
				Lal	oor:		\$105.00
			M	iscellaneo	ous:		\$9.45
			Tas	k 6 Subto	tals		\$459.45

Task:	7	000001	Repair	Verification/Test Drive
-------	---	--------	--------	-------------------------

Complaint: Repair Verification/Test Drive

Repair Verification/ lest Drive	Department: Service			
st Drive	•			
	Extended			

Supp.	Part	Description / Ref Number	U/M	Quantity	List	Price	Price
			Task 7 Subtotals	Parts:		\$0.00	
				Labor:		\$1	89.00
				Task 7 Subtotals		\$1	89.00

Task: 8 010000 A/C System - Diagnose

Department: Service

Complaint: Check A/C system performance and advise.

Correction: A/C system cools to 46 degrees while ambient is 63 degrees. All fan speeds and bled doors work properly. Fan hub stays at similar sped to hub. When key off, hub does spin, but is stiff. Fan belts worn and walking in pulleys. Fan needs replaced. Pressures at 125 for HP and 40 to 18 for LP. No good air flow through cooling pack. There is no evidence of leaks. Drained coolant. Found drain valve broken. Disconnected everything and set condenser off to the side held by bungee cord. Unbotted radiator and used the A frame to remove it. Set up blocks and rested the radiator on them. Removed fan blade and shroud. Found a couple of bad spots and there is a lot of build-up in the radiator. Washed out the front and found a core broken away. Leak tested the CAC and pressurized to 25 psi and it held. Washed out CAC and blew out with shop air. Sent radiator out to repair shop. Installed fan shroud. Installed radiator. Installed new fan blade and support bars. Tightened hose clamps and installed A/C condenser. Installed CAC pipes. Installed hood springs and cables. Filled cooling system. Washed engine.

Supp.	Part	Description / Ref Number	U/M	Quantity	List	Price	Extended Price
LP	632	3/8-16 X 1 GRD 8 BOLT	EA	1.0	\$0.61	\$0.37	\$0.37
LP	636	3/8-16 X 2 GRD 8 BOLT	EA	1.0	\$1.25	\$0.77	\$0.77
LP	82292	3/8 PETCOCK I/S BRS FTG	EA	1.0	\$31.59	\$19.44	\$19.44
LP	88435	1/4 SAE TRU-TORQ FLAT WASHER	EA	4.0	\$0.15	\$0.09	\$0.36
LP	88437	3/8 SAE EXTRATHICK F/WASHER	EA	1.0	\$0.29	\$0.18	\$0.18
LP	88441	5/8 SAE TUR-TORQ FLAT WASHER	EA	2.0	\$1.06	\$0.65	\$1.30
PC	905200-32	FAN-ACS 32 8 BLADE	EA	1.0	\$286.88	\$200.82	\$200.82
LP	A106	5/8 USS NUT	EA	2.0	\$1.09	\$0.67	\$1.34
LP	A530	3/8 GRD 8 HD L/WASHER	EA	1.0	\$0.15	\$0.09	\$0.09
LP	A534	5/8 L/WASHER	EA	2.0	\$0.68	\$0.42	\$0.84
				** 0 .			~

** See Last Page for Invoice Total *



WKI Wichita Kenworth

5115 N. Broadway Wichita, K\$ 67219 (316) 838-0867 Invoice: 01S13221

Date / Hour: 5/9/2022 12:03:07PM

Repair Order: 13221 Customer: 10124 Branch: Wichita

Total Invoice: \$ 9,089.72

Page 4 of 7

Bill To:

Rohloff Construction

1030 N Washington **Cash Acct** Wichita, KS 67214 Ship To: Rohloff Construction

1030 N Washington

Cash Acct Wichita, KS 67214

Work: (316) 641-8095

Shop: 316-641-8095

Customer P/O:		Dena.Sampson Orig R/O:		0: 0	Completion Date: 5/6/2022			
PC	CT05317	TIE-CABLE 50LB 15.5 BLK	EA	12.0	\$0.22	\$0.14	\$1.68	
DYC	HE8813	HOSE RADIATOR OVERFLOW	FT	5.0	\$1.83	\$1.24	\$6.20	
NF	HEXHEADST	MISC SELF-TAPPING S/M SCREW	EA	4.0	\$0.50	\$0.36	\$1.44	
PC	P037ST-PAS	RING-RETAINING	EA	2.0	\$1.76	\$1.23	\$2 46	
PC	RC1030	CAP-RADIATOR 10 PSI	EA	1.0	\$12.60	\$9.65	\$9.65	
	Freight Gd	Paccar ground freight		1.0	\$0.00	\$30.00	\$30.00	
	Hazard	Hazardous Materials		1.0	\$0.00	\$50.00	\$50.00	
	Shop Sup	Shop Supplies		1.0	\$0.00	\$156.49	\$156.49	
	Sublet	Radiator repair		1.0	\$0.00	\$2,622.00	\$2,622.00	
		Task 8 Subtotals		Parts.		\$246.94		
					Labor		\$1,738.80	
			Miscellane		ous:	\$2,858.49		
			Ta	sk 8 Subto	tals	\$	4,844.23	

Task: 9 000000 Engine System

Complaint: Chirp in front of engine area

Correction: Loosened up adjuster nut and removed A/C belts. Loosened up bolts on fan hub and used adjuster bolt to lower fan hub. Removed fan belts and installed new ones and adjusted till tight. Installed new A/C belts and then adjusted them till tight.

	Part	Description / Ref Number	U/M	Quantity	List	Price	Extended Price
PC	17590BLT	BELT-V 17/32 TW X59EL SGL	EA	1.0	\$19.83	\$11.56	\$11.56
LOYA	ALTY CARD: Y1703						
PC	17590BLT	BELT-V 17/32 TW X59EL SGL	EA	1.0	\$19.83	\$11.56	\$11.56
LOYA	ALTY CARD: Y1703						
PC	22550BLT	BELT-V 22/32TWX55EL SGL	EA	1.0	\$28.94	\$16.87	\$16.87
LOYA	ALTY CARD: Y1703						
PC	22550BLT	BELT-V 22/32TWX55EL SGL	EA	1.0	\$28.94	\$16.87	\$16.87
LOYA	ALTY CARD: Y1703						
	Shop Sup	Shop Supplies		1.0	\$0.00	\$17.01	\$17.01
		Tas	k 9 Subtotals	Parts:		\$56.86	
				Lat	oor:		\$189.00
				Miscellaneo	us:		\$17.01
				Task 9 Subto	tals		\$262.87

Task: 10 020001 Clutch - Clutch Assembly - Adjust Complaint: Perform clutch adjustment

Correction: Removed inspection plate on trans. Adjusted clutch till 1/2 and 1/8 at throughout bearing to clutch brake and release fork to throughout bearing. Has a little more than 2" free pedal. Put inspection plate back on and tightened it down.

		\$0.00	\$17.01	\$17.01
U/M	Quantity		Price	Price
	U/M	U/M Quantity	U/M Quantity List	U/M Quantity List Price

Department: Service

Department: Service