

Date	A/R Acct#	Page#
03/31/24	939791	1

HARRY'S FARM TIRE - MENONA
P.O. Box 307

HARRY'S FARM TIRE - MENONA
P.O. Box 307

| ALL PAYMENTS ARE DUE APR 10, 2024

WENONA, IL 61377

03/31/24

WENONA, IL 61377

939791

JOHN HUGHES
1767 NORTH IL ROUTE 23

JOHN HUGHES
1767 NORTH IL ROUTE 23

STREATOR, IL 61364

STREATOR, IL 61364

(815)822-3965

<<< Invoice >>>			Purchase	Net	Current	M.D.	Future	Past	Invoice	Amount
Date	Id	Code	Order	Tot Due	Due	Code	Due	Due	Id	Due
03/19/24	K74367	I		8045.00	8045.00				K74367	8045.00
				*****					*****	
SUBtotal Amounts				8045.00	8045.00				Current Due	8045.00

Tires
8410

Current	> 30days	> 60days	> 90 Days	> 120 days	
8045.00	0.00	0.00	0.00	0.00	<<< Account Age Analysis

8045.00



29987 N 300 East Rd
 Streator, IL 61364
 Phone: 815-673-4320

Dixon, IL 815-288-4441
 Freeport, IL 815-233-1216
 Geneseo, IL 309-944-2101
 Lacon, IL 309-248-2845
 Mendota, IL 815-539-6724
 Pontiac, IL 815-842-1149
 Princeton, IL 815-875-3838
 Streator, IL 815-673-4320



SERVICE INVOICE

Invoice To Account No: 71533

JOHN L HUGHES
 1767 STATE ROUTE 23 N
 STREATOR IL 61364

Bus Phone:
 Prv Phone: 815-249-6892

Invoice Number: **32416**
 Invoice Date: **04/28/2021**
 Location: **07**
 Work Order Number: **335055**
 Payment Type: **Finance**

Page: **1 of 2**

Make/Model:	Meter	Serial Number:	EQ Id:	Fleet No:
John Deere 8410	3870	RW8410P006863	49382KSR	

Service Reminders:

GEN-1 Retail

COMPLAINT:

01 HYDRAULIC LINE UNDER TRACTOR LEAKING

CORRECTION:

Traveled to customer south of Ottawa. Removed the back cab panel and blew out all the loose dirt and debris from under the cab to get a better look at what was leaking. Found the load sense line from the pump up to the valve stack had a hole in it. Removed hose and took customer into town (Ottawa) where he works so he could make a new hose. Returned and installed the new hose. Thinking the tractor was low on oil I added 5 gallons of oil since the sight glass was cloudy and I couldn't see oil. Ended up over filling it so I had to drain the 5 gallons back out to get the tractor to the correct oil level. Left that 5 gallons with the customer but didn't charge it to the ticket.

PartNumber	Description	Quantity	Net Price	Extended Price	Taxed Ind
T77613	O-RING	1.00	1.37	\$1.37	N
T77857	O-RING	1.00	1.41	\$1.41	N

Labor: \$476.30 Parts: \$2.78 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$479.08

/SERVICE CALL Retail

COMPLAINT:

02 SERVICE CALL

CORRECTION:

Miscellaneous	Description	Quantity	Net Price	Extended Price	Taxed Ind
SERVICE CALL	SC FEE	1.00	75.00	\$75.00	N

Miscellaneous Charges:

SERVICE ACCESSORIES \$8.00

Labor: \$0.00 Parts: \$0.00 OL&M: \$0.00 Misc: \$83.00 Sub-Total: \$83.00



PRAIRIE STATE TRACTOR

2001 N 501 East Rd
Stream N 51104
Phone: 815 875 4100

Dixon, IL 815 288 4444
Freeport, IL 815 255 1210
Holt, IL 815 288 2101
Lancaster, IL 815 288 2248
Mantoloking, IL 815 288 2728
Pekin, IL 815 288 1148
Ponca, IL 815 288 2448
Stream N 815 875 4100



SERVICE INVOICE

Invoice To Account No: 7155

JOHN DEERE PRAIRIE STATE TRACTOR 2001 N 501 EAST RD STREAM N 51104 PHO: 815 875 4100	Invoice Number: 32418 Invoice Date: 04/28/2021 Location: 07 Work Order Number: 33088 Payment Type: Finance
	Page: 2 of 2

Make	Model	Serial Number	EOM	Fleet No.
JOHN DEERE	8410	111111111111111111	4/28/2021	

Service Number:

Checkbook ID No:
Tax Exempt No: ON FILE

8410

Labor:	\$476.30
Parts:	\$2.78
OLAM:	\$0.00
Misc:	\$83.00
Sales Tax:	\$0.00
Total:	\$562.08

TERMS AND CONDITIONS

This invoice is subject to the terms of the Multi-Line Account a service of John Deere Financial, f.e.b. I grant the issuer a purchase money security interest as limited in this agreement, in the goods described.

Signature:

Date:



29987 N 300 East Rd
Streator, IL 61364
Phone: 815-673-4320
Fax: 815-672-4247

Pontiac, IL 61784
815-842-1149

Lacon, IL 61540
309-248-2845

www.ksequipment.com



JOHN DEERE

Invoice To Account No: 32160

SERVICE INVOICE

JOHN HUGHES
1767 STATE ROUTE 23 N
STREATOR IL 61364

Invoice Number: 456297
Invoice Date: 02/19/2020
Location: 2
Work Order Number: 79194
Payment Type: Finance
Page: 1 of 6

Make/Model:	Meter	Serial Number:	EQ Id:	Fleet No:
JOHN DEERE 8410	3714	RW8410P006863	38772W	

Service Reminders:
INSPECTION Retail

COMPLAINT:
01 TRACTOR INSPECTION \$449.00

10% DEALER INSTALLED PARTS OVER \$250

CAUSE:
CORRECTION:
Looked the tractor over and found.

Cab
All of the back lighting in the SCV control is out making it hard to see.
Codes none
Headliner is all cut up.
The outside cab filter is dirty.

Lights
Both left and the outside right roof work lights are out.
Front left amber roof light is out
Both right amber roof lights are out

Engine
The front engine dampener is factory, it has a recommended change of 5 years 4500 hours. It looks ok just noticed it.
Looks like the water pump has never been done. It is at and hour area where we see this fail. There is also no coolant in the coolant tank on top of the engine. Could be a leak or burning it.
The fan belt has a cut and a few small holes in it.
The injectors look like they have never been out and tested and base on the hours it wouldn't hurt them to get checked.
Valve cover is leaking a little and the valves should be adjusted does not look like the cover has ever been off.
Aux drive belt is showing some cracking.

Drive train
Right rear axle shaft seal looks like it is collecting dirt don't think it is enough to change but should be watched.
Hydraulic oil filter is marked 2266 hrs 2/11. Are records don't show the oil ever being changed and it should have been changed at 1500 and 3000 hours.
Front axle oil and hub oil also has no record of being changed and should have been done at 1500 and 3000 hours.

I have not looked into the light staying on at this time.

Washed the tractor where the hood will cover and then installed the hood and side shields.

Labor: \$449.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$449.00
-----------------	---------------	--------------	--------------	---------------------

Gen1 Retail

COMPLAINT:
02 RIGHT FLASHER STAYS ON. JOHN HAS BEEN PULLING THE FUSE TO SHUT OFF.
FRONT INJECTOR RETURN LINE LEAKING.

PLEASE REPLACE CCU/PCU

CAUSE:
CORRECTION:



29987 N 300 East Rd
 Streator, IL 61364
 Phone: 815-673-4320
 Fax: 815-672-4247

Pontiac, IL 61764
 815-842-1149

Lacon, IL 61540
 309-248-2845

www.karequipment.com



JOHN DEERE

Invoice To Account No: 32160

SERVICE INVOICE

JOHN HUGHES
 1767 STATE ROUTE 23 N
 STREATOR IL 61364

Invoice Number: 456297
 Invoice Date: 02/19/2020
 Location: 2
 Work Order Number: 79194
 Payment Type: Finance
 Page: 2 of 6

Make/Model:	Meter	Serial Number:	EQ Id:	Fleet No:
JOHN DEERE 8410	3714	RW8410P006863	38772W	

Service Reminders:

Looked into the right flasher and after testing it looks like it needs a new CCU. The problem is the controller opens and closes the ground for the relay that operates the light with the controller plugged in there is a ground all the time why the light stays on. If it is unplugged the wire test good with no shorts to ground. You can't get just the CCU i will have to get a CCU/PCU and this will mean the transmission will need to be calibrated as well.

Got a "new" CCU/PCU and installed it to find that it had been used and I couldn't change the engine hours to match this tractor. Talked to dawn and she made a parts case, they wanted it returned and would send a different one.

Install the second CCU/PCU and input all addresses that where need to make it work on this tractor. All data saved how I had it. Tested the lights and they worked as they should. Took the tractor out and warmed the oil then ran the calibration 3 times to get the best cal. Tested on the lot and it shifted very nice. Cleared all codes that where stored.

Well i was heating the oil i found that SCV #1 was leaking oil. Moved to a different SCV to continue the calibration, looked into the problem and fixed it on segment 4.

PartNumber	Description	Quantity	Net Price	Extended Price	Taxed Ind
RE219440	Vehicle Controller	1.00	\$1,681.73	\$1,681.73	N
RE219440-CR	CORE for:Vehicle Controller	-1.00	\$100.00	-\$100.00	N

Labor: \$443.19 Parts: \$1,581.73 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$2,024.92

Gen10 Retail

COMPLAINT:
 03 BACK LIGHTING IN THE SCV CONTROL

CAUSE:
 CORRECTION:
 Removed the SCV display and disassembled changed out all back lighting and then tested all looked good reassembled and installed in the tractor.

PartNumber	Description	Quantity	Net Price	Extended Price	Taxed Ind
R107890	BULB	5.00	\$2.43	\$12.15	N

Labor: \$83.85 Parts: \$12.15 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$96.00

/HYD FLUID & FILTER Retail

COMPLAINT:
 04 SERVICE HYDRAULIC OIL AND FILTERS
 CLEAN SUMP SCREEN

CAUSE:
 CORRECTION:
 Drained all the oil from the tractors transmission and rear end. Pulled the sump screen and trans screen both where clean. Put them back in and then drain plugs. Changed oil filter and marked it with the date and hours. Filled with oil then ran to move the oil around and fill everything. Topped off the oil after running and checked for leaks.

While warming the oil to calibrate the transmission I found that the SCV's were leaking oil. Looked into it and the o-rings on the SCV #1 where falling apart. All of them where the old style o-ring so I updated all to the new o-ring and cleaned the drain out. Checked oil after fixing and topped off as needed.

PartNumber	Description	Quantity	Net Price	Extended Price	Taxed Ind
B3690R	O-RING	3.00	\$4.10	\$12.30	N



29987 N 300 East Rd.
Streator, IL 61364
Phone: 815-673-4320
Fax: 815-672-4247

Pontiac, IL 61784
815-842-1149

Lacon, IL 61540
309-246-2845

www.ksequipment.com



JOHN DEERE

Invoice To Account No: 32160

SERVICE INVOICE

JOHN HUGHES
1767 STATE ROUTE 23 N
STREATOR IL 61364

Invoice Number: 456297
Invoice Date: 02/19/2020
Location: 2
Work Order Number: 79194
Payment Type: Finance
Page: 3 of 6

Make/Model:	Meter	Serial Number:	EQ Id:	Fleet No:
JOHN DEERE 8410	3714	RW8410P006863	38772W	

Service Reminders:

Part Number	Description	Quantity	Net Price	Extended Price	Taxed Ind
H63262	O-RING	1.00	\$2.40	\$2.40	N
R83630	O-RING	8.00	\$1.93	\$15.44	N
RE174130	OIL FILTER	1.00	\$85.71	\$85.71	N
TY22028	HY-GARD	151.00	\$3.06	\$462.06	Y

Labor: \$374.90 Parts: \$577.91 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$952.81

Gen2- Retail

COMPLAINT:
05 FRONT AXLE HUB OIL CHANGED

CAUSE:
CORRECTION:
Jacked up the front end and turned wheels so the plugs where down. Removed the plugs and let the hubs drain while other work was being done. Turned the wheels so the fill line was level then filled with new 85-140 gear oil.

Drain oil out of the axle and then filled with hydraulic oil it is on seg4.

PartNumber	Description	Quantity	Net Price	Extended Price	Taxed Ind
TY26812	LUBRICANT	2.00	\$21.47	\$42.94	Y

Labor: \$127.20 Parts: \$42.94 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$170.14

Gen3- Retail

COMPLAINT:
06 WATER PUMP

CAUSE:
CORRECTION:
Drained the coolant, about 5 gallons. It was very dirty. Removed water pump cover and the thermostat housing. Pulled the old water pump that still had a plastic impeller. Cleaned the weep whole and then sealing area for the water pump. Lubed the o-ring on the new water pump with soap and pressed the pump into the front cover. Checked to make sure the snap ring popped into place. Cleaned the gasket surface of the cover and the thermostat housing and installed new seals for the bypass tube. Installed new thermostats then put the cover and housing back on the tractor. Filled the system with clean water and Mac's radiator cleaner. Pulled the tractor outside and let it run for about an hour then drained it over night. Filled the system with new coolant and will run to work air out when the other work is done.

Topped off the system after running.

PartNumber	Description	Quantity	Net Price	Extended Price	Taxed Ind
AR48675	THERMOSTAT	2.00	\$10.87	\$21.74	N
R119383	GASKET	1.00	\$16.82	\$16.82	N
R136063	SEAL	1.00	\$11.04	\$11.04	N
R136151	SEAL	1.00	\$10.99	\$10.99	N
RE521502	WATER PUMP	1.00	\$484.39	\$484.39	N
RE521502-CR	CORE for: Pump Kit	-1.00	\$50.00	-\$50.00	N
RE57190	SEAL	2.00	\$8.66	\$17.32	N
TY26576	COOL-GARD TM	4.00	\$32.21	\$128.84	Y

Labor: \$528.86 Parts: \$641.14 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$1,170.00

Gen8 Retail



29987 N 300 East Rd
 Streator, IL 61364
 Phone: 815-673-4320
 Fax: 815-672-4247

Portia, IL 61784
 815-842-1149

Lacoh, IL 61540
 309-248-2845

www.ksequipment.com



JOHN DEERE

Invoice To Account No: 32160

SERVICE INVOICE

JOHN HUGHES
 1767 STATE ROUTE 23 N
 STREATOR IL 61364

Invoice Number: 456297
 Invoice Date: 02/19/2020
 Location: 2
 Work Order Number: 79194
 Payment Type: Finance
 Page: 4 of 6

Make/Model:	Meter	Serial Number:	EQ Id:	Fleet No:
JOHN DEERE 8410	3714	RW8410P006863	38772W	

Service Reminders:

COMPLAINT:

08 INJECTORS TESTED/ please replace with new

CAUSE:

CORRECTION:

Pulled the injectors and tested. #1 3300 psi ok spray #2 3350 psi ok spray #3 3200 psi bad spray #4 3400 psi ok spray #5 3350 psi ok spray #6 3400 psi ok spray. Should be at 3800 psi and normally if I bump up the pressure with adjustment the spray gets bad. Recommend changing all with new or reman.

Ordered 6 new injectors. Cleaned the injector holes in the head to get a good seal. Installed the compression seal on the bottom of the injector and then installed them in the head. Torqued the injectors to spec and made sure they where a lined like they should be. Installed new leak off connectors on all injectors and then installed the leak off line. Installed injection lines and put the intake tube back in place. Started the tractor and checked for leaks all looked good.

PartNumber	Description	Quantity	Net Price	Extended Price	Taxed Ind
R51936	WASHER	3.00	\$1.33	\$3.99	N
R79604	TUBE NUT	6.00	\$3.27	\$19.62	N
RE501970	FITTING	6.00	\$8.51	\$51.06	N
RE61593	NOZZLE HOLDE	6.00	\$164.36	\$986.16	N
RE61593-CR	CORE for:Nozzle Holder	-6.00	\$10.00	-\$60.00	N

Labor: \$508.91 Parts: \$1,000.83 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$1,509.74

Gen9 Retail

COMPLAINT:

09 VALVE COVER LEAK

CAUSE:

CORRECTION:

Cleaned around the valve cover so the dirt wouldn't fall into the engine. Removed the valve cover and found engine was lock on TDC #6 so i checked adjusted the valves as needed. Then rolled the engine to TDC #1 and checked and adjusted the valves as needed. Cleaned the valve cover and then the top of the head and installed a new seal and put the valve cover back in place.

PartNumber	Description	Quantity	Net Price	Extended Price	Taxed Ind
RE54368	GASKET	1.00	\$46.21	\$46.21	N

Labor: \$106.25 Parts: \$46.21 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$152.46

Gen- Retail

COMPLAINT:

10 AUX DRIVE BELT REPLACE

CAUSE:

CORRECTION:

General Repairs

Removed alternator and bracket to get the old belt out and then installed the new belt and returned the Alternator and brackets that had to be moved.

PartNumber	Description	Quantity	Net Price	Extended Price	Taxed Ind
R157687	V-BELT	1.00	\$52.57	\$52.57	N



29987 N 300 East Rd
 Streator, IL 61364
 Phone: 815-673-4320
 Fax: 815-672-4247

Pontiac, IL 61764
 815-842-1149

Lacon, IL 61540
 309-248-2645

www.ksrequipment.com



JOHN DEERE

Invoice To Account No: 32160

SERVICE INVOICE

JOHN HUGHES
 1767 STATE ROUTE 23 N
 STREATOR IL 61364

Invoice Number: 456297
 Invoice Date: 02/19/2020
 Location: 2
 Work Order Number: 79194
 Payment Type: Finance
 Page: 5 of 6

Make/Model:	Meter	Serial Number:	EQ Id:	Fleet No:
JOHN DEERE 8410	3714	RW8410P006863	38772W	

Service Reminders:

Labor: \$66.30 Parts: \$52.57 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$118.87

Gen4- Retail

COMPLAINT:
 11 DAMPENER REPLACEMENT

CAUSE:

CORRECTION:

Removed the fan belt then removed the hardware holding the fan support and installed studs. Moved the support away from the block so there was room to removed the fan drive form the dampener and then the dampener. Installed puller and pulled the dampener out to find that the front seal was leaking. Had a hard time getting the front seal out but was able to. Removed the old wear ring cleaned the area then installed new wear ring and seal using the special tools. Installed the new dampener and torqued to spec. Put drive in place and installed a new fan belt. Pushed the fan support back onto place and installed the hardware.

PartNumber	Description	Quantity	Net Price	Extended Price	Taxed Ind
AR49025	SEAL	1.00	\$24.60	\$24.60	N
R131213	BELT	1.00	\$52.64	\$52.64	N
R26333	WASHER	1.00	\$6.30	\$6.30	N
R523306	KEY	1.00	\$8.27	\$8.27	N
R79846	CAP SCREW	1.00	\$2.30	\$2.30	N
RE57603	Torsional Da	1.00	\$335.35	\$335.35	N

Labor: \$703.53 Parts: \$429.46 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$1,132.99

Gen5- Retail

COMPLAINT:
 12 LIGHTS

CAUSE:

CORRECTION:

After getting the right amber lights working like they should I tested and found that the roof lights still didn't work. The front one needed new terminals both need a bulb and a housing b/c the threads pulled out of the old one. The left front roof amber needed a bulb and housing. Changed all the work lights on the cab roof well they where out. Tested all lights after install and everything worked as it should.

PartNumber	Description	Quantity	Net Price	Extended Price	Taxed Ind
21M7305	SCREW	6.00	\$0.44	\$2.64	N
57M7519	ELEC. CONN	2.00	\$0.70	\$1.40	Y
R161288	LAMP	4.00	\$46.09	\$184.36	N
RE49778	BULB	3.00	\$1.31	\$3.93	N
RE55150	LAMP	1.00	\$58.90	\$58.90	N
RE55151	LAMP	2.00	\$58.90	\$117.80	N

Labor: \$185.88 Parts: \$369.03 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$554.91

Gen7 Retail

COMPLAINT:
 13 10% DEALER INSTALLED PARTS DISCOUNT PROMOTION THROUGH JOHN DEERE

CAUSE:



29987 N 300 East Rd
 Streator, IL 61364
 Phone: 815-673-4320
 Fax: 815-672-4247

Pontiac, IL 61764
 815-842-1149

Lacon, IL 61540
 309-246-2645

www.ksrequipment.com



JOHN DEERE

Invoice To Account No: 32160

SERVICE INVOICE

JOHN HUGHES
 1767 STATE ROUTE 23 N
 STREATOR IL 61364

Invoice Number: 456297
 Invoice Date: 02/19/2020
 Location: 2
 Work Order Number: 79194
 Payment Type: Finance
 Page: 6 of 6

Make/Model:	Meter	Serial Number:	EQ Id:	Fleet No:
JOHN DEERE 8410	3714	RW8410P006863	38772W	

Service Reminders:
 CORRECTION:

Miscellaneous	Description	Quantity	Net Price	Extended Price	Taxed Ind
JD SERVICE SPECIAL	John Deere Service Coupon/Rebate 10% parts discount - Deere Promotion	1.00	-\$410.50	-\$410.50	N
Labor: \$0.00	Parts: \$0.00	OL&M: \$0.00	Misc: -\$410.50	Sub-Total: -\$410.50	

Service Accessories Retail

COMPLAINT:
 14 SERVICE ACCESSORIES

CAUSE:
 CORRECTION:
 SERVICE ACCESSORIES FOR COMPLETE REPAIR ORDER.
 INCLUDES SHOP SUPPLIES, MISC. LUBRICANTS, WELDING SUPPLIES IF NEEDED, TORCH SUPPLIES IF NEEDED ETC.

Miscellaneous	Description	Quantity	Net Price	Extended Price	Taxed Ind
Service Accessories	Service Accessories	1.00	\$54.15	\$54.15	N
Labor: \$0.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$54.15	Sub-Total: \$54.15	

Finance Information

Customer PO No:
 Tax Exempt No: ON FILE
 Advisor: CHERYL MCMICHAEL

8410

Labor:	\$3,577.87
Parts:	\$4,753.97
OL&M:	\$0.00
Misc:	-\$356.35
Sales Tax:	\$46.05
Total:	\$8,021.54

TERMS AND CONDITIONS

This purchase(s) is subject to the terms of the Multi-Use Account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.

Received by:

Date: