



Invoice #7560

3B's Towing Inc

Page:1

Phone: 402-238-2844

Vehicle : 2011 Ram 4500HD 6.7 L 408 CID L6 Cummins ISB-07 Diesel
 VIN : 3D6WU7EL0BG560197
 Fleet #/Driver :
 Created : 1/29/2024 2:36:41 PM CST
 Invoiced : 3/12/2024 10:39:24 AM CDT

Service Writer : 4
 Tag/State : MATER1/NE
 Odometer In : 377335
 Odometer Out : 377596

Labor/Notes

Qty	Technician	Description	Unit Price	Price
1	10	CUSTOMER STATES THE COOLING SYSTEM IS SLOWLY GETTING OIL IN THE COOLANT. THE VEHICLE WAS INSPECTED AND THE CUSTOMER'S CONCERN WAS VERIFIED. THERE WAS A LARGE AMOUNT OF OIL IN THE RADIATOR WHEN REMOVING THE RADIATOR CAP. THE COOLING SYSTEM WAS INSPECTED FOR ANY OBVIOUS CONCERNS AND THERE WERE NONE PRESENT OTHER THAN THE OIL IN THE COOLANT. THE ENGINE OIL WAS INSPECTED AND WAS AT THE PROPER LEVEL AND WAS NOT MILKY OR DILUTED. A ROAD TEST WAS PERFORMED TO INSPECT FOR A LEAKING HEAD GASKET AND THERE WAS NO CONCERN FOUND. IT IS SUSPECTED THE OIL COOLER IS LEAKING OIL INTERNALLY INTO THE COOLANT AND IS BUILDING UP IN THE RADIATOR. THE CUSTOMER WAS INFORMED THAT THE OIL COOLER IS LEAKING AND WILL NEED TO BE REPLACED ALONG WITH A COOLING SYSTEM FLUSH. THE CUSTOMER REQUESTED THE REPAIRS BE COMPLETED. AFTER THE REPAIRS WERE COMPLETED THE COOLING SYSTEM WAS FLUSHED WITH THE FLEETGUARD COOLING SYSTEM CLEANER TO REMOVE ALL OIL RESIDUE FROM THE COOLING SYSTEM. WHEN FLUSHING THE COOLING SYSTEM THERE WAS A SLIGHT SMELL OF WARM BRAKES FROM THE FRONT END. IT WAS CONFIRMED THAT THE PASSENGER FRONT BRAKE IS SLIGHTLY STICKING AND GETTING WARM. THE CUSTOMER WAS INFORMED AND STATED THEY WOULD MAKE THE REPAIRS ON THE BRAKES ON THEIR OWN AND WOULD TAKE THE VEHICLE AS IS.	\$240.00	\$240.00
3.5	10	REMOVE AND REPLACE OIL COOLER WITH NEW GASKETS.	\$160.00	\$560.00
5	10	FLUSH COOLING SYSTEM WITH FLEETGUARD COOLING SYSTEM CLEANER, VACUUM FILL WITH RED ELC COOLANT	\$160.00	\$800.00
1.5	10	REPLACE ABS SENSOR	\$160.00	\$240.00

Parts

Qty	Code	Description	Condition	Unit Price	Price
1		TURBOCHARGER HOSE KIT		\$168.65	\$168.65
1		O RING		\$11.60	\$11.60
1		OIL COOLER GASKET SET		\$46.41	\$46.41
1		2007.5-22 6.7 CUMMINS OIL COOLER		\$432.12	\$432.12
1		SEAL, O-RING		\$7.35	\$7.35
1		THERMOSTAT, 190 DEGREE		\$59.35	\$59.35
1		THERMOSTAT		\$77.93	\$77.93
1		2007.5-22 6.7 CUMMINS AIR FILTER		\$70.53	\$70.53



Invoice #7560

3B's Towing Inc

Vehicle: 2011 Ram 4500HD 6.7 L 408 CID L6 Cummins

Qty	Code	Description	Condition	Unit Price	Price
1		5.9/6.7 CUMMINS OIL FILTER DONALDSON BLUE		\$24.40	\$24.40
3.05		5W-40 CK-4 GALLON, BULK		\$35.90	\$109.50
1		FLEETGUARD RESTORE COOLANT SYSTEM CLEANER GALLON		\$49.28	\$49.28
2.85		NITRITE FREE EXTENDED LIFE COOLANT, CAT EC-1 RATED CONCENTRATE		\$22.87	\$65.18
60		DEIONIZED WATER, GALLON		\$0.99	\$59.40
1		FUEL, 27.033 GALLONS		\$100.00	\$100.00

Labor	\$1,840.00
Parts	\$1,181.70
Charges	\$100.00
Sales Tax	Sales Tax @ 7%	\$82.72

Total \$3,204.42

Check #2210: \$3,204.42

PAYMENT \$3,204.42

BALANCE DUE \$0.00

I hereby authorize the repair work herein set forth to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express garagekeeper's lien is hereby acknowledged on above vehicle to secure the amount or repairs thereto. All Vehicles left over 72 hrs. after repairs are completed WILL INCUR A \$15.00 PER DAY STORAGE FEE. 12 Month warranty on repairs.

Customer Signature _____

Customer Signature: _____