		PE	TERBILT	OF NOR	FOLK		SERVIC	E INVOICE
(Peterbilt)			2001 SOUTH 13TH STREET NORFOLK, NE 68701 Phone: (402) 844-4749 Fax: (402) 844 - 3920					055284:01
		a.r. c1						Number
		Phone	e: (402) 844-474	49 Fax: (402)	844 - 3920		P.0.	Number
	DG	Peterbilt	TruckCare Roa	adside Assis	t 800-473-837	2		
IDWEST PETERB S274	NLT GROUP		SERVICE		E			lce Date
							03/0	07/2023
	Bill-To Custo JERRYS SEI PO BOX 784 HARTINGTO	RVICE INC			Owner: 46574 JERRYS SERVI 505 N CEDAR A HARTINGTON,	VE		
	(402) 254-6	546			Engine Serial	4529	85505 Cust Unit # 60 386	
Date In	Date In Service	Mileage	Engine Hrs	Date Out	Bill Type	Terms	Writer	Reviewer
02/27/2023	10/04/2012	617,743	0	02/28/2023	SR	N10TH	DANCOMP	43058
0#2 PRESSURE	ILDING PRESSURE I	BUILDING PRESS						SR
Cause								
pre coo dis turt cra one Fin	040 - Ran truck up to a essure gauge and test blant system. Drained ver and removed valve connected connectors to mounting bolts. Ho cked between the inta e. Cleaned block surfa ished cleaning up sur d then torqued down in	ed with the combus coolant, removed e train. Disconnecto s. Unbolted fuel filte isted cylinder head ake valves. Ordere- nce and measured face. Installed new	stion tester in the s air cleaner asseml ed fuel lines and c er base from side o I from engine. Insp d new head and ho liner projection. Co head gasket and	surge tank. The oby, charge air p oolant lines from of engine and pu pected cylinder h ead gasket kit. S ustomer decided hoisted new cyl	fluid changed co ipes and upper ra- n engine. Pulled I ulled out of the wa nead and found c Swapped parts fro to just do head inder head into p	or showing c adiator tube. back wiring h ay. Removed ylinders 2, 4 bm old cylind gasket and c lace. Started	combustion in the Pulled off valve arness and I head bolts and and 6 were all er head to the new ylinder head. new head bolts	N

Qt	y Item	Description	Price Each	Extended
		LABOR TO PERFORM REPAIRS		4,650.00
1	114P/2190199PEX	CYLINDER HEAD, MX-13, EPA04/10	7,731.00	7,731.00
1	114P/1948921PE	PACCAR OIL ELEMENT	56.67	56.67
1	114P/1655115PE	PACCAR FUEL ELEMENT	71.66	71.66
1	114P/FS19727FLG	FILTER-FUEL	23.21	23.21
2	114P/3706TRP	CLAMP-HOSE AIR/FUEL SS #6	1.13	2.26
1	114P/1844253PE	GASKET-EXHAUST CIRCULAR 5"	14.94	14.94
1	114P/90-0013	CLAMP-V BAND 5"	14.42	14.42
1.10	114P/EC3555	COOLANT-TRP ELC 50/50 DRUM	9.79	10.77
10	114P/CT03316	TIE-CABLE 50LB 8" BLK	0.06	0.60
15	114P/CT05512	TIE-CABLE 120LB, 15.25" BLK	0.31	4.65
11	114P/500010048	OIL-ROTELLA T TRI P 15W40 CK4	23.96	263.56
-1	114P/2190199PEX-CORE	CYLINDER HEAD, MX-13, EPA04/10	2,100.00	-2,100.00
-1	114P/1861200PRX-CORE	FUEL PUMP, MX-13 EPA 10, REMAN	360.00	-360.00
2	114P/1830688PE	BOLT-FLANGE M10	1.11	2.22
1	114P/1745246PE	BOLT-FLANGE HEAT RESISTANT M10	9.10	9.10
2	114P/1264794PE	BUSHING-ADAPTER	3.35	6.70
2	114P/1738898PE	BRACKET	37.40	74.80
6	114P/1313120PE	BOLT-FLANGE M8X55	1.73	10.38
S	114P/1893478PE	SENSOR-TEMPERATURE CHARGE AIR	172.67	172.67
	114P/1638271PE	O-RING INJECTOR	6.95	41.70

.

MIDWEST

PETERBILT GROUP

S274

2001 SOUTH 13TH STREET

2001 SOUTH 13TH STREET NORFOLK, NE 68701 Phone: (402) 844-4749 Fax: (402) 844 - 3920

SERVICE INVOICE

RO114055284:01

P.O. Number

Peterbilt TruckCare Roadside Assist 800-473-8372

SERVICE INVOICE

Invoice Date 03/07/2023

60

Bill-To Customer: 46574 JERRYS SERVICE INC PO BOX 784 HARTINGTON, NE 68739

(402) 254-6546

505 N CEDAR AVE HARTINGTON, NE 68739

JERRYS SERVICE INC

Owner: 46574

 V.I.N
 1XPHPP9X3DD185505

 Engine Serial
 A101371

 Vehicle ID #
 144529
 Cust Unit #

 2013
 PETERBILT
 386

· · ·	Date In	Date In	n Service	Mileage	Engine Hrs	Date Out	Bill Type	Terms	Writer	Reviewer
02	/27/2023	10/04	4/2012	617,743	0	02/28/2023	SR	N10TH	DANCOMP	43058
1	114P/1805	233PE		GASKET-EXHA	UST TURBOCHA	RGER		22.01	22.0)1
4	114P/1866	163PE		NUT-HEX MET	RIC M10X1			31.49	125.9	6
1	114P/1904	646PE		FUEL PIPE AS	SEMBLY-HIGH PF	RES,		232.49	232.4	9
1	1141/63258	3		10-1.50 X 30 M	M HEX HD C/S 1	0		1.10	1.1	0
1	114P/2137	593PE		SENSOR-PRE	TURBO PRESSU	RE		118.49	118.4	9
2	114P/1844	625PE		RING-SEALING	S 22.0X13.0X1.5			1.32	2.6	4
1	114P/2140	883PE		GASKET SET,	CYLINDER HEAD	, MX-		742.37	742.3	7
26	114P/2301	199PE		BOLT CYLINDE	R HEAD, M18 X	200		32.40	842.4	0
7	114P/1822	941PE		BOLT-FLANGE	M12X155X80			5.44	38.0	8
1	114P/1861	200PRX		FUEL PUMP, M	X-13 EPA 10, RE	MAN		633.76	633.7	6
2	114P/1785	827PE		BUSHING-ADA	PTER			3.26	6.5	2
0.09	114P/1058	16EXX		M-DEL 1300S 1	5W40 BULK			18.30	1.6	5
1	1141/66058	3		8-1.25 MM HEX	NUT 10.9			0.85	0.8	5
1	114P/1922	496PE		PACCAR OIL E	LEMENT-CENTRI	FUGAL		62.11	62.1	1
1	114P/1861	200PRX-C	ORE	FUEL PUMP, M	X-13 EPA 10, REM	MAN		360.00	360.0	0
1	114P/2190	199PEX-C	ORE	CYLINDER HE	AD, MX-13, EPA04	/10		2,100.00	2,100.0	0
1	FRTRO			FREIGHT CHAI	RGED ON RO's			22.29	22.2	9
				PART IS ON RS	SV 11/03/2017					
Total La	bor 4,6	50.00	Total Parts	11,341.74	Total Other	22.29	Prepay	\$0.00	Job#2 Total	16,014.03

DISCLAIMER OF WARRANTIES

ANY WARRANTIES ON THE PRODUCTS SOLD HEREBY ARE THOSE MADE BY MANUFACTURER, IF ANY. THE SELLER HEREBY EXPRESSLY DISCLAIMS ALL WARRANTIES EITHER EXPRESS OR IMPLIED, INCLUDING ANY IMPLIED WARRANTY OR MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE, AND PETERBILT OF NORFOLK NEITHER ASSUMES NOR AUTHORIZES ANY OTHER PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF SAID PRODUCTS. WE HEREBY CERTIFY THAT THESE GOODS WERE PRODUCED IN COMPLIANCE WITH ALL APPLICABLE REQUIREMENTS OF SECTIONS 6, 7 AND 12 OF THE FAIR LABOR STANDARDS ACT OF 1938, AS AMENDED AND OF REGULATIONS AND ORDERS OF THE ADMINISTRATOR OR WAGE AND HOUR DIVISION ISSUED UNDER SECTION 14 THEREOF.

Please remit to: Sioux City Truck Sales, Inc. PO Box 386 Sioux City, IA 51102-0386

Parts : 11,398.03 Labor : 4,836.00 Sublet : 0.00 Prepay: \$0.00 Other Charges : \$22.29 **Misc Supplies :** 95.00 EPA Charge : 15.00 Sales Tax : 0.00

Total:

16,366.32

			and the second se						
reterb	ill)		2001 SOUTH	13TH STREE (, NE 68701	T		RO	114056027	7:01
		Phone:	(402) 844-474		44 - 3920		P	.O. Numbe	er
								60	
	J <u>G</u>	Peterbilt Tr	ruckCare Roa	dside Assist	800-473-837	2		60	
DWEST PETERB S274	NLT GROUP		0551405		-			nvoice Da	te
0214			SERVICE	INVOIC	E				
								06/02/2023	3
ាះស្	Bill-To Custo				Owner: 46574 JERRYS SERVIO				
	JERRYS SEF D PO BOX 784				505 N CEDAR A				
		N, NE 68739	20		HARTINGTON,	NE 68739			
E1364EX	e.		×						
	(402) 254-65	546				PP9X3DD18 101371	5505		
					Vehicle ID # 14	4529	Cust Unit #	60	
					2013 PETERBI		386		
Date In	Date In Service	Mileage	Engine Hrs	Date Out	Bill Type	Terms	Writer		viewer
05/23/2023	10/04/2012	628,529	834	05/24/2023	SR	N10TH	KATICOU	4.	3006
			Sold Op	perations		- Oter Source Const	in the state of the		-
b#1 SCOOLAN	I LEAK	COOLANT LEAK							SR
Cause 43 Correction 43 m cc cc cd fro he in	JSHING COOLANT - 3040 - Ran truck with p inutes. Removed pres onfirming combustion. over and rocker assem amps. Removed air co om engine along with t ead bolts and made su ispected for cracks. Fo	sure gauge and test Removed air cleane ablies. Drained coola ompressor lines and the harness brace o ure everything was d ound nothing wrong b	ted for combustion er, charge air pipe ant and pulled off disconnected fue n drivers side. Bo disconnected in or with the cylinder h	n gasses in the o s, cut loose wini coolant lines. Di I injector lines fr Ited up lifting bra der to pull off the nead but head ga	coolant system a ng harness from sconnected turbe om unit pumps a acket to back of t e cylinder head. asket was blown	nd the fluid cl side of engine o from manifo and pulled off he cylinder he Hoisted cylind out on cylind	hanged color e, removed va Id and took of fuel filter mod ead. Remove der head off a ers 1 and 2 w	alve fegr ule d nd here	
Cause 43 Correction 43 ccc cc cd. frc he in it all pr fr 3 te lin pr cc CC CC CC CC CC CC CC CC CC CC CC CC	3040 - Ran truck with p inutes. Removed pres onfirming combustion. over and rocker assem amps. Removed air co om engine along with the ead bolts and made su uspected for cracks. For was getting into the co lowable spec and the ull liner and inspect. D om the crankshaft and liners confirming the co est fit new liners to eac ner O rings to cylinders iston heads with new r connecting rods to the of Reassembled the engin all pump and pick up tu and installed new seal 1	sure gauge and test Removed air cleane oblies. Drained coola ompressor lines and the harness brace of ure everything was do ound nothing wrong y colant jackets. Clear front 2 cylinders app rained oil and remov l pushed out the pist counterbore needed th cylinder and check is and pressed in the crank shaft. Installed he with push rods, ro be and fixing frame to the oil pan and re ule back to engine a	ted for combustion er, charge air pipe ant and pulled off disconnected fue n drivers side. Bol disconnected in or with the cylinder h ned up block deck peared to have a l ved oil pan, oil put tons. Pulled liners to be cut. Cleane ked liner protrusio e new liners. Reme main bearings an d new head gaske ocker assemblies, and reinstalled to engine and the wiring han	n gasses in the c s, cut loose winit coolant lines. Dia il injector lines fri lted up lifting bra der to pull off the read but head ga and checked lin out of rust jacking mp and pick up out of the block d up block and s on. Each liner av oved old piston l d torqued main et, cleaned up the adjusted the val bottom of engine e. Filled engine v	coolant system a ng harness from sconnected turbe om unit pumps a acket to back of t e cylinder head. asket was blown hers. They were g around the line and fixing frame. There was clea set up cutting too erages .007" of heads from conn caps. Installed p e cylinder head a lives to where the e. Cleaned corre with oil. Hooked I up wiring and re	nd the fluid cl side of engine o from manifo ond pulled off he cylinder he Hoisted cylind out on cylind all at the very rs. Got okay f Unbolted the r cavitation u d. Cut all 6 co protrusion non ecting rods a istons to liner and hoisted be cy needed to basion out of th up fuel lines a cinstalled all r	hanged color e, removed va ld and took of fuel filter mod ead. Remove der head off a ers 1 and 2 w bottom of the rom customer connecting r ndemeath the unterbores ar w. Installed n s and torqued ack into place be. Cleaned u e oil pan fixin and coolant lir emaining pan	alve ffegr ule d nd here e r to ods front nd ew ew l up the g ring les. ts.	
Cause 43 Correction 43 m ccc cd. frr he in it al pp frr 3 te lin pr CC R 0 a N P a	3040 - Ran truck with p inutes. Removed pres- onfirming combustion. over and rocker assem amps. Removed air co- om engine along with to ead bolts and made su spected for cracks. Fo- was getting into the co- llowable spec and the ull liner and inspect. D om the crankshaft and liners confirming the co- est fit new liners to eac ner O rings to cylinder iston heads with new ro- onnecting rods to the Reassembled the engin- il pump and pick up tu and installed new seal fit ounted fuel filter mod Pulled coolant back into any leaks on the engine	sure gauge and test Removed air cleane oblies. Drained coola ompressor lines and the harness brace of ure everything was do ound nothing wrong y colant jackets. Clear front 2 cylinders app rained oil and remov l pushed out the pist counterbore needed th cylinder and check is and pressed in the rings. Rolled in new crank shaft. Installed he with push rods, ro be and fixing frame to the oil pan and re ule back to engine a o the system. Reinst	ted for combustion er, charge air pipe ant and pulled off disconnected fue n drivers side. Bol disconnected in or with the cylinder h ned up block deck peared to have a l ved oil pan, oil put tons. Pulled liners to be cut. Cleane ked liner protrusio e new liners. Reme main bearings an d new head gaske ocker assemblies, and reinstalled to installed to enging and the wiring han talled air cleaner a	n gasses in the c s, cut loose winit coolant lines. Die linjector lines fri lted up lifting bra der to pull off the read but head ge and checked lin out of rust jacking mp and pick up out of the block d up block and s on. Each liner av oved old piston l d torqued main et, cleaned up the adjusted the val bottom of engine a. Filled engine v ness brace. Tied assembly. Prime	coolant system a ng harness from sconnected turbe om unit pumps a acket to back of te e cylinder head. asket was blown hers. They were g around the line and fixing frame. There was clea set up cutting too erages .007" of heads from conn caps. Installed p e cylinder head a lyes to where the e. Cleaned corn with oil. Hooked I up wiring and re d fuel system an	nd the fluid cl side of engine o from manifo ond pulled off he cylinder he Hoisted cylind out on cylind all at the very rs. Got okay f Unbolted the r cavitation u d. Cut all 6 co protrusion non ecting rods a istons to liner and hoisted be exp needed to basion out of th up fuel lines a einstalled all r	hanged color e, removed va ld and took of fuel filter mod ead. Remove der head off a ers 1 and 2 w bottom of the rom customer connecting r ndemeath the unterbores ar w. Installed n s and torqued ack into place be. Cleaned u e oil pan fixin and coolant lir emaining pan arted. Inspec	alve ffegr ule d nd here e r to ods front nd ew ew l up the g ring less. ts. ted for	
Cause Correction 43 m ccc cd, frc he in it al p fr 3 te lif p C R 0 a a a	3040 - Ran truck with p inutes. Removed pres onfirming combustion. over and rocker assem amps. Removed air co om engine along with the ead bolts and made su spected for cracks. For was getting into the co llowable spec and the ull liner and inspect. D om the crankshaft and liners confirming the co set fit new liners to eac ner O rings to cylinders iston heads with new r connecting rods to the of Reassembled the engin il pump and pick up tu and installed new seal the Aounted fuel filter mod	sure gauge and test Removed air cleane oblies. Drained coola ompressor lines and the harness brace of ure everything was do ound nothing wrong y colant jackets. Clear front 2 cylinders app rained oil and remov l pushed out the pist counterbore needed th cylinder and check is and pressed in the rings. Rolled in new crank shaft. Installed he with push rods, ro be and fixing frame to the oil pan and re ule back to engine a o the system. Reinst	ted for combustion er, charge air pipe ant and pulled off disconnected fue n drivers side. Bol disconnected in or with the cylinder h ned up block deck peared to have a l ved oil pan, oil put tons. Pulled liners to be cut. Cleane ked liner protrusio e new liners. Reme main bearings an d new head gaske ocker assemblies, and reinstalled to installed to enging and the wiring han talled air cleaner a	n gasses in the c s, cut loose winit coolant lines. Die linjector lines fri lted up lifting bra der to pull off the read but head ge and checked lin out of rust jacking mp and pick up out of the block d up block and s on. Each liner av oved old piston l d torqued main et, cleaned up the adjusted the val bottom of engine a. Filled engine v ness brace. Tied assembly. Prime	coolant system a ng harness from sconnected turbe om unit pumps a acket to back of te e cylinder head. asket was blown hers. They were g around the line and fixing frame. There was clea set up cutting too erages .007" of heads from conn caps. Installed p e cylinder head a lyes to where the e. Cleaned corn with oil. Hooked I up wiring and re d fuel system an	nd the fluid cl side of engine o from manifo and pulled off he cylinder he Hoisted cylind out on cylind all at the very rs. Got okay f Unbolted the r cavitation u of. Cut all 6 co protrusion non- ecting rods a sistons to liner and hoisted be ey needed to be installed all r ad got truck st d tested truck	hanged color e, removed va ld and took of fuel filter mod ead. Remove der head off a ers 1 and 2 w bottom of the rom customer connecting r ndemeath the unterbores ar w. Installed n s and torqued ack into place be. Cleaned u e oil pan fixin and coolant lir emaining pan arted. Inspec	alve ffegr ule d nd here e r to ods front nd ew ew l up the g ring less. ts. ted for	ded
Cause 43 Correction 43 m ccc cc cd. frc he in it al pu fr 3 te lin p C C C C C C C C C C C C C C C C C C	3040 - Ran truck with p inutes. Removed pres- onfirming combustion. over and rocker assem amps. Removed air co- om engine along with the ead bolts and made su spected for cracks. For was getting into the co- llowable spec and the ull liner and inspect. D form the crankshaft and liners confirming the co- est fit new liners to each ner O rings to cylinder iston heads with new for onnecting rods to the cassembled the engin- il pump and pick up tu and installed new seal for ounted fuel filter mod Pulled coolant back into any leaks on the engine into the constant back into	sure gauge and test Removed air cleaner oblies. Drained coolar ompressor lines and the harness brace of ure everything was do ound nothing wrong to oolant jackets. Clean front 2 cylinders app rained oil and remov l pushed out the pist counterbore needed the cylinder and check is and pressed in the rings. Rolled in new crank shaft. Installed to the oil pan and re- ule back to engine a to the system. Reinst e. Washed off the er <u>Description</u>	ted for combustion er, charge air pipe ant and pulled off of disconnected fue n drivers side. Bol disconnected in or with the cylinder h ned up block deck peared to have a l ved oil pan, oil put tons. Pulled liners to be cut. Cleane ked liner protrusio e new liners. Remo main bearings an d new head gaske bocker assemblies, and reinstalled to installed to engine and the wiring han talled air cleaner a ngine after it ran for RFORM REPAIRS	n gasses in the o s, cut loose winit coolant lines. Dia i njector lines fri lted up lifting bra der to pull off the nead but head ga and checked lin for of rust jacking mp and pick up a out of the block d up block and s on. Each liner av oved old piston h d torqued main et, cleaned up the adjusted the val bottom of engine assembly. Prime for a while to veri	coolant system a ng harness from sconnected turbe om unit pumps a acket to back of te e cylinder head. asket was blown hers. They were g around the line and fixing frame. There was clea set up cutting too erages .007" of heads from conn caps. Installed p e cylinder head a lyes to where the e. Cleaned corn with oil. Hooked I up wiring and re d fuel system an	nd the fluid cl side of engine o from manifo and pulled off he cylinder he Hoisted cylind out on cylind all at the very rs. Got okay f Unbolted the r cavitation u d. Cut all 6 co protrusion non ecting rods a istons to liner and hoisted bi ey needed to bosion out of th up fuel lines a einstalled all r id got truck st d tested truck	hanged color e, removed va ld and took of fuel filter mod ead. Removed der head off a ers 1 and 2 w bottom of the rom customent e connecting r ndemeath the unterbores ar w. Installed n is and torqued ack into place be. Cleaned u e oil pan fixin and coolant lir emaining part arted. Inspected	alve f egr ule d nd here e r to oods front nd ew ew l s to the g ring nes. ts. ted for ed 6,975.00	
Cause Correction 43 m ccc cd. frc he in it all pp fr 3 te lin p CC R 0 0 a M P a a 2 0ty ltem 1 114P/229	3040 - Ran truck with p inutes. Removed pres onfirming combustion. over and rocker assem amps. Removed air co om engine along with the ead bolts and made su ispected for cracks. For was getting into the co llowable spec and the ull liner and inspect. D om the crankshaft and liners confirming the co east fit new liners to each ner O rings to cylinders iston heads with new to connecting rods to the of Reassembled the engine all pump and pick up tu und installed new seal f Aounted fuel filter mode Pulled coolant back into ing leaks on the engine again for leaks.	sure gauge and test Removed air cleaner oblies. Drained coolar ompressor lines and the harness brace of ure everything was do ound nothing wrong to oolant jackets. Clear front 2 cylinders app rained oil and remov l pushed out the pist counterbore needed th cylinder and check is and pressed in the rings. Rolled in new crank shaft. Installed to the oil pan and re ule back to engine a to the system. Reinst e. Washed off the er <u>Description</u> LABOR TO PER OVERHAUL KIT	ted for combustion er, charge air pipe ant and pulled off disconnected fue n drivers side. Bol disconnected in or with the cylinder h ned up block deck peared to have a l ved oil pan, oil put tons. Pulled liners to be cut. Cleane ked liner protrusio e new liners. Reme main bearings an d new head gaske ocker assemblies, and reinstalled to enstalled to engine and the wiring han talled air cleaner a ngine after it ran for RFORM REPAIRS T, LEVEL 1 EPA10	n gasses in the o s, cut loose winit coolant lines. Dia i njector lines fri lted up lifting bra der to pull off the nead but head ga and checked lin out of rust jacking mp and pick up a out of the block d up block and s on. Each liner av oved old piston l d torqued main at, cleaned up the adjusted the val bottom of engine hess brace. Tied assembly. Prime or a while to veri	coolant system a ng harness from sconnected turbe om unit pumps a acket to back of te e cylinder head. asket was blown hers. They were g around the line and fixing frame. There was clea set up cutting too erages .007" of heads from conn caps. Installed p e cylinder head a lyes to where the e. Cleaned corn with oil. Hooked I up wiring and re d fuel system an	nd the fluid cl side of engine o from manifo ind pulled off he cylinder he Hoisted cylind out on cylind all at the very rs. Got okay f Unbolted the rr cavitation u d. Cut all 6 co protrusion non ecting rods a istons to liner and hoisted bi- ey needed to bision out of th up fuel lines a einstalled all r id got truck st d tested truck <u>Price</u> 6,043.	hanged color e, removed va ld and took of fuel filter mod ead. Remove der head off a ers 1 and 2 w bottom of the rom customer e connecting r nderneath the unterbores ar w. Installed ne s and torqued ack into place be. Cleaned u e oil pan fixin and coolant lir emaining part arted. Inspecter ce Each	alve f egr ule d nd here e f r to ods e front nd ew l up the g ring nes. is. ted for ed 6,975.00 6,043.78	K
Cause Correction 43 Correction 43 Cocc ccc cd, frc	3040 - Ran truck with p inutes. Removed pres- onfirming combustion. over and rocker assem amps. Removed air co- om engine along with the ead bolts and made su spected for cracks. Fo- was getting into the co- llowable spec and the ull liner and inspect. D om the crankshaft and liners confirming the co- est fit new liners to each ner O rings to cylinders iston heads with new ro- onnecting rods to the Reassembled the engin- il pump and pick up tu and installed new seal the Pulled coolant back into any leaks on the engine- again for leaks.	sure gauge and test Removed air cleaner oblies. Drained coolar ompressor lines and the harness brace of ure everything was do ound nothing wrong y oolant jackets. Clear front 2 cylinders app rained oil and remov l pushed out the pist counterbore needed th cylinder and check is and pressed in the rings. Rolled in new crank shaft. Installed the with push rods, roc be and fixing frame to the oil pan and re ule back to engine a o the system. Reinst e. Washed off the er <u>Description</u> LABOR TO PER OVERHAUL KIT CYLINDER LINE	ted for combustion er, charge air pipe ant and pulled off disconnected fue n drivers side. Bol disconnected in or with the cylinder h hed up block deck peared to have a l ved oil pan, oil put tons. Pulled liners to be cut. Cleane ked liner protrusio e new liners. Reme main bearings an d new head gaske ocker assemblies, and reinstalled to enstalled to engine and the wiring han talled air cleaner a ngine after it ran for RFORM REPAIRS T, LEVEL 1 EPATO ER, W/ AP RING,	n gasses in the c s, cut loose winit coolant lines. Dis- linjector lines fri lited up lifting bra- der to pull off the nead but head ga and checked lin- to of rust jacking mp and pick up a out of the block d up block and s on. Each liner av oved old piston lid torqued main at, cleaned up the adjusted the val bottom of engine hess brace. Tied assembly. Prime or a while to veri	coolant system a ng harness from sconnected turbe om unit pumps a acket to back of te e cylinder head. asket was blown hers. They were g around the line and fixing frame. There was clea set up cutting too erages .007" of heads from conn caps. Installed p e cylinder head a lyes to where the e. Cleaned corn with oil. Hooked I up wiring and re d fuel system an	nd the fluid cl side of engine o from manifo ind pulled off he cylinder he Hoisted cylind out on cylind all at the very rs. Got okay f Unbolted the rr cavitation u d. Cut all 6 co protrusion non- ecting rods a istons to liner and hoisted bi- ey needed to bision out of th up fuel lines a einstalled all r id got truck st d tested truck <u>Price</u> 6,043. 325.	hanged color e, removed va ld and took of fuel filter mod ead. Remove der head off a ers 1 and 2 w bottom of the rom customer e connecting r nderneath the unterbores ar w. Installed ne s and torqued ack into place be. Cleaned u e oil pan fixin and coolant lir emaining part arted. Inspecter ce Each	alve f egr ule d nd here e r to oods front nd ew ew l s to the g ring nes. ts. ted for ed 6,975.00	
Cause 43 Correction 43 frequencies 6 1 114P/229 6 114P/197 12 114P/452	3040 - Ran truck with p inutes. Removed pres onfirming combustion. over and rocker assem amps. Removed air co om engine along with the ead bolts and made su aspected for cracks. For was getting into the co llowable spec and the ull liner and inspect. D om the crankshaft and liners confirming the co east fit new liners to each ner O rings to cylinders iston heads with new to onnecting rods to the Reassembled the engine ill pump and pick up tu and installed new seal the Aounted fuel filter mode Pulled coolant back into iny leaks on the engine again for leaks.	sure gauge and test Removed air cleaner oblies. Drained coolar ompressor lines and the harness brace of ure everything was do ound nothing wrong y oolant jackets. Clear front 2 cylinders app rained oil and remov l pushed out the pist counterbore needed th cylinder and check is and pressed in the rings. Rolled in new crank shaft. Installed the with push rods, roc be and fixing frame to the oil pan and re ule back to engine a o the system. Reinst e. Washed off the er <u>Description</u> LABOR TO PER OVERHAUL KIT CYLINDER LINE	ted for combustion er, charge air pipe ant and pulled off disconnected fue n drivers side. Boi disconnected in or with the cylinder h ned up block deck peared to have a l ved oil pan, oil put tons. Pulled liners to be cut. Cleane ked liner protrusio e new liners. Reme main bearings an d new head gaske ocker assemblies, and reinstalled to engine and the wiring han talled air cleaner a ngine after it ran for RFORM REPAIRS T, LEVEL 1 EPA10 ER, W/ AP RING, N-CHLORINATED	n gasses in the c s, cut loose winit coolant lines. Dis- linjector lines fri lited up lifting bra- der to pull off the nead but head ga and checked lin- to of rust jacking mp and pick up a out of the block d up block and s on. Each liner av oved old piston lid torqued main at, cleaned up the adjusted the val bottom of engine hess brace. Tied assembly. Prime or a while to veri	coolant system a ng harness from sconnected turbe om unit pumps a acket to back of te e cylinder head. asket was blown hers. They were g around the line and fixing frame. There was clea set up cutting too erages .007" of heads from conn caps. Installed p e cylinder head a lyes to where the e. Cleaned corn with oil. Hooked I up wiring and re d fuel system an	nd the fluid cl side of engine o from manifo ind pulled off he cylinder he Hoisted cylind out on cylind all at the very rs. Got okay f Unbolted the rr cavitation u d. Cut all 6 co protrusion non- ecting rods a istons to liner and hoisted bi- ey needed to bision out of th up fuel lines a einstalled all r id got truck st d tested truck <u>Price</u> 6,043. 325.	hanged color e, removed va ld and took of fuel filter mod ead. Remove der head off a ers 1 and 2 w bottom of the rom customer e connecting r nderneath the unterbores ar w. Installed n s and torqued ack into place be. Cleaned u is oil pan fixin and coolant lir emaining pan arted. Inspecter cand inspecter c	alve f egr ule d nd here e f r to ods e front nd ew l ule f egr ing es. is. ted for ed 6,975.00 6,043.78 1,950.18	5
Cause 43 Correction 43 Ital 1 Correction 43 Correction 43 Correction 43 Interview 1 1 114P/181 1 114P/181	3040 - Ran truck with p inutes. Removed pres- onfirming combustion. over and rocker assem amps. Removed air co- om engine along with the ead bolts and made su aspected for cracks. Fo- was getting into the co- llowable spec and the ull liner and inspect. D om the crankshaft and liners confirming the co- est fit new liners to each ner O rings to cylinders iston heads with new ro- onnecting rods to the Reassembled the engine il pump and pick up tu and installed new seal the Pulled coolant back into any leaks on the engine again for leaks.	sure gauge and test Removed air cleaner oblies. Drained coolar ompressor lines and the harness brace of ure everything was do ound nothing wrong y oolant jackets. Clear front 2 cylinders app rained oil and remov l pushed out the pist counterbore needed th cylinder and check is and pressed in the rings. Rolled in new crank shaft. Installed the with push rods, ro be and fixing frame to the oil pan and re ule back to engine a to the system. Reinst e. Washed off the er <u>Description</u> LABOR TO PEF OVERHAUL KIT CYLINDER LINE CLEANER -NOI LINE-AIR BREA NUT-HEX METF	ted for combustion er, charge air pipe ant and pulled off disconnected fue n drivers side. Boi disconnected in or with the cylinder h hed up block deck peared to have a l ved oil pan, oil put tons. Pulled liners to be cut. Cleane ked liner protrusio e new liners. Reme main bearings and d new head gaske ocker assemblies, and reinstalled to engine and the wiring han talled air cleaner a hgine after it ran for RFORM REPAIRS T, LEVEL 1 EPAIO ER, W/ AP RING, N-CHLORINATED NTHER RIC M10X1	n gasses in the o s, cut loose winit coolant lines. Dia i injector lines fri lited up lifting bra der to pull off the read but head ga and checked lin out of rust jacking mp and pick up a out of the block d up block and s on. Each liner av oved old piston lid d torqued main at, cleaned up the adjusted the val bottom of engine a. Filled engine v ness brace. Tied assembly. Prime or a while to veri	coolant system a ng harness from sconnected turbe om unit pumps a acket to back of te e cylinder head. asket was blown hers. They were g around the line and fixing frame. There was clea set up cutting too erages .007" of heads from conn caps. Installed p e cylinder head a lyes to where the e. Cleaned corn with oil. Hooked I up wiring and re d fuel system an	nd the fluid cl side of engine o from manifo ind pulled off he cylinder hi Hoisted cylind out on cylind all at the very rs. Got okay f Unbolted the rr cavitation u d. Cut all 6 co protrusion non- ecting rods a istons to liner and hoisted bi- exy needed to basion out of th up fuel lines a einstalled all r id got truck st d tested truck enset truck st d tested truck 0,043. 325. 2. 50. 32.	hanged color e, removed va ld and took of fuel filter mod ead. Remove der head off a ers 1 and 2 w bottom of the rom customer e connecting r ndemeath the unterbores ar w. Installed ne s and torqued ack into place be. Cleaned u e oil pan fixin and coolant lir emaining part arted. Inspecte cand inspected to Each	alve f egr ule d nd here e f r to ods e front nd ew l up the g ring ees. ts. ted for 6,975.00 6,043.78 1,950.18 33.48 50.65 32.12	
Cause 43 Correction 43 from 6 1 114P/229 6 114P/197 12 114P/452	3040 - Ran truck with p inutes. Removed pres onfirming combustion. over and rocker assem amps. Removed air co om engine along with the ead bolts and made su aspected for cracks. For was getting into the co llowable spec and the ull liner and inspect. D om the crankshaft and liners confirming the co east fit new liners to each ner O rings to cylinders iston heads with new in onnecting rods to the of Reassembled the engine il pump and pick up tu and installed new seal the Aounted fuel filter mod Pulled coolant back into again for leaks.	sure gauge and test Removed air cleaner oblies. Drained coolar ompressor lines and the harness brace of ure everything was do ound nothing wrong y oolant jackets. Clear front 2 cylinders app rained oil and remov I pushed out the pist counterbore needed th cylinder and check is and pressed in the rings. Rolled in new crank shaft. Installed the with push rods, ro be and fixing frame to the oil pan and re ule back to engine a o the system. Reinst e. Washed off the er <u>Description</u> LABOR TO PEF OVERHAUL KIT CYLINDER LINE CLEANER -NON LINE-AIR BREA NUT-HEX METF 8-1.25 X 30 MM	ted for combustion er, charge air pipe ant and pulled off disconnected fue n drivers side. Boi disconnected in or with the cylinder h ned up block deck peared to have a l ved oil pan, oil put tons. Pulled liners to be cut. Cleane ked liner protrusio e new liners. Reme main bearings an d new head gaske ocker assemblies, and reinstalled to engine and the wiring han talled air cleaner a ngine after it ran for RFORM REPAIRS T, LEVEL 1 EPA10 ER, W/ AP RING, N-CHLORINATED ATHER RIC M10X1 I HEX HD C/S 10	n gasses in the o s, cut loose winit coolant lines. Dia i injector lines fri lited up lifting bra der to pull off the read but head ga and checked lin out of rust jacking mp and pick up a out of the block d up block and s on. Each liner av oved old piston lid d torqued main at, cleaned up the adjusted the val bottom of engine a. Filled engine v ness brace. Tied assembly. Prime or a while to veri	coolant system a ng harness from sconnected turbe om unit pumps a acket to back of te e cylinder head. asket was blown hers. They were g around the line and fixing frame. There was clea set up cutting too erages .007" of heads from conn caps. Installed p e cylinder head a lyes to where the e. Cleaned corn with oil. Hooked I up wiring and re d fuel system an	nd the fluid cl side of engine o from manifo ind pulled off he cylinder he Hoisted cylind out on cylind all at the very rs. Got okay f Unbolted the rr cavitation u d. Cut all 6 co protrusion non- ecting rods a istons to liner and hoisted be ey needed to basion out of th up fuel lines a einstalled all r ad got truck st d tested truck Price 6,043. 325. 2. 50. 32.	hanged color e, removed va ld and took of fuel filter mod ead. Remove der head off a ers 1 and 2 w bottom of the rom customer e connecting r ndemeath the unterbores ar w. Installed ne s and torqued ack into place be. Cleaned u te oil pan fixin and coolant lir emaining part arted. Inspect cach cach	alve f egr ule d nd here e f r to ods e front nd ew ew f g ring nes. ts. ted for ed Extend 6,975.00 6,043.78 1,950.18 33.48 50.65 32.12 1.10	
Cause 43 Correction 43 mm ccc ccd cc cdi cc <	3040 - Ran truck with p inutes. Removed pres onfirming combustion. over and rocker assem amps. Removed air co om engine along with the ead bolts and made su aspected for cracks. For was getting into the co llowable spec and the ull liner and inspect. D om the crankshaft and liners confirming the co east fit new liners to each ner O rings to cylinders iston heads with new in onnecting rods to the of Reassembled the engine il pump and pick up tu and installed new seal the Aounted fuel filter mod Pulled coolant back into again for leaks.	sure gauge and test Removed air cleaner oblies. Drained coolar ompressor lines and the harness brace of ure everything was do ound nothing wrong y oolant jackets. Clear front 2 cylinders app rained oil and remov l pushed out the pist counterbore needed th cylinder and check is and pressed in the rings. Rolled in new crank shaft. Installed the with push rods, ro be and fixing frame to the oil pan and re ule back to engine a to the system. Reinst e. Washed off the er <u>Description</u> LABOR TO PEF OVERHAUL KIT CYLINDER LINE CLEANER -NOI LINE-AIR BREA NUT-HEX METF 8-1.25 X 30 MM 5/16 SAE GR 8	ted for combustion er, charge air pipe ant and pulled off disconnected fue n drivers side. Boi disconnected in or with the cylinder h ned up block deck peared to have a l ved oil pan, oil put tons. Pulled liners to be cut. Cleane ked liner protrusio e new liners. Reme main bearings and d new head gaske ocker assemblies, and reinstalled to engine and the wiring han talled air cleaner a ngine after it ran for RFORM REPAIRS T, LEVEL 1 EPAIO ER, W/ AP RING, N-CHLORINATED ATHER RIC M10X1 I HEX HD C/S 10 F/W YZ	n gasses in the o s, cut loose winit coolant lines. Dia i injector lines fri lted up lifting bra der to pull off the read but head ga and checked lin out of rust jacking mp and pick up a out of the block d up block and s on. Each liner av oved old piston l d torqued main at, cleaned up the adjusted the val bottom of engine a. Filled engine v ness brace. Tied assembly. Prime or a while to veri	coolant system a ng harness from sconnected turbe om unit pumps a acket to back of te e cylinder head. asket was blown hers. They were g around the line and fixing frame. There was clea set up cutting too erages .007" of heads from conn caps. Installed p e cylinder head a lyes to where the e. Cleaned corn with oil. Hooked I up wiring and re d fuel system an	nd the fluid cl side of engine o from manifo ind pulled off he cylinder he Hoisted cylind out on cylind all at the very rs. Got okay f Unbolted the rr cavitation u d. Cut all 6 co protrusion non- ecting rods a istons to liner and hoisted be ey needed to basion out of th up fuel lines a einstalled all r ind got truck st d tested truck Price 6,043. 325. 2. 50. 32. 1. 0	hanged color e, removed va ld and took of fuel filter mod ead. Remove der head off a ers 1 and 2 w bottom of the rom customer connecting r ndemeath the unterbores an w. Installed ne s and torqued ack into place be. Cleaned u te oil pan fixin and coolant lir emaining pan arted. Inspecte can	alve f egr ule d nd here e f r to ods e front nd ew ew f g ring less. ts. ted for ed 6,975.00 6,043.78 1,950.18 33.48 50.65 32.12 1.10 0.85	
Cause 43 Correction 43 mm cc cc cc fm at fm 3 fm 4 fm 3 fm 3 fm 4 fm 4 fm 4 fm 4 fm 4 fm 1 <td>3040 - Ran truck with p inutes. Removed pres onfirming combustion. over and rocker assem amps. Removed air co om engine along with the ead bolts and made su aspected for cracks. For was getting into the co llowable spec and the ull liner and inspect. D om the crankshaft and liners confirming the co east fit new liners to each ner O rings to cylinders iston heads with new in onnecting rods to the of Reassembled the engine il pump and pick up tu and installed new seal the Aounted fuel filter mod Pulled coolant back into again for leaks.</td> <td>sure gauge and test Removed air cleaner oblies. Drained coolar ompressor lines and the harness brace of ure everything was do ound nothing wrong y oolant jackets. Clear front 2 cylinders app rained oil and remov l pushed out the pist counterbore needed th cylinder and check is and pressed in the rings. Rolled in new crank shaft. Installed the with push rods, ro be and fixing frame to the oil pan and re ule back to engine a to the system. Reinst e. Washed off the er <u>Description</u> LABOR TO PEF OVERHAUL KIT CYLINDER LINE CLEANER -NOI LINE-AIR BREA NUT-HEX METF 8-1.25 X 30 MM 5/16 SAE GR 8</td> <td>ted for combustion er, charge air pipe ant and pulled off disconnected fue n drivers side. Boi disconnected in or with the cylinder h ned up block deck peared to have a l ved oil pan, oil put tons. Pulled liners to be cut. Cleane ked liner protrusio e new liners. Reme main bearings an d new head gaske ocker assemblies, and reinstalled to engine and the wiring han talled air cleaner a ngine after it ran for RFORM REPAIRS T, LEVEL 1 EPA10 ER, W/ AP RING, N-CHLORINATED ATHER RIC M10X1 I HEX HD C/S 10</td> <td>n gasses in the o s, cut loose winit coolant lines. Dia i injector lines fri lted up lifting bra der to pull off the read but head ga and checked lin out of rust jacking mp and pick up a out of the block d up block and s on. Each liner av oved old piston l d torqued main at, cleaned up the adjusted the val bottom of engine a. Filled engine v ness brace. Tied assembly. Prime or a while to veri</td> <td>coolant system a ng harness from sconnected turbe om unit pumps a acket to back of te e cylinder head. asket was blown hers. They were g around the line and fixing frame. There was clea set up cutting too erages .007" of heads from conn caps. Installed p e cylinder head a lyes to where the e. Cleaned corn with oil. Hooked I up wiring and re d fuel system an</td> <td>nd the fluid cl side of engine o from manifo ind pulled off he cylinder he Hoisted cylind out on cylind all at the very rs. Got okay f Unbolted the rr cavitation u d. Cut all 6 co protrusion non- ecting rods a istons to liner and hoisted bi- ey needed to basion out of th up fuel lines a einstalled all r id got truck st d tested truck extended to basion out of th p fuel lines a einstalled all r d got truck st d tested truck extended to basion out of th up fuel lines a einstalled all r d got truck st d tested truck extended to basion out of th up fuel lines a einstalled all r d got truck st d tested truck extended to basion out of th up fuel lines a einstalled all r d got truck st d tested truck extended to basion out of th up fuel lines a einstalled all r d got truck st d tested truck extended to basion out of th up fuel lines a einstalled all r d got truck st d tested truck extended to basion out of th up fuel lines a einstalled all r d got truck st d tested truck extended to basion out of th up fuel lines a einstalled all r d got truck st d tested truck extended to basion out of th up fuel lines a einstalled all r d got truck st d tested truck extended to basion out of th up fuel lines a einstalled all r d got truck st d tested truck extended to extended to</td> <td>hanged color e, removed va ld and took of fuel filter mod ead. Remove der head off a ers 1 and 2 w bottom of the rom customer e connecting r ndemeath the unterbores ar w. Installed ne s and torqued ack into place be. Cleaned u te oil pan fixin and coolant lir emaining part arted. Inspect cach cach</td> <td>alve f egr ule d nd here e f r to ods e front nd ew ew f g ring nes. ts. ted for ed Extend 6,975.00 6,043.78 1,950.18 33.48 50.65 32.12 1.10</td> <td></td>	3040 - Ran truck with p inutes. Removed pres onfirming combustion. over and rocker assem amps. Removed air co om engine along with the ead bolts and made su aspected for cracks. For was getting into the co llowable spec and the ull liner and inspect. D om the crankshaft and liners confirming the co east fit new liners to each ner O rings to cylinders iston heads with new in onnecting rods to the of Reassembled the engine il pump and pick up tu and installed new seal the Aounted fuel filter mod Pulled coolant back into again for leaks.	sure gauge and test Removed air cleaner oblies. Drained coolar ompressor lines and the harness brace of ure everything was do ound nothing wrong y oolant jackets. Clear front 2 cylinders app rained oil and remov l pushed out the pist counterbore needed th cylinder and check is and pressed in the rings. Rolled in new crank shaft. Installed the with push rods, ro be and fixing frame to the oil pan and re ule back to engine a to the system. Reinst e. Washed off the er <u>Description</u> LABOR TO PEF OVERHAUL KIT CYLINDER LINE CLEANER -NOI LINE-AIR BREA NUT-HEX METF 8-1.25 X 30 MM 5/16 SAE GR 8	ted for combustion er, charge air pipe ant and pulled off disconnected fue n drivers side. Boi disconnected in or with the cylinder h ned up block deck peared to have a l ved oil pan, oil put tons. Pulled liners to be cut. Cleane ked liner protrusio e new liners. Reme main bearings an d new head gaske ocker assemblies, and reinstalled to engine and the wiring han talled air cleaner a ngine after it ran for RFORM REPAIRS T, LEVEL 1 EPA10 ER, W/ AP RING, N-CHLORINATED ATHER RIC M10X1 I HEX HD C/S 10	n gasses in the o s, cut loose winit coolant lines. Dia i injector lines fri lted up lifting bra der to pull off the read but head ga and checked lin out of rust jacking mp and pick up a out of the block d up block and s on. Each liner av oved old piston l d torqued main at, cleaned up the adjusted the val bottom of engine a. Filled engine v ness brace. Tied assembly. Prime or a while to veri	coolant system a ng harness from sconnected turbe om unit pumps a acket to back of te e cylinder head. asket was blown hers. They were g around the line and fixing frame. There was clea set up cutting too erages .007" of heads from conn caps. Installed p e cylinder head a lyes to where the e. Cleaned corn with oil. Hooked I up wiring and re d fuel system an	nd the fluid cl side of engine o from manifo ind pulled off he cylinder he Hoisted cylind out on cylind all at the very rs. Got okay f Unbolted the rr cavitation u d. Cut all 6 co protrusion non- ecting rods a istons to liner and hoisted bi- ey needed to basion out of th up fuel lines a einstalled all r id got truck st d tested truck extended to basion out of th p fuel lines a einstalled all r d got truck st d tested truck extended to basion out of th up fuel lines a einstalled all r d got truck st d tested truck extended to basion out of th up fuel lines a einstalled all r d got truck st d tested truck extended to basion out of th up fuel lines a einstalled all r d got truck st d tested truck extended to basion out of th up fuel lines a einstalled all r d got truck st d tested truck extended to basion out of th up fuel lines a einstalled all r d got truck st d tested truck extended to basion out of th up fuel lines a einstalled all r d got truck st d tested truck extended to basion out of th up fuel lines a einstalled all r d got truck st d tested truck extended to basion out of th up fuel lines a einstalled all r d got truck st d tested truck extended to basion out of th up fuel lines a einstalled all r d got truck st d tested truck extended to extended to	hanged color e, removed va ld and took of fuel filter mod ead. Remove der head off a ers 1 and 2 w bottom of the rom customer e connecting r ndemeath the unterbores ar w. Installed ne s and torqued ack into place be. Cleaned u te oil pan fixin and coolant lir emaining part arted. Inspect cach cach	alve f egr ule d nd here e f r to ods e front nd ew ew f g ring nes. ts. ted for ed Extend 6,975.00 6,043.78 1,950.18 33.48 50.65 32.12 1.10	

Date In Date In Service 05/23/2023 10/04/2012 114P/1923003PE 10/14P/CT05512 1 114P/CT05517	Peterbilt 1 omer: 46574 RVICE INC 4 DN, NE 68739	Engine Hrs	3, NE 68701 9 Fax: (402) dside Assis	844 - 3920 t 800-473-8372 E Owner: 46574 JERRYS SERVIC 505 N CEDAR A HARTINGTON, N V.I.N 1XPHI Engine Serial A Vehicle ID # 144 2013 PETERBII BIII Type	CE INC VE NE 68739 PP9X3DD185 101371 4529 C LT Torms	P.O. Invo 06/0 505 Cust Unit # 60 386 Writer	0056027:01 Number 60 Dice Date 02/2023
Date In Date In Service 05/23/2023 10/04/2012 114P/1923003PE 10 114P/CT05512 14P/CT05512	Peterbilt 7 ormer: 46574 RVICE INC 4 DN, NE 68739 546 <u>Mileage</u> 628,529	Engine Hrs	9 Fax: (402) dside Assis INVOIC	Conner: 46574 JERRYS SERVIC 505 N CEDAR A HARTINGTON, N V.I.N 1XPHI Engine Serial A Vehicle ID # 144 2013 PETERBII BIII Type	CE INC VE NE 68739 PP9X3DD185 101371 4529 C LT Torms	505 Cust Unit # 60 386 Writer	60 bice Date 02/2023
S274 Bill-To Custor JERRYS SEF PO BOX 784 HARTINGTO (402) 254-65 (402) 254-65 (402) 254-65 (402) 254-65 (10,004/2012) 11.99 114P/500010048 1 114P/1923003PE 10 114P/CT05512	Peterbilt 7 ormer: 46574 RVICE INC 4 DN, NE 68739 546 <u>Mileage</u> 628,529	TruckCare Road	dside Assis INVOIC	Conner: 46574 JERRYS SERVIC 505 N CEDAR A HARTINGTON, N V.I.N 1XPHI Engine Serial A Vehicle ID # 144 2013 PETERBII BIII Type	CE INC VE NE 68739 PP9X3DD185 101371 4529 C LT Torms	505 Cust Unit # 60 386 Writer	60 bice Date 02/2023
S274 Bill-To Custon JERRYS SEF PO BOX 784 HARTINGTO (402) 254-65 (402) 254-65 (402) 254-65 (11.99 114P/500010048 1 114P/1923003PE 10 114P/CT05512	omer: 46574 RVICE INC 4 DN, NE 68739 546 <u>Mileage</u> 628,529	Engine Hrs 834	INVOIC Date Out	Owner: 46574 JERRYS SERVIC 505 N CEDAR A HARTINGTON, N V.I.N 1XPHI Engine Serial A Vehicle ID # 144 2013 PETERBII BIII Type	CE INC VE NE 68739 PP9X3DD185 101371 4529 C LT Torms	06/0 505 286 Writer	Dice Date
S274 Bill-To Custo JERRYS SEF PO BOX 784 HARTINGTO (402) 254-65 (402) 254-65 (402) 254-65 (199 114P/500010048 1 114P/1923003PE 10 114P/CT05512	RVICE INC 4 DN, NE 68739 546 <u>Mileage</u> 628,529	Engine Hrs 834	Date Out	Owner: 46574 JERRYS SERVIC 505 N CEDAR A HARTINGTON, N V.I.N 1XPHI Engine Serial A Vehicle ID # 144 2013 PETERBII BIII Type	VE NE 68739 PP9X3DD185 101371 4529 (LT Torms	06/0 505 286 Writer	02/2023
Bill-To Custo JERRYS SEP PO BOX 784 HARTINGTO (402) 254-65 05/23/2023 10/04/2012 11.99 114P/1923003PE 10 114P/CT05512	RVICE INC 4 DN, NE 68739 546 <u>Mileage</u> 628,529	Engine Hrs 834	Date Out	Owner: 46574 JERRYS SERVIC 505 N CEDAR A HARTINGTON, N V.I.N 1XPHI Engine Serial A Vehicle ID # 144 2013 PETERBII BIII Type	VE NE 68739 PP9X3DD185 101371 4529 (LT Torms	505 Cust Unit # 60 386 Writer)
JERRYS SEF PO BOX 784 HARTINGTO (402) 254-65 05/23/2023 10/04/2012 11.99 114P/500010048 1 114P/1923003PE 10 114P/CT05512	RVICE INC 4 DN, NE 68739 546 <u>Mileage</u> 628,529	834		JERRYS SERVIC 505 N CEDAR A HARTINGTON, N V.I.N 1XPHI Engine Serial A Vehicle ID # 144 2013 PETERBII BIII Type	VE NE 68739 PP9X3DD185 101371 4529 (LT Torms	Cust Unit # 60 386 Writer	
PO BOX 784 HARTINGTO (402) 254-65 05/23/2023 10/04/2012 11.99 114P/500010048 1 114P/1923003PE 10 114P/CT05512	4 DN, NE 68739 546 <u>Mileage</u> 628,529	834		505 N CEDAR A HARTINGTON, N V.I.N 1XPHI Engine Serial A Vehicle ID # 144 2013 PETERBII BIII Type	VE NE 68739 PP9X3DD185 101371 4529 (LT Torms	Cust Unit # 60 386 Writer	
HARTINGTO (402) 254-65 (402) 254-65 05/23/2023 10/04/2012 11.99 114P/500010048 1 114P/1923003PE 10 114P/CT05512	DN, NE 68739 546 <u>Mileage</u> 628,529	834		HARTINGTON, N V.I.N 1XPHI Engine Serial A Vehicle ID # 144 2013 PETERBII BIII Type	NE 68739 PP9X3DD185 101371 4529 C LT Torms	Cust Unit # 60 386 Writer	
(402) 254-65 Date In Date In Service 05/23/2023 10/04/2012 11.99 114P/500010048 1 114P/1923003PE 10 114P/CT05512	546 Mileage 628,529	834		V.I.N 1XPHI Engine Serial A Vehicle ID # 144 2013 PETERBII BIII Type	PP9X3DD185 101371 4529 C LT Terms	Cust Unit # 60 386 Writer	
Date In Date In Service 05/23/2023 10/04/2012 11.99 114P/500010048 1 114P/1923003PE 10 114P/CT05512	Mileage 628,529	834		Engine Serial A Vehicle ID # 144 2013 PETERBII Bill Type	101371 4529 C LT Terms	Cust Unit # 60 386 Writer	
Date In Date In Service 05/23/2023 10/04/2012 11.99 114P/500010048 1 114P/1923003PE 10 114P/CT05512	Mileage 628,529	834		Engine Serial A Vehicle ID # 144 2013 PETERBII Bill Type	101371 4529 C LT Terms	Cust Unit # 60 386 Writer	
05/23/2023 10/04/2012 11.99 114P/500010048 1 114P/1923003PE 10 114P/CT05512	628,529	834		2013 PETERBI	Terms	386 Writer	
05/23/2023 10/04/2012 11.99 114P/500010048 1 114P/1923003PE 10 114P/CT05512	628,529	834		Bill Type	Terms	Writer	Reviewer
05/23/2023 10/04/2012 11.99 114P/500010048 1 114P/1923003PE 10 114P/CT05512	628,529	834					
11.99 114P/500010048 1 114P/1923003PE 10 114P/CT05512					N10TH	KATICOUC	43006
1 114P/1923003PE 10 114P/CT05512	OILINGTEEDTT	TRI P 15W40 CK4		51	23.96		37.28
10 114P/CT05512	GASKET		•		12.87	1	12.87
1 114P/CT05317	TIE-CABLE 120	LB, 15.25" BLK			0.31		3.10
114170100011	TIE-CABLE 50L	B 15.5" BLK			0.16		0.16
Total Labor 6,975.00 Total Parts	8,444.32	Total Other	0.00	Prepay	\$0.00	Job#1 Tota	15,419.32
Job#3 ASR	ADDITIONAL SER	VICE REQUEST	ASR				SR
Condition 43040 = Cut counterbore	es						
Cause 43040 = Cut counterbore	es						
Correction 43040 = Cut counterbore cylinder and checked line	es, Cleaned up blo er protrusion. Each	ock and set up cuttin Iner averages .00	ng tool. Cut all 7" of protrusio	6 counterbores an n now	nd test fit new li	ners to each	
Qty Item	Description	Sector and Sector			Price E	Each	Extended
	LABOR TO PER	RFORM REPAIRS					40.00
1 CTRBOR	COUNTER BOR	RETOOL			200.00		00.00
Total Labor 1,240.00 Total Parts	s 0.00	Total Other	200.00	Prepay	\$0.00	Job#3 Tota	al 1,440.00

DISCLAIMER OF WARRANTIES	Parts :	8,444.32
ANY WARRANTIES ON THE PRODUCTS SOLD HEREBY ARE THOSE MADE BY MANUFACTURER, IF ANY.	Labor :	8,215.00
THE SELLER HEREBY EXPRESSLY DISCLAIMS ALL WARRANTIES EITHER EXPRESS OR IMPLIED,	Sublet :	0.00
INCLUDING ANY IMPLIED WARRANTI ON MERCINA ASSUMES NOR AUTHORIZES ANY OTHER PERSON	Prepay:	\$0.00
TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF SAID PRODUCTS. WE HEREBY CERTIFY THAT THESE GOODS WERE PRODUCED IN COMPLIANCE WITH ALL APPLICABLE	Other Charges :	\$200.00
REQUIREMENTS OF SECTIONS 6, 7 AND 12 OF THE FAIR LABOR STANDARDS ACT OF 1936, AS	Misc Supplies :	95.00
AMENDED AND OF REGULATIONS AND ORDERS OF THE ADMINISTRATOR OR WAGE AND HOUR	EPA Charge :	15.00
DIVISION ISSUED UNDER SECTION 14 THEREOF.	Sales Tax :	0.00
Please remit to: Sioux City Truck Sales, Inc. PO Box 386 Sioux City, IA 51102-0386		
	Total:	16,969.32

Customer Signature X

5