

Service Invoice

Invoice Date 8/11/2022

Page 1 of 3

Store Location 3501 Jeffers St North Platte, NE 69101 (800) 494-9560

Bill To: Wilson Feed Yard, Inc 75695 Road 321 Grant, NE 69140-2023 USA Jobsite:

Wilson Feed Yard, Inc 3501 S Jeffers St North Platte, NE 69101-7847

USA

Account Number Invoic		Invoice I	Number	Customer PO Division			
0073150 INV532		170			СМ		
Document Number		Payment Terms		Service Call Date		Service Writer	
SC550743		CHARGE- 15th Day of Following Month		06/29/2022		Alek J Janecek	
Make	Model		Serial Number	Customer Equipment Number	Eq	uipment Number	Last Meter
AA 277C		JWF02131		CU	110246	3,922.00	

Workscope Extended Price

Replace - Both - Track Belt

Customer complaint:

Replace tracks

Resultant damage:

Missing cogs on tracks

Cause of failure:

none

Repair process comments:

I had to torch off track tensioner, torched off pin. Removed idlers, removed tracks. Removed sprockets, disassembled sprockets. Assembled sprockets with new parts. Installed new tracks with new tensioner, pin and hard ware. Tensioned tracks

Doute				
Parts	0500000	OLEEVE INDIED	0.40	000.00
72.00	2583088	SLEEVE INNER	9.49	683.28
72.00	2583089	SLEEVE OUTER	10.04	722.88
24.00	2583122	BOLT CARRIAG	19.47	467.28
24.00	1K6872	NUT	1.29	30.96
24.00	7X3392	WASHER	0.70	16.80
2.00	2583083	TENSION GP	147.26	294.52
2.00	7X0371	BOLT	7.49	14.98
2.00	3E9862	LOCKNUT	7.10	14.20
2.00	8T4360	BOLT	1.50	3.00
2.00	2583078	PIN	5.34	10.68
2.00	2583084	RING MIDDLE	116.70	233.40
2.00	2583086	RING OUTER	114.71	229.42
2.00	2583087	RING INNER	117.43	234.86
2.00	2583085	SPROCKET CAS	177.96	355.92
2.00	4209877	TRACK	2,343.80	4,687.60
Labor				
		Total Labor		1,670.25
Miscella	neous			
1.00		FRT	107.62	107.62
			Total Segment Parts	7,999.78
			Total Segment Labor	1,670.25
			Total Segment Miscellaneous	107.62
			Segment Total	9,777.65

Continued on back



Service Invoice

Invoice Date 8/11/2022

Page 2 of 3

Workscope Extended Price

Check - Pins & Bushings - Bucket

Customer complaint:

Quick coupler loose.

Resultant damage:

Damaged pins, bushings and bores

Cause of failure:

Lack of grease

Repair process comments:

Removed quick coupler from loader frame. Removed old bushings. Cleaned all surfaces. The bores for the new bushing were enlarged and would not fit the new bushing properly. Customer chose not to have bores built and bored. New bushings are very loose. Installed the new bushings and pins and greased.

Parts					
4.00	3B8489	FITTING	2.14	8.56	
4.00	6K4148	BEARING	25.19	100.76	
2.00	1429091	PIN AS	93.88	187.76	
1.00	FST0838471	1X1X1/4 60G FLP WHEEL	7.47	7.47	
2.00	3456511	PIN AS	56.34	112.68	
1.00	MSC4589587	YELLOW PAINT	11.60	11.60	
Labor					
		Total Labor		1,179.00	
Miscellaneous					
1.00		FRT	10.85	10.85	



Service Invoice

Invoice Date 8/11/2022

Page 3 of 3

	Extended Price
 Total Segment Parts	428.83
Total Segment Labor	1,179.00
Total Segment Miscell	•
Segment Total	1,618.68
Total Invoice Parts	8,428.61
Total Invoice Labor	2,849.25
Total Invoice Miscellane	
Total Tax	797.74

Thank you for choosing NMC. We appreciate your business!



Go Paperless. Visit us online at http://nmc-corp.com/paperlessinvoicing to register your account for convenient 24/7 online access to invoices, statements, and secure electronic payment options.



Please detach and include this portion with your payment.

Account Number	Invoice Number	Invoice Date
0073150	INV532470	08/11/2022

Please Pay This Amount:

\$12,194.07

Claims for shortages or damages must be made within 5 days of receipt of invoice.

Approved returns subject to restock/handling charges.

No service adjustment unless NMC, Inc. is notified, in writing, within 30 days.

For billing inquiries please call: (800) 891-8015, or email: billing@nmc-corp.com

Remit To: NMC, LLC P.O. Box 911784 Denver, CO 80291-1784