2/7/2024

Replace clutch, clutch brake, pllot bearing, rear main seal, bell housing gasket, shift tower gasket, drain and add new synthetic trans fluid, resurface flywheel

CVS GROUP LLC

PO Box 57187 Des Moines, IA 50317 CHRIS@ICSLOG.COM 515-265-7417

Purchase Order

Unit

Unit: 50386 VIN: 1XPXD49X9ED236333 2014 Peterblit 389 Current Usage: 0 Miles

Description	Quantity	Rate	Amount
Service: Manual Transmission & Clutch: Manual Transmission and Clutch Inspection / Change Trans Oil	0	\$150.00	\$0.00
clutch	1	\$1,215.70	\$1,215.70
resurface flywheel	1	\$217.50	\$217.50
bell housing gasket	1	\$54.49	\$54.49
clutch brake kit	1	\$58.99	\$58.99
shift tower gasket	1	\$23.40	\$23.40
50 WT SYN TRANS FLUID	20	\$15.74	\$314.70
		Subtotal	\$1,884.78
and the second of the second o		p Supplies	\$0.00
		Labor	\$0.00
		Parts	\$1,884.78
		Subtotal	\$1,884.78
	(7% of	Local \$1,884.78)	\$131.93

Total \$2,016.71

*: Core charges not included in total. You will be charged for any core that is not in returnable condition. This charge may be applied on a separate invoice.

The details and the estimate for the repairs provided above are based on our first inspection and do not constitute a guarantee that no further work or parts will be required. The estimate is not a guarantee of the final price of the repairs. The total bill of work and final price will be as per the details available on completion of the repairs. Other terms and conditions as applicable. If you authorize us to perform the above repairs, either verbally or in writing, you agree to pay in full for the work performed and parts required.

Customer signature		
Printed Name:	Dato:	

CVS GROUP LLC

PO Box 57187 Des Moines, IA 50317 CHRIS@ICSLOG.COM 515-265-7417 Involce:

INV-6

Date:

3/13/2024

Bill To 3BD Trucking LLC 8017 County Road P34 Fort Calhoun, NE 68023 P: 402-427-3305 Remit Paymont To
CVS GROUP LLC
PO Box 57187
Des Moines, IA 50317

	Service Order	Terms	Due Date	Authorizer	Customer PO		Unit#
	SO-1012 COD		3/13/2024	Bob Work			50386
tem	Description				Quantity	Rate	Amount
		nck and crank overh	aul				
	nt: Replace engine blo	ock and crank, oven	adi				
,ause: C	Customer request						
abor	Englne / Overhau Completed: 3/13/		plock and crank, overha	aul - Created: 3/11/2024	64.00000	\$150.00	\$9,600.00
Parts	ISX 15 block and				1.00000	\$6,900.00	\$6,900.00
Parts	KIT - INFRAME				1.00000	\$4,170.00	\$4.170.00
Parts		ANGE HEAD CAP			22,00000	\$21.46	\$472.12
Parts	PUMP, LUBRICA				1,00000	\$661.51	\$661.51
Parts	LUBE SPIN				1.00000	\$49.43	\$49.43
Parts	SEAL, OIL				1.00000	\$93.21	\$93.21
Parts	GASKET, ADAP	TER			1.00000	\$17.81	\$17.81
Parts	GASKET, FLYW	HEEL HOUSING			1.00000	\$85.79	\$85.79
Parts	ISX15 FRONT C				1.00000	\$65.17	\$65.17
Parts		NE, CUMMINS ISX			1.00000	\$21.80	\$21.80
Parts		NE, CUMMINS ISX			1.00000	\$1 5.54	\$15.54
Parts	15W-40 HP EXF				13.00000	\$19.26	\$250.38
Parts	ANTIFREEZE, F	REG, PREMIX 50/50			12.00000	\$15.45	\$185.43
Parts	KIT - BEARING				3.00000	\$33.75	\$101.25
Parts	KIT, SEAL				1,00000	\$148.58	\$148.58
Parts	FREON R134A				4.00000	\$16.05	\$64.19
Parts	SCREW, HEX F	LANGE HEAD CAP			4.00000	\$20.97	\$83.88
Parts	PAINT CECO				1.00000	\$44.94	\$44.9
Parts	10 OZ WHT LIT	·нм			1.00000	\$17.48	\$17.4
Parts	SHOP SOLVEN	IT 230Z			4.00000	\$9.00	\$36.0
Parts	1/4" CLEAR PR	REMIUM SHRINK TU	JBE ES-1		3.00000	\$0.99	\$2.9
Parls	16-14 GA NON	INSUL BUTT CON	1		3.00000	\$0.33	\$0.9

24, 3.47 PM	Invoices	Overtilly	Rate	Amount
	Description	Quantily 16,00000	\$0.75	\$12.00
Parts	14" CABLE TIE 120 LB	1.00000	\$40.59	\$40.59
Parts	36ML THRD LOCK	3.00000	\$7.82	\$23.48
Parts	DEXRON III	1.00000	\$84.35	\$84.35
Parts	FUEL SPIN-ON	1.00000	\$70,46	\$70.46
Parts	FUEL ELEMENT	1.00000	\$362.98	\$362.98
Parts	FLYWHEEL CUMMINS ISX SIG NATURE 600	1.00000	\$1,215.70	\$1,215.70
Parts	CLUTCH EASY PEDAL AD	1.00000	\$37.04	\$37.04
Parts	BEARING, HIGH TEMP FLYWHEEL PI	1.00000	\$ 36.75	\$ 36.75
Parts	DISC, CLUTCH BRAKE	1.00000	\$8.38	\$8.38
Parts	SHIFT TOWER GASKET	2.00000	\$44,41	\$88.83
Parts	MOTOR MOUT BUSHING	2.50000	\$43.50	\$108.75
Parts	HYDRAULIC FLUID	20.00000	\$15.74	\$314.70
Parts	50 WT SYN TRANS FLUID	20.00000	3-04-2380-60 (4-	\$25,492.46
	Replace clutch, clutch brake, flywheel, trans fluid			
(Inspection)		a 02000		\$0.00
Labor	Clutch / Clutch / Replace clutch, clutch brake, flywheel, trans fluid - Created: 3/13/2024	0.00000		\$0.00
	Completed: 3/13/2024		Subtotal	\$0.00
	the second control of		22 : 0 C 1000 PM	
			Labor	\$9,600.00
Unit: 50386 2014 Peterb	; VIN: 1XPXD49X9ED236333		Parts	\$15,892.46
	01,485 Miles	St	nop Supplies	\$68.00
		Pre-Cha	rge Subtotal	\$25,560.46
		(7% o	Local f \$25,560.46)	\$1,789.23
			Total	\$27,349.69
		Payme	nts & Credits	\$0.00
			Balance Due	\$27.349.69

Any warranties on the parts and accessories sold hereby are made by the manufacturer. You understand and agree that we make no warranties of any kind unless expressed in writing. You hereby authorize us to perform the repair work herein set forth and to purchase the necessary material and parts to perform such repair work. You agree that we are not responsible for loss or damage to your vehicle or articles left in your vehicle in case of fire, theft, or any other cause beyond our control or for any delays caused by unavallability of parts or delays in part shipments by the supplier or transporter. In addition, you agree that we are not responsible for damages to your vehicle from freezing due to lack of antifreeze. You hereby grant our employees permission to operate your vehicle on streets, highways, or elsewhere for the purpose of testing and/or inspection. You acknowledge and agree that an express mechanic's lien on your vehicle is granted to secure payment of this invoice for the repair work detailed in this invoice.

Customer Sign	ature:	



1208 31st Ave **COUNCIL BLUFFS, IA 51501**

(712) 366-6440

WORK, ROBERT - 110771 Sold

To 8017 CO RD 34

FORT CALHOUN NE 68023

WORK, ROBERT - 110771 Ship

8017 CO RD 34 To

FORT CALHOUN NE 68023

SERVICE INVOICE RA104007593:01

ESTIMATE: ES104006423

CONTACT # (402) 427-3305 UNIT NO 50386

MILEAGE 697.146

VIN 1XPXD49X9ED236333

PO NO

LICENSE 236333

YEAR/MAKE/MODEL 2014 / PETERBILT / 389

DATE CREATE 7/5/23

ENG HRS 0

DATE INVOICED. 7/8/23

R RATIO

ENGINE/MODEL/SN / / 79672942

TAG # 7465

TRANS/MODEL/SN: //

DRIVER CONTACT

RXLS/MODEL/SN / /

DAIL SCHEDELLD 7/5/2023 9:09 18A1 DEL MILE

Sold Operations

JOB#1 CI

COURTESY INSPECTION

COMPLAINT

COURTESY INSPECTION -- ROBERT 702 427 3305

CAUSE

CORRECTION

		UNIT PRICE EXTO PRICE
CTY ITEM	DESCRIPTION	
1		

Sublet Labor: Misc Parts: Prepay:












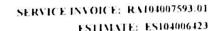



Sold Operations (Cont.)

JOB #2 EA EXPRESS ASSESSMENT

COMPLAINT CAUSE CORRECTION POSSIBLE EXHAUST LEAK AT ECM -- CHECK/ADVISE

TEST DROVE TO LISTEN FOR EXHAUST LEAK STEVE WAS TALKING ABOUT. DID NOT HEAR ANYTHING. SENT REQUEST FOR EGR VALVE IS ORDERED FROM CUMMINS. REMOVED THE OLD EGR VALVE AND THEN INSTALLED THE NEW ONE. HOOKED THE COMPUTER TO THE TRUCK AND FOUND THE EXHAUST PRESSURE SENSOR TO HAVE A CODE. LOOKED IT OVER AND FOUND THE SENSOR TO BE BROKEN. REPLACED THE SENSOR AND THE CODE WENT INACTIVE. I CLEARED THE CODES AND AM HAVING IT TEST DRIVEN.

	1	DESCRIPTION UNIT PRICE	EXTOPRICE
OTY	ITEM	CLAMP V BAND 66 63	66 63
1	104C/3685309	00 121	184 99
1	104C/4928594	SENSOR PRESSURE	1 885 08
1	104C/5406049RX	KIT EXH RCN VALVI:	120030000 10000
-1	104C/5406049RX-CORE	(3686640D) KIT EXII RCN VALVE 156.25	-156 25
• 1		(3686640D) KIT EXII RCN VALVE	156 25
1	J04C/5406049RX-CORE	0 (2)	
1	104D/BRZ CT 300 L SS	CLAMP-CT HOSE 2 1/4-3 1/8 5	26.31
1	104D/DN X002252	REST INDICATOR- 25m POP UP	
-	LABOR EA-10	LABOR	511 50
	CHORLETTE	Prepay \$0.00 Parts \$2,171.43 Labor \$511.50 Misc \$0.00 Sublet \$0.00	\$2,682.93

Sold Operations Totals Prepay: \$0.00 Parts: \$2,171.43 Labor: \$511.50 Mise: \$0.00 Sublet: \$0.00 \$2,682.93

By executing below, you hereby agree that any dispute in any way related to the services rendered (except for any dispute regarding your failure to pay for services rendered or the creation, perfection or foreclosure of any lien or security interest) shall be submitted to final and binding arbitration under the commercial arbitration rules of the American Arbitration Association. Nebraska law shall govern the arbitration proceeding and the arbitration trial shall occur in Omaha, Nebraska. TCC MAKES NO REPRESENTATION WARRANTY OF ANY KIND WHATSOEVER, EXPRESS OR IMPUED, INCLUDING WITHOUT LIMITATION REPRESENTATIONS OR WARRANTIES WITH RESPECT TO MERCHANTABILTY. NONINFRINGEMENT OF THIRD-PARTY RIGHTS. AND FITNESS OR SUITABILITYFOR ANY PURPOSEOR USE. FURTHER, YOU AGREE THAT TCC SHALL NOT BE LIABLE TO YOU OR ANY PARTY FOR ANY SPECIAL, INCIDENTAL, INDIRECT, PUNITIVE. EXEMPLARY OR CONSEQUENTIAL DAMAGES OF ANY KIND, ARISING OUT OF, RELATING TO OR IN CONNECTION WITH THE SERVICES RENDERED, EVEN IF TCC HAS BEEN ADVISED, KNOWS OR SHOULD HAVE KNOWN OF THE POSSIBILTY OF SUCH DAMAGES.

CREDIT C	ARD
1-118	(A11) (B11)
LABOR	\$511.50
PARTS	\$2,171.43
MISC	\$0.00
SUBLET	50 ()()
PREPAY	\$0.00
SUBTOTAL	\$2,682.93
SHOP SUPPLIES	576 72
MISC SUPPLIES	\$0.00
ΓAX	\$193.17
TOTAL	\$2,952.82

Please Remit Payment to Truck Center Companies - Council Bluffs

PO Box 27379

Opalbry NE 68127 VISA******8861

\$2,952 82

<u>AuthNbr</u> 694920

AUTHORIZED BY

DATE

REMIT TO: PO Box 27379 Omaha, NE 68127 866-751-1189













14321 Cornhusker Road **OMAHA. NE 68138**

(402) 592-2440

WORK, ROBERT - 110771 Sold

To 8017 CO RD 34

FORT CALIJOUN NE 68023

WORK, ROBERT - 110771 Ship

To 8017 CO RD 34

FORT CALHOUN NE 68023

SERVICE ORDER RA106026611

ESTIMATE: 13557503

UNIT NO. 50386

VIN: 1XPXD49X9ED236333

YEAR/MAKE/MODEL: 2014 / PETERBILT / 389

ENGINE/MODEL/SN: / / 79672942

TRANS/MODEL/SN: //

RXLS/MODEL/SN: //

CONTACT # (402) 427-3305

PO NO

MILEAGE 701,302 LICENSE 236333

DATE CREATE 8/7/23

ENG HRS 0

DATE INVOICED

R RATIO

DRIVER CONTACT

TAG # 6757

ран усперенты 8/7/2023 12 00 00А **DEL MILE**

Sold Operations

JOB #1 COURTE: COURTESY VEHICLE INSPECTION

COMPLAINT

COURTESY VEHICLE INSPECTION - (COURTESY INSPT) - ROBERT 402-427-3305

CAUSE

CORRECTION

QTY	ITEM	DESCRIPTION	UNIT PRICE	EXTD PRICE

Prepay:

Parts

Labor: Misc

Sublet















ESTIMATE: 13557503

Sold Operations (Cont.)

JOB #2 EA

EXPRESS ASSESSMENT

COMPLAINT CAUSE CORRECTION

EXPRESS ASSESSMENT - (EA) - TOWED IN - TURBO BLOWN

269/119567. CHECKED TURBO FOR BEING BLOWN PULLED CAC PIPE OF AT TURBO AND IT WAS FULL OF OIL CAC WILL NEED REMOVED AND CLEANED AND ALSO PRESSURE CHECK FOR LEAKS. CHECKED OUTLET SIDE AND THERE WAS OIL ALSO. AFTERTREATMENT WAS LEAKING OIL OUT OF V BAND CLAMPS. REMOVED OUTLET PIPE OF EGR COOLER AND IT WAS DRY WILL NEED A NEW NUT FOR CLAMP AT EGR COOLER CALLED CUSTOMER TO SEE IF TRUCK WAS DELETED AND IT IS SHOULD STILL REMOVED AFTERTREATMENT AND WASH OIL OUT 12/59640- DRAIN COOLANT, REMOVE EXHAUST PIPES FROM TURBO REMOVE COOLANT LINES FROM TURBO. REMOVE OIL DRAIN. REMOVE VGT ACTUATOR FROM TURBO, REMOVE TURBO, HAD SERVICE MANAGER INSPECT FAILED TURBO. REMOVE HOOD SPRINGS AND CABLES REMOVE CAC PIPE FROM LIIS, RECOVER FREON 4 05LBS REMOVED REMOVE AC CONDENSOR FROM TRUCK. REMOVE CAC CROM TRUCK. REMOVE AIR CLEANER PIPING FROM TRUCK. REMOVE AIR FILTER HOUSING CAPS AND REMOVE AIR FILTERS. CLEAN OUT AIR FILTER HOUSING ASSEMBLY RHS AND LHS OF TRUCK. STEAM OUT CAC AND AIR CLEANER PIPING. SET CAC TO DRAIN AND DRY OUT. SWAP FITTING FROM OLD TURBO TO NUEW TURBO. INSTALL NEW TURBO WITH NEW GASKET AND MOUNTING NUTS 12/59640- INSTALL TURBO OIL RETURN WITH NEW GASKET INSTALL CHARGER AIR COOLER AND AC CONDENSOR RECONNECT AC LINES, STARTED VACCUM AND LEAK TEST - PASSED CHARGED AC TO 4 LBS CONNECTED ALL COOLANT LINES TO TURBO, TURBO COOLANT SUPPLY LINE WAS VERY RUSTY AND TWISTED REMOVE COOLANT LINE AND INSTALL NEW COOLANT LINE RAN VGT INSTALL PROCEDURE-PASS INSTALL VGT AND CALIBRATED VGT- FAIL. NEEDS NEW VGT, CONTACTED CUSTOMER, CUSTOMER APPROVED NEW VGT. CONNECTED NEW VGT AND RAN INSTALL PROCEDURE- PASS. INSTALL NEW VGT. WITH NEW GASKET AND BOLTS RAN CALIBRATION PROCEDURE- PASS INSTALL REMAINING COOLANT LINES AND PUMPED COOLANT BACK INTO ENGINE INSTALL NEW AIR FILTERS AND AIR FILTER PIPING REMOVE COVER FOR SCR SYSTEM REMOVE LOWER EXHAUST PIPE REMOVE MODULE FROM TOP OF SCR 12/59640- REMOVE DOC AND DPF TUBE. REMOVE EXHAUST PIPE CONNECTOR AND EXHAUST PIPE. TAKE TO WASH BAY AND STEAM OUT OIL INSTALL DPF/DOC, HAD TO MODIFY I BAND CLAMP TO WORK INSTALL EXHAUST EXTENDER WITH NEW GASKETS INSTALL EXHAUST PIPE UP TO DOSER PIPE WITH NEW GASKET INSTALL REMAINING AIR INLET PIPING TOP OFF COOLANT AND OIL INSTALL SCR COVERS AND STEPS. START TRUCK AND CONNECTED TO INSITE CLEAR INACTIVE CODES ROAD TESTED AND CKD OP-ALL OK

0.104	ITEM	DESCRIPTION	UNIT PRICE	EXTO PRIC
atv	106C/2880213	CLAMP V BAND	71.40	71.4
7	106C/2880215	GASKET AFM DEVICE	26 30	52 6
 -	106C/3684359	GASKET ATM DEVICE GASKET EXILOUT CONNECTION	18.85	18 8
<u>.</u>	106C/4034289RX-CORE	(2837201D) KIT VG TUR ACT SERV	312.50	-312 5
-1	106C/4298975	NUT LOCK	12.72	50.8
	106C/4318952	TUBE TUR COOLANT SUPPLY	158.55	158 5
	106C/4966441	GASKET EXILOUT CONNECTION	26 48	26 4
	106C/4966454	CLAMP V BAND	67.65	135 3
- -	106C/6378270RX	KIT VG TUR ACT SERVICE	1,921 87	1,921 8
- -	106C/6378270RX-CORE	(2837201D) KIT VG TUR ACT SERV	312 50	312.5
-	106D/DN P625128	FILTER - AIR PRIMARY RADIA	164 62	161.6
	106D/MBL 125152	MOBIL DELVAC HDEO 15W-40 BULK	20 55	15.4
()	106D/OWI 23519399	BULK ALLIED 50/50 ANTIFREEZE	9.81	3 9
	C	BAY 7 PLEASE		
	LABOR EA-10	EXPRESS ASSESSMENT		3,135 0
	LABOR FA-10	EXPRESS ASSESSMENT - (EA)		495 0













SERVICE ORDER: RA106026611

ESTIMATE: 13557503

			Sold Operatio	ns (Cont.)			
QTY	ITEM	DESCRIPTION				UNIT PRICE	EXTO PRICE
1	IRI	FREIGHT				35.00	35 00
i i i i i i i i i i i i i i i i i i i			Parts \$2.619 88	Labor \$3,630 00	Misc \$35 00	Sublet \$0.00	\$6,284.88
Sold Op	perations Totals	Prepay: \$0.00	Parts: \$2,619.88	Labor: \$3,630.00	Mise: \$35.00	Sublet: \$0.00	\$6,284.88

By executing below, you hereby agree that any dispute in any way related to the services rendered (except for any dispute regarding your failure to pay for services rendered or the creation, perfection or foreclosure of any lien or security interest) shall be submitted to final and binding arbitration under the commercial arbitration rules of the American Arbitration Association. Nebraska as shall govern the arbitration proceeding and the arbitration trial shall occur in Omaha, Nebraska. TCC MAKES NO REPRESENTATION WARRANTY OF ANY KIND WHATSOEVER, EXPRESS OR IMPLIED, INCLUDING WITHOUT LIMITATION REPRESENTATIONS OR WARRANTIES WITH RESPECT TO MERCHANTABILTY. NONINFRINGEMENT OF THIRD-PARTY RIGHTS. AND FITNESS OR SUITABILITYFOR ANY PURPOSEOR USE. FURTHER, YOU AGREE THAT TCC SHALL NOT BE LIABLE TO YOU OR ANY PARTY FOR ANY SPECIAL, INCIDENTAL, INDIRECT, PUNITIVE, EXEMPLARY OR CONSEQUENTIAL DAMAGES OF ANY KIND, ARISING OUT OF, RELATING TO OR IN CONNECTION WITH THE SERVICES RENDERED, EVEN IF TCC HAS BEEN ADVISED, KNOWS OR SHOULD HAVE KNOWN OF THE POSSIBILTY OF SUCH DAMAGES.

CREDIT C	ARD
ISHN	IAILD BILLID
1.ABOR	\$3,630 00
PARTS	\$2,619.88
MISC	\$35 00
SUBLET	\$0.00
PREPAY	\$0.00
SUBTOTAL	56,284.88
SHOP SUPPLIES	\$300 00
MISC SUPPLIES	\$0.00
ГАХ	\$162.52
TOTAL	\$6,747.40

Please Remit Payment to Truck Center Companies P O Box 27379 Omaha, NE 68127

AUTHORIZED BY

DATE

REMIT TO: PO Box 27379 Omaha, NE 68127 866-751-1189













DUPLICATE

MYCO MAINTENANCE, INC. (JUNC)

1256 MAIN ST

JUNCTION CITY WI 54443

715-457-4774

Invoice:

JUN-00029149

PO:

Remit To: Wayne Transport

14345 CONLEY AVENUE

Invoice Dt:

5/1/2023

JUN-00030780 RO:

ROSEMOUNT MN 55068-4441

Open Dt:

3/20/2023

JUNC Shop:

Tel:

651-438-6495 x 1095 Fax: 651-438-6494

Customer: Cust Ph:

WORROB

402-427-3305

Email:

Fax:

Robert Work

8017 County Road P34

Ft Cahoun NE 68023 robertework@yahoo.com Unit:

VIN:

Make:

Model:

Year:

50386 1XPXD49X9ED236333

License: Division: 210034 PET

JCT

PTRBL

389 SL

2014

Department: Cost Center: PETJUN

Currency:

US\$ - United States

Dollars

ODOMETER :

683,245

Section:

0

Comment:

Fee SHOP SUPPLIES

Qty 1.00

Total Charge 89.51 89.512

Charge

15.00

95.00

89.51

Section:

1

Comment:

018-001-004 Component:

Description:

Oil Seal - Front Wheel

Complaint:

LEAKING

Cause:

Correction:

Job Code: Rep Reason:

DRIVERREPORT

Comment

Paccar - Peterbilt, Council

Bluffs, IA RO113092456:01

Lube Leak

Qty Fee 1.00 **EPA CHARGE** 1.00 SHOP FEE

110.00 Charge Services 529.58 529.58 Council Bluffs, IA Tax

529.58

Total

0.00

Total

15.00

95.00



Section:

Comment:

Component: Description:

023-002-001 Clutch Assembly **OUT ADJUST**

Complaint: Cause:

BROKEN

Correction:

REPLACED NEW

Job Code:

Rep Reason: DRIVERREPORT

Comment

Replaced broken Grease Zerk Fitting from Throw Out Bearing & greased. Secured Grease Line. Adjusted Clutch

to spec.

0.00 Total Charge Labor Time 201.25 Labor 161.00 1.25 Clutch Assembly BROKEN REPLACED NEW Causes:

BROKEN Corrections: REPLACED NEW

Otv	Charge	Total
20.00	61.93	61.93
1.00		
4.00	2.45	2.45
1.00		
4.00	22	0.22
1.00	****	
	-	64.60
	1.00 1.00 1.00	1.00 61.93 1.00 2.45

Section:

3

Comment:

053-999-029

Component: Description:

Grease - Fifth Wheel Plate

Complaint:

CUSTREQUEST

Cause:

Correction:

Job Code:

Rep Reason: DRIVERREPORT

Comment

Greased 5th Wheel

Greased 5th Wheel			0.00
	Qty	Charge	Total
Part		3.00	3.00
113P/106029EXX - M - Grease XHP 222	1.00	_	3.00

201.25

Page: 2 of 5



Section:

Comment:

024-002-046 Component:

Universal Joint - Drive Shaft, All Positions Description:

WORN OUT Complaint: USE

Cause:

REPLACED NEW Correction:

Job Code:

Rep Reason: DRIVERREPORT

Comment

Replaced U-Joint & Bearing Retainer w/new.

Total Charge **Labor Time** 402.50 161.00 Labor 2.50 Universal Joint - Drive Shaft, All Positions USE REPLACED

0.00

NEW Causes: USE Corrections: REPLACED

	_	402.50
Otv	Charge	Total
	213.16	213.16
1.00	(14-6)	12.35
1.00	12.35	12.33
4.00	27.63	27.63
1.00		23.46
1.00	23.46	25.40
		_
4.00	14.18	14.18
1.00		
		290.78
	1.00 1.00 1.00 1.00 1.00	1.00 213.16 1.00 12.35 1.00 27.63 1.00 23.46

Version: 23.20.2.179

Page: 3 of 5



REPLACED NEW

Section:

5

Comment:

Component: 018-002

Description:

Drive Axle Hubs & Bearings

Complaint:

WORN OUT

Cause: Correction:

tion: REPLACED NEW

USE

Job Code:

Rep Reason: DRIVERREPORT

Labor	Labor Time	Charge	Total
Drive Axle Hubs & Bearings USE REPLACED NEW Causes: USE Corrections:	10.50	161.00	1,690.50

REPLACED NEW			
KEI BIOED HEIT		-	1,690.50
Part	Qty	Charge	Total
113P/RSP400342WEL - Carrier - Eaton	1.00	1765.83	1,765.83
113P/RSP400342WEL-CORE - Carrier - Eaton - Core - \$973.42	1.00	.00	0.00
113P/CM10081520 - Kit - Seal & Spacer	2.00	78.69	157.38
113P/SET401TRB - Set - Bearing 580/572	2.00	57.44	114.88
113P/SET403TRB - Set - Bearing 594A/592A	2.00	68.30	136.60
113P/512087ETN - Kit - Stud	1.00	103.16	103.16
113P/03-01568 - CG03- 01568E Shaft	2.00	5.14	10.28
113I/26033 - Ultra Grey Silicone	1.00	13.17	13.17
113P/170-70-18X - Kit - Bearing Retainer	1.00	26.89	26.89
113P/170-4-281-1X - Yoke Assembly - End SPL170 2.024-39	1.00	216.14	216.14
113M/ABP-10081520 - Seal Kit	2.00	61.50	123.00
113P/550026918 - Oi' - Spirax S6 AXRME 75W-90DR2 - 32.12 X \$7.04	1.00	226.13	226.13
J2.12 / W1.03		-	2,893.46

Section:

6

Comment:

Component: 013-002-027

Description:

Pad - Disc Brake

Complaint: Cause: WORN OUT

Correction:

INSPECTED

Job Code:

Rep Reason: DRIVERREPORT

Comment

Replaced RDA Brake Pads

w/new.

Labor	Labor Time	Charge	Total
Pad - Disc Brake USE	.50	161.00	80.50

REPLACED NEW Causes:

USE Corrections: INSPECTED

80.50

0.00

Version: 23.20.2.179

© 2015, 2023 Trimble Inc. All rights reserved. Unauthorized duplication, copying, or use prohibited. Page: 4 of 5

User ID: TMSVAMS SSRS SRV

4/5/2024 1:25 PM



Section:

Comment:

013-001-028 Component:

Description: Caliper Assembly - Disc Brake

FROZEN Complaint: USE Cause:

REPLACED NEW Correction:

Job Code:

Version: 23.20.2.179

Rep Reason: DRIVERREPORT

~	mc	_	-	-

Replaced RR Brake Caliper

w/new

0.00

Total **Labor Time** Charge Labor 161.00 1.00 161.00 Caliper Assembly - Disc Brake

USE REPLACED NEW Causes: USE Corrections: REPLACED NEW

161.00

Total Qty Charge Part 1,667.81 1667.81 1.00 113P/K097850SCBXW -ADB22X Caliper w/Carrier .00 0.00 1.00 113P/K097850SCBXW-CORE - ADB22X Caliper w/Carrier -Core - \$472.86

Balance Due:

1,667.81

Page: 5 of 5

89.51 SHOP SUPPLIES

28.00 **Total Parts Issued:** 175 75 **Total Labor Hours:** 4,919.65 **Total Part Charges:** 2,535.75 **Total Labor Charges:** 0.00 **Total Fuel Charges:** 529.58 **Total Service Charges:** 7,984.98 Repair Total: 0.00 Taxes: 199.51 Fees: 0.00 Discount: 8,184.49 Invoice Total: 0.00 **Amount Paid:** 8,184.49

© 2015, 2023 Trimble Inc. All rights reserved. Unauthorized duplication, copying, or use prohibited.

4/5/2024 1:25 PM User ID: TMSVAMS SSRS SRV

INTERSTATE

Power Systems

10143 SCUTH 136TH SIREET OMAHA, NE 68138-3924 PHONE: (402) 331-4104

FAX:

(402) 331-2961

www.istate.com

ACCOUNT NUMBER: 204182

INVOICE NUMBER: R013101636:01 10/13/2022 INVOICE DATE:

CASE INVOICE TERMS:

VEHICLE#:

674083

ORIG. DOCUMENT: E013009895



SERVICE INVOICE

BILL-TO

3BD TRUCKING

8017 COUNTY ROAD T34 FORT CALHOUN, NE 68023 SHIP-TO

3BD TRUCKING

8017 COUNTY ROAD T34 FORT CALHOUN, NE 68023

		PETERBILT	Model:	CONVENTIO	N/Tag #:	CS.
Cust. Unit #: 50386	Make: Model#:	PETERBIET	In Serv Date:	12/31/9999	Year:	2014
VIN: 1XPXD49X9ED236333 Engine S/N: 79672942	Model #:	6X1u13D150000000	In Sery Date:		Mileage:	1
Tran S/N: Reefer S/N: APU S/N:	Model #: Model #: APU Gen S/N:		In Serv Date: In Serv Date: In Serv Date: BOM/Spec:		Eng IIrs: Warr ID: Date Crea	0 te: 09/28/2022

Sold Operations

SHF-CMN Job#1

SHOP - CUMMINS LABOR

S-CUST

Condition

BLOWING COOLANT OUT OVER FLOW

Cause

10143 SCUTH 136TH STREET OMAHA, NE 68138-3924 PHONE: (402) 331-4104

(402) 331-2961 FAX:

www.istate.com

ACCOUNT NUMBER: 204182

INVOICE NUMBER: R013101636:01 10/13/2022 INVOICE DATE:

CASH INVOICE TERMS:

674083 VEHICLE : ORIG. DOCUMENT: E013009895



Correction Pulled EGR HOT PIPE CLAMP CFF. MADE SURE IT WAS DRY AND IT IS. DRAINED CCOLANT. REMOVED CAC PIPING. REMOVED UPPER AND LOWER RAD HOSE. REMOVED MOUNTING KUTS FROM RAD. PULLED RAD OFF. RECOVERED AC SYSTEM. PULLED FAN SHROUD OFF ENGINE. REMOVED FAN. REMOVED HUB. GOT SPACER PLACE AND CRANK PULLEY OFF. DAMPNER IS SIEZED ON CRANK, HEATED IT. SPRAYED IT WITH PB BLASTER STILL WOULDN'T MOVE, GOING TO LET IT SOAK OVERNIGHT THEN SEE IF IT COMES OFF IN MORNING. UNDID WIRE HAPNESS COING TO RIGHT SIDE OF ENGINE. HUNG IT OFF TO SIDE. UNBOLIED TURBO AND REMOVED IT. REMOVED VALVE COVER. REMOVED ROCKERS. NEED TO REMOVE A COUPLE MORE THINGS ON SIDE OF ENGINE. REMOVED REST OF BRACKETS AND LINES FROM SIDE OF ENGINE. REMOVED DAMPENER. PULLED OFF FRONT COVER. REMOVED CAM GEAR. HAD TO PULL CAM OUT OF HEAD. CHECKED OVER CAMSHAFT AND IT IS FLAKING. ROLLER ON NUMBER FIVE WHERE CAM IS FLAKED IS JUNK TO. LOOSENED HEAD BOLTS. PULLED HEAD OFF ENGINE. HEAD GASKET WAS BLOWN IN ONE SPOT. FOUND THAT WHEN I REMOVED BELLOS ON EXHAUST MANIFOLD CIL AND COOLANT CAME OUT. REMOVED EXHAUST MANIFOLD. NUMBER 2 VALVES ARE WET WITH CIL AND COCLANT. STARTED CLEAN UP BLOCK, NEED TO CLEAN TWO MORE SPCTS AND CHECK LINER HEIGHTS. STARTED TEARING DOWN OLD HEAD. REMOVED FUEL LINES. REMOVED CROSSOVER TUBES. PULLED INJECTORS. REMOVED INTAKE. REMOVED FUEL RAIL. REMOVED BRACKETS. PUT CLD HEAD ON GROUND, PICKED UP NEW HEAD, SET IT ON BENCH, SWAPPED OVER INJECTOR C RINGS AND COPPER WASHERS. CLEANED UP CROSSOVER TUBES BECAUSE THEY HAD A BUNCH OF RUST ON THEM. PUT INJECTORS IN. PUT CROSSCVER TUBES IN. TORQUED TO SPEC. PUT FUEL RAIL ON. TIGHTENED IT DOWN. PUT FUEL LINES ON. TORQUED TO SPEC. PUT BRACFET THAT SITS BEHIND RAIL ON TIGHTENED IT DOWN. PUT THERMOSTAT HOUSING ON. TORQUED TO SPEC. PUT LIFTING EYES ON. TIGHTENED IT DOWN. PUT HEATER HOSE BLOCK ON TORQUED TO SPEC. PUT EXHAUST MANIFOLD ON. TORQUED TO SPEC. PUTT HE INTAKE ON TORQUED TO SPEC. BLEW CUT BOLT HOLES. CLEANED BLOCK AGAIN. PULLED FOUR PLUGS OUT OF BLOCK. SET HEAD GASKET ON. PUT CYLINDER HEAD ON. GOT IT LINED UP. TORQUED BOLTS TO 150 THEN TO 300, TORQUED 90 DEGREES ON HEAD BOLTS. PUT ASSEMBLY LUBE ON CAM BEARINGS. PUT CAMSHAFT IN ENGINE. PUI BACK PLATE ON. PUT CAM SPACER IN. PUT ENGINE IN TIME. PUT ENGINE ON TDC. PUT IDLER GEAR AND CAM GEAR ON. LEFT THEM LOCSE. GOT GEAR LASH SET. TORQUED IDLER GEAR TO SPEC. TORQUED CAM GEAR TO SPEC. PUT FRONT COVER GASKET IN. PUT FRONT COVER IN PARTS WASHER. PUT FRONT ROCKER SHAFTS ON. TORQUED THEM. PUT FRONT COVER ON. TORQUED TO SPEC. PUT DAMPNER ON TORQUED THAT TO SPEC. PUT FAM HUB ON TIGHTENED BOLTS. PUT BRACKETS BACK ON RIGHT SIDE OF ENGIEN. PUT EGR VALVE CN. TIGHTENED IT DOWN. PUT BELTS ON FRONT OF ENGINE. HOOKED UP COOLANT LINES. HOOKED UP INJECTOR HARNESS. HOOKED UP WIRE HARNESS. PUT FAN ON. PUT TURBO CN. RUN OVERHEAD. PUT RAD IN. SE BACK ROCKERS SHAFT IN. TGRQUED TO SPEC. RAN OVERHEAD. PUT TURBO ON, TIGHTENED IT ALL DOWN, PUT BELLOWS CN. TIGHENED CLAMPS, PUT EGR PIPE ON. TIGHTENED CLAMPS. PUT FITTING FROM INTAKE TO COMPRESSOR ON. TIGHTENED LINE AND HOSE CLAMP. TIED UP WIRE HARNESS. STABBED RAD. HOOKED UP. HOOKED UP EGR CROSSOVER PIPE. GOT CAC PIPES ON AND TIGHT. WAS GONG TO PUT INTAKE PIPING ON BUT BRANDON IS MESSING WITH LIGHTS AND IT WOULD BE IN HIS WAY. FILLED TRUCK UP WITH COCLANT, HAD TO GET A LOWER RAD BUSHING, GOT HOOD SPRINGS AND CABLE ON. PUT CLIPS IN. TRUCK HAD CODES FOR INJECTOR 3 AND 6. CHMED OUT WIRES GOING TO INJECTOR 3 GOT OL. OHMED OUT WIRES GOING TO SIX.3 CHMS. REMOVED CROSSOVER TUBE. REMOVED VALVE COVER. DISCONNECTED INJCTOR HARNESS OHMED SCLENIOD. .3 OHMS ON BOTH. GOT AN INJECTOR HARNESS. PUT HARNESS IN. GOT TPUCK RUNNING.

	INJECTOR HARNES	S. PUT HARNESS IN. GOT TPUCK RUNNING.	Price Each	Extended
QEY	Item	Description		6,400.00
	CMN-GEN	SHOP - CUMMINS LABOR UPPER ENGINE GASKET KIT	1,773.08	1,773.08
1	013XX4376104-013		72.15	72.15
1	013FR3680758	PLATE, CLAMPING	3€.49	3€.4
1	5594275NN	SENSOR, POSITION	3€.22	36.2
1	013FR559427ENX	SENSOR, POSITION	8.88	53.2
6	013XX2872717-013	O-RING	6.49	38.9
6	013XX3347939-013	C RING	2,819.83	2,819.8
1	013ME4298629-013	CAMSHAFT	2,819.63	27017

10143 SCUTH 136TH STREET OMAHA, NE 68138-3924 PHONE: (402) 331-4104

FAX: (402) 331-2961

www.istate.com

ACCOUNT NUMBER: 204182

INVOICE NUMBER: R013101636:01 INVOICE DATE: 10/13/2022

INVOICE TERMS: CASE

674083 VEHICLE : ORIG. DOCUMENT: E013009895



) (ESTEND IN PRIOR HEER HURS ROBER HOLD BOLL HER AND A STATE AND A		
	Sold Operations (Cont.)	13.50	13.50
	BOLT	6,532.18	6,532.18
1 5575513-013	ATVS CYLINDER HEAD	101.68	101.68
1 013MXHDEN429823	MANIFOLD GASKET	20.47	81.88
1 013XX3688347-01	TURBO NUT	15.77	31.54
4298975-013	WASHER SEAL	47.88	47.98
2 3684284-013	T BOLT	222.43	222.43
1 013MX3686838-01	ROCKER LEVER	99.39	198.78
1 5484231-013	CLAMP	2.32	2.32
2 3683144-013 1 IMP 72333	HOSE CLAMP #16 LINED	ē.50	8.50
21757775659	SEAL, O RING	15.92	15.9
	SEAL, O RING	15.02	60.01
1 013FR367884C 4 CNI 23519398	FPWRCLPLSDRUM/BULK ANTIFRZ EXT	36.17	3€.1
1 013XX3678610-01	13 THREADED PLUG	26.68	2€.€
1 DDE 23525918	RTV 85GRAM	399.12	399.1
1 013XX3686370-03	13 INJECTOR HARNESS	57.81	57.8
1 013MX07-03286P0		22.00	44.0
2 HWC07816	WASHER	21.00	-21.0
-1 5594275NX-CORE	(4383999D) SENSCR, POSITION	21.00	-21.0
-1 5594276NX-CORE	(4383999D) SENSCR, POSITION	21.00	21.0
1 5594275NX-CORE	(4383999D) SENSCR, POSTITON	21.00	21.0
1 5594276NM-CORE	(12C2COCC) SENSCE POSITION	sc:0.00 Sublet:0.00	19,110.4
	* •		S-CUS

S-CUST IPS CMAHA - DOT Job#3 -013-000005

Condition IPS OMAHA - DOT

Correction INSPECTED TRUCK, FOUND RIGHT SIDE HEADLIGHT HIGH AND LOW BEAM NOT WORKING, REAR RUNNING LIGHTS WERE NOT WORKING. MISSING LEFT SIDE MUD FLAP. FILLED OUT DOI

Oty	Item	Description	Extended 90.00
1 1	·013-CTH000005 S-ESC S-DTS	IPS CMAHA - DOT SERVICE- ESC SERVICE- DIS Prepay:0.00 Parts:0.00 Labor:85.50 Misc:4.50 Sublet:0.00	90.00
		SHOP - OTHER LABOR	5-CUSI

Condition NO TAIL LIGHTS

Cause

10143 SCUTH 136TH STREET CMAHA, NE &8138-3924 (402) 331-4104 PHONE:

(402) 331-2961 FAX:

www.istate.com

ACCOUNT NUMBER: 204182

R013101636:01 INVOICE NUMBER: 10/13/2022 INVOICE DATE:

CASH INVOICE TERMS:

674083 VEHICLE#: ORIG. DOCUMENT: E013009895



Sold Operations (Cont.)

Correction

CHECKED AT LIGHTS AND HAVE GROUND. HAD TO FIGURE OUT RUNNING LIGHT AND BRASE LIGHT WIRES. UNDID LOOM AND FOUND LOTS OF BUTT CONNECTORS. CHECKED AND MADE SURE THEY WERE ALL GOOD CONNECTIONS. TESTED TAIL LIGHTS AND THEY WORK. FOLLOWED WIRING UP TO CONNECTOR. FIGURED OUT ALL OF THE PINS AND TESTED HARNESS BACK TO LIGHTS AND THEY WORK. GETTING GROUND AT TERMINAL THAT NEEDS POWER FOR RUNNING LIGHTS. FUSE BOX DOES NOT HAVE COVER SO TESTED ALL FUSES FOR BLOWN FUSES. REPLACED 3 BAD FUSES. USED SWITCH TO FIND WHAT FUSE KEEPS BLOWING. FOLLOWED WIRING HAPESS UP TRUCK AND CANNOT FIND ANY ISSUES BUT CANNOT SEE WHERE HARNESS GOES CHICE IT GETS BY TRANSMISSION, TRIED LOOKING UP WIRING DIAGRAMS ON MITCHELL, NEED TO PULL FUSE BOX APART TO SEE WHERE WIRING GOES TO MAIN CONNECTOR. POWER WIRE TO LIGHT IS SHORIED TO GROUND. FUSE WILL NOT BLOW WHEN CONNECTOR UNDER FUSE PANEL IS NOT HOOKED UP. CHECKED ALL WIRES IN COMMECTER FOR CONTINUITY TO GROUND AND FOUND ONE THAT DOES. CHECKED WIRE AND IT WAS NOT CORRECT. TRIED AGAIN TO FIND A DIAGRAM BUT CANNOT FIND ANYTHING. STARTED CHECKING ALL CONNECTORS ON FIREWALL TO FIND PINS THAT HAVE POWER AND IT GOES AWAY WHEN SWITCH IS SHUT OFF. FOUND PIN AND CHECKED WIRE ON OTHER END OF CONNECTOR AND FOUND IT HAS CONTINUITY TO GROUND. RAH JUMPER WIRE FROM CONNECTOR TO LIGHTS AND LIGHTS WORK AS THEY SHOULD THROUGH SWITCH. ROUTED WIRE ON TRUCK ALONG POWER HARNESS AND SECURED ALL WIRING UNDER TRUCK. SPLICED WIRE IN AT CONNECTOR ON FIREWALL AND AT PLUG AT REAR OF TRUCF. SPLICED III WIRE TO TRAILER LIGHT WIRING. CHECKED AND TRAILER CORD IS GETTING POWER THROUGH MARKER LIGHT PIN. CHECKED LIGHTS AND CNLY HAD ONE LIGHT ON. CHECKED WIRING FROM PLUG TO LIGHT. FOUND THERE WAS A BUTT CONNECTOR WITH BAD CONNECTION. CUT OUT ALL 3 BUTT CONNECTORS AND REPLACED WITH GOOD CONNECTORS. WENT OVER EVERYTHING AGAIN AND CHECKED THAT LIGHTS WORK WITH THE SWITCHES

AND CUECKE		VED THAT LIGHTS WORK WITH IND SHITTENES		
3-2	AND CHECK	KED THAT LIGHTS WORK WITH THE SWITSHEE	Price Each	Extended
Oty	Item	Description		690.00
	CTH-GEN	SHOP - OTHER LABOR SHOP - OTHER LABOR		0.00
	CTH-GEN	Prepay: 0.00 Parts: 0.00 Labor: 690.00 Mi	sc:0.00 Sublet:0.00	690.00
				S-011ST

shp-orn Joh# 5

SHOP - OTHER LABOR

Condition

DRIVERS SIDE MUDFLAP MISSING

Cause

Correction

GOT PICTURE OF MUD FLAP ON PASSENGER SIDE AND SENT TO PARTS. ORDERED HANGER, MUD FLAP, AND REFLECTOR CUT NEW MUD FLAP TO SIZE OF OLD ONE. MEASURED AND MARKED OUT WHERE HANGER BOLTS ON NEW MUD FLAP. DFILLED OUT HOLES AND BOLTED HANGER AND REFLETOR TO MUD FLAP. BROKEN OFF HANGER WAS SEIZED INTO MOUNT SO TOCK TIME GETTING IT HIT CUT. INSTALLED NEW MUD FLAP AND PUT PIN IN TO SECURE.

GETTING IT MIT GOT: INCIDEN			Price Each	Extended
Sty	Item	Description		20.00
1	OTH-GEN	SHOP - CIHER LABOR		80.00
	013XXBTSA91R	FLAP HANGER	63.52	63.52
		24X30 MUDELAP	14.58	14.58
	013XXGLC2430PPSB	Prepay:0.00 Parts:78.10 Labor:80.00 Misc:0.0	Sublet:0.00	158.10

10143 SCUTH 136TH STREET OMAHA, NE 68138-3924 (402) 331-4104 PHONE:

(402) 331-2961 FAX:

www.istate.com

ACCOUNT NUMBER: 204182

R013101636:01 INVOICE NUMBER: 10/13/2022 INVOICE DATE:

CASE INVOICE TERMS:

674083 VEHICLE#:

ORIG. DOCUMENT: E013009895



65.25 Diagnostic/Tech Services: 7,255.50 Labor: AuthNbr Paid via 4.50 Misc. Charges: 12,788.56 Parts: \$20,238 81 CASH 0.00 Sublet: 0.00 Prepay: 125.00 Shop Supplies (ESC): 0.00 Taxes: 20,238.81 Total:

This document is subject to the General Terms and Conditions, the Mechanic's Lien Rider, the Abandoned Vehicle Rider, the Storage Fee & Lien Rider, fampered Emissions Systems Policy, and Code of Conduct, which are expressly incorporated herein by reference, and are available at https://www.istate.com/ierms-conditions/ or in hard copy upon request.

All claims must be accompanied by this invoice. Diagnostic and Technical service charge may apply

Date:	
	Date: