



Joe Busch Ag Repair, Inc.

1708 250th Street ~ Boone, IA 50036

Sales Order

Date	9/20/2016
S.O. No.	2791
Account #	
Terms	Due on receipt

Name / Address

MARK PLATT
 237 W. MULBERRY ST.
 OGDEN, IA 50212
 (515) 490-9516

PAID

MDL:	MFR:	SER #:	HRS:	Worker	P.O. No.
------	------	--------	------	--------	----------

656 CASE/IH 044307 7151

SJ

Qty	Part #	Description	List Price	Act. Price	Ext. Price
-----	--------	-------------	------------	------------	------------

1	TRUCK	TRUCK FREIGHT CHGS		100.00	100.00T
1	STH 1310	CARB KIT		33.92	33.92T
1	71425C92	CARB SOLENOID		63.25	63.25T
1	382400R1	HOSE		21.00	21.00T
1	UPS	SOLENOID AND HOSE FRT.		6.69	6.69T
6	D16	516 SPARK PLUG		2.73	16.38T
2.25	15W40	ENGINE OIL-GAL.		13.865	31.20T
1	51151	8000 SER OIL FILTER		6.18	6.18T
1	BA	BOIL FLUSH OVEN EXTRACT AND REBOIL TANK		185.11	185.11T
1	370832R91	SEDIMENT BOWL ASSEMBLY		32.60	32.60T
1	HH224839	TRIPLE BAFFLE FUEL CAP		43.33	43.33T
1	UPS	BOWL AND CAP FRT.		9.50	9.50T
1	369154R1	GASKET, FUEL GAUGE		6.70	6.70T
1	151	SHOP SUPPLIES & HAZ		30.00	30.00T
20	LABOR-S...	NOTES BELOW		92.00	1,840.00T

HAULED IN FROM FARM DUE TO NOT RUNNING

REMOVED WHEEL WEIGHTS FROM EACH SIDE

FREED UP WHEELS FROM AXLES AND REMOVED REAR WHEELS AND TIRES.

SWAPPED WHEELS AND TIRES FROM SIDE TO SIDE TO GET AS NARROW AS POSSIBLE.

RE INSTALLED WHEEL WEIGHTS.

CHANGED OUT SPARK PLUGS CAP , ROTOR AND DID TUNED UP.

PULLED OFF CARB AND REBUILT IT WITH A NEW CARB

Subtotal

Sales Tax (7.0%)

Total

Fax # (515)433-6052

Web Site www.joebuschagrepair.com

E-mail joebuschag@gmail.com



Joe Busch Ag Repair, Inc.

1708 250th Street ~ Boone, IA 50036

Sales Order

Date	9/20/2016
S.O. No.	2791
Account #	
Terms	Due on receipt

Name / Address


MARK PLATT
 237 W. MULBERRY ST.
 OGDEN, IA 50212
 (515) 490-9516

PAID

MDL:	MFR:	SER #:	HRS:	Worker	P.O. No.
656	CASE/IH	044307	7151	SJ	

Qty	Part #	Description	List Price	Act. Price	Ext. Price
-----	--------	-------------	------------	------------	------------

KIT AND CARB SOLENOID.
 INSTALLED CARB ALONG WITH NEW INTAKE BOOT AND GOT IT RUNNING GOOD.
 PULLED HOODS OFF TO GET AT RUSTED FUEL TANK
 REMOVED TANK & HAD IT BOILED OUT TO REMOVE RUST
 REPLACED FUEL BOWL AS IT WAS LEAKING.
 TESTED AND RAN GOOD.
 CUSTOMER WANTS LIGHTS & LEAKING RADIATOR REPAIRED THIS WILL BE ON ANOTHER INVOICE
 TRACTOR ALSO NEEDS NEW TORQUE - BUT WILL WAIT UNTIL OTHER REPAIRS ARE DONE

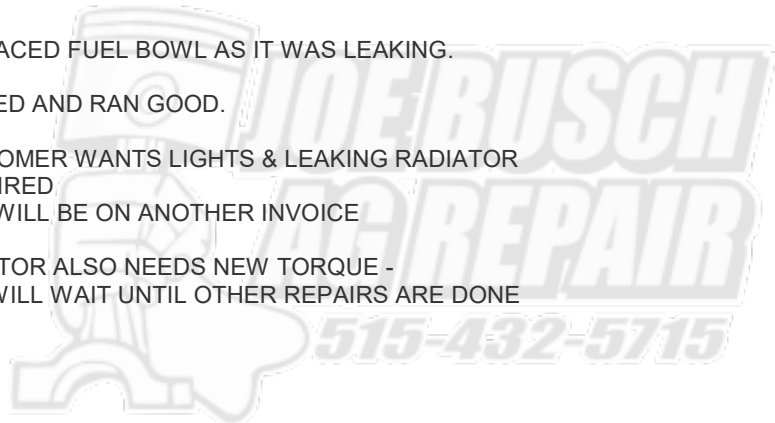

Subtotal	\$2,425.86
Sales Tax (7.0%)	\$169.81
Total	\$2,595.67