



BTI Bucklin
 94 SE 30 Road
 Great Bend, KS 67530
 (800) 817-9921
 (620) 793-3500

BTI Bucklin (800) 334-4823 (620) 826-3271
 BTI Greensburg (888) 723-3331 (620) 723-3331
 BTI Ness City (800) 572-2251 (785) 798-2410
 BTI Pratt (800) 573-5606 (620) 672-5606
 BTI Hoxie (844) 688-4362 (785) 675-8207
 BTI Great Bend (800) 817-9921 (620) 793-3500



SERVICE INVOICE

Invoice To Account No: 16803

Deliver To:

VINCENT FREES 430 8TH RD BUSHTON KS 67427 Bus Phone: (620)562-3236 Prv Phone:	VINCENT FREES 430 8TH RD BUSHTON KS 67427 Bus Phone: (620)562-3236 Prv Phone:	Invoice Number: 793531 Invoice Date: 3/27/2024 Location: 7 Work Order Number: 129322 Payment Type: Finance Page: 1 of 21
---	---	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9300	11389	RW9300H001847	99921341	

ALL/9001/OC/590 Retail
 CORRECTION:
 TECH NAME: LOUIS L.

WINTER SERVICE INSPECTION 2023-2024

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
37900	PTS DISC ALLOW	1.00	0.00	-2,073.15	(\$2,073.15)	N
<i>Comments: 5% Parts Discount</i>						
ROLLBACK7	SVC ROLLBACK INSPECTION DISC/GB	1.00	0.00	-900.00	(\$900.00)	N
<i>Comments: Free Inspection</i>						
Labor: \$900.00		Parts: \$0.00		OL&M: \$0.00		Misc: (\$2,973.15)
						Sub-Total: (\$2,073.15)

9300/7369/RCB/10 Retail
 CORRECTION:
 R & I RH CONSOLE BACK LIGHT BULBS SUP

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
R107890	BULB	3.00	3.84	3.84	\$11.52	N
R117645	BULB	2.00	4.99	4.99	\$9.98	N
Labor: \$165.00		Parts: \$21.50		OL&M: \$0.00		Misc: \$0.00
						Sub-Total: \$186.50

9300/1409/CRY/10 Retail
 CORRECTION:
 LIGHT BULBS CORNER POST DISPLAY - Remove & Install

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
R107890	BULB	5.00	3.84	3.84	\$19.20	N
Labor: \$54.00		Parts: \$19.20		OL&M: \$0.00		Misc: \$0.00
						Sub-Total: \$73.20

GEN-04 Retail
 CORRECTION:



BTI Bucklin
94 SE 30 Road
Great Bend, KS 67530
(800) 817-9921
(620) 793-3500

BTI Bucklin (800) 334-4823 (620) 826-3271
BTI Greensburg (888) 723-3331 (620) 723-3331
BTI Ness City (800) 572-2251 (785) 798-2410
BTI Pratt (800) 573-5606 (620) 672-5606
BTI Hoxie (844) 688-4362 (785) 675-8207
BTI Great Bend (800) 817-9921 (620) 793-3500



SERVICE INVOICE

Invoice To Account No: 16803

Deliver To:

VINCENT FREES 430 8TH RD BUSHTON KS 67427 Bus Phone: (620)562-3236 Prv Phone:	VINCENT FREES 430 8TH RD BUSHTON KS 67427 Bus Phone: (620)562-3236 Prv Phone:	Invoice Number: 793531 Invoice Date: 3/27/2024 Location: 7 Work Order Number: 129322 Payment Type: Finance Page: 2 of 21
---	---	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9300	11389	RW9300H001847	99921341	

GEN-04 Retail

REPLACE BRAKE HOSE:

-WAS IN THE MIDDLE OF BLEEDING THE BRAKES AND SEEN THAT THERE WAS HYDRAULIC OIL LEAKING OUT ONTO THE FLOOR, FOUND THAT THE BRAKE HOSE FROM THE BRAKE VALVE TO THE FRONT AXLE HAD BLOWN OUT.
-DISCONNECTED BRAKE HOSE FROM THE FRONT AXLE, FOUGHT DISCONNECTING THE BRAKE HOSE FROM THE BRAKE VALVE BECAUSE OF THE LOCATION AND BECAUSE THE FRONT DUALS WERE ALREADY BACK ON.
-REMOVED BRAKE HOSE, HAD A NEW HOSE MADE, INSTALLED NEW BRAKE HOSE, AGAIN FOUGHT CONNECTING THE HOSE TO THE BRAKE VALVE, CONNECTED HOSE TO THE FRONT AXLE, TIGHTENED FITTINGS.
-TOPPED OFF HYDRAULIC OIL, TEST RAN, NO MORE LEAKS, TOPPED OFF HYDRAULIC OIL AGAIN.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind	
X1J943-6-6	ELBOW FITT	1.00	29.00	29.00	\$29.00	N	
X1JC43-6-6	HOSE FITTING	1.00	11.97	11.97	\$11.97	N	
X487-6-RL	3/8" 4000 PSI HYDRAULIC HOSE	25.00	0.72	0.72	\$18.00	N	
Labor: \$438.00				Parts: \$58.97	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$496.97

9300/7281/LH/10 Retail

CORRECTION:

DOOR LEFT HAND - Remove & Install
Removed door cylinder. Removed and installed cab door. Installed seal

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind	
RE570092	SEAL	1.00	57.31	57.31	\$57.31	N	
Labor: \$412.50				Parts: \$57.31	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$469.81

GEN-06 Retail

CORRECTION:

REPOSITIONED THE WIPER ARM, TIGHTENED THE WIPER ARM TO WIPER MOTOR RETAINING NUT

Labor: \$66.00				Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$66.00
-----------------------	--	--	--	----------------------	-------------------------	---------------------	---------------------------

9300/7288/HOD/10 Retail

CORRECTION:



BTI Bucklin
 94 SE 30 Road
 Great Bend, KS 67530
 (800) 817-9921
 (620) 793-3500

BTI Bucklin (800) 334-4823 (620) 826-3271
 BTI Greensburg (888) 723-3331 (620) 723-3331
 BTI Ness City (800) 572-2251 (785) 798-2410
 BTI Pratt (800) 573-5606 (620) 672-5606
 BTI Hoxie (844) 688-4362 (785) 675-8207
 BTI Great Bend (800) 817-9921 (620) 793-3500



SERVICE INVOICE

Invoice To Account No: 16803

Deliver To:

VINCENT FREES 430 8TH RD BUSHTON KS 67427 Bus Phone: (620)562-3236 Prv Phone:	VINCENT FREES 430 8TH RD BUSHTON KS 67427 Bus Phone: (620)562-3236 Prv Phone:	Invoice Number: 793531 Invoice Date: 3/27/2024 Location: 7 Work Order Number: 129322 Payment Type: Finance Page: 3 of 21
---	---	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9300	11389	RW9300H001847	99921341	

9300/7288/HOD/10 Retail
 LATCH HOOD - Remove & Install

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
11M7012	Cotter Pin	1.00	0.35	0.35	\$0.35	N
R134907	LATCH	1.00	17.27	15.71	\$15.71	N
RE50874	LATCH	1.00	56.02	56.02	\$56.02	N
Labor: \$67.50		Parts: \$72.08		OL&M: \$0.00		Misc: \$0.00
						Sub-Total: \$139.58

9300/7340/HOD/10 Retail
 CORRECTION:
 HANDLE HOOD - Remove & Install

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE65577	HANDLE	1.00	185.13	185.13	\$185.13	N
Labor: \$45.00		Parts: \$185.13		OL&M: \$0.00		Misc: \$0.00
						Sub-Total: \$230.13

9300/8111/HOD/E/10 Retail
 CORRECTION:
 ISOLATOR HOOD (EACH) - Remove & Install

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
R237211	ISOLATOR	2.00	142.76	142.76	\$285.52	N
Labor: \$75.00		Parts: \$285.52		OL&M: \$0.00		Misc: \$0.00
						Sub-Total: \$360.52

9300/7064/10 Retail
 CORRECTION:
 GUDGEON - Remove & Install
 Removed gudgeon drive shaft. Disconnected oil lines/hoses, harnesses routed to hinge area. Disconnected drive shaft at the clutch. Replaced needed parts (spindle wear plate, thrust bearing race, bearing race, joint yoke assembly, pins, bushings, drive shaft retainer, v-ring seal, drive shaft ball bearing, etc.) Reinstall everything back in reverse order.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------



BTI Bucklin
 94 SE 30 Road
 Great Bend, KS 67530
 (800) 817-9921
 (620) 793-3500

BTI Bucklin (800) 334-4823 (620) 826-3271
 BTI Greensburg (888) 723-3331 (620) 723-3331
 BTI Ness City (800) 572-2251 (785) 798-2410
 BTI Pratt (800) 573-5606 (620) 672-5606
 BTI Hoxie (844) 688-4362 (785) 675-8207
 BTI Great Bend (800) 817-9921 (620) 793-3500



SERVICE INVOICE

Invoice To Account No: 16803

Deliver To:

VINCENT FREES 430 8TH RD BUSHTON KS 67427 Bus Phone: (620)562-3236 Prv Phone:	VINCENT FREES 430 8TH RD BUSHTON KS 67427 Bus Phone: (620)562-3236 Prv Phone:	Invoice Number: 793531 Invoice Date: 3/27/2024 Location: 7 Work Order Number: 129322 Payment Type: Finance Page: 4 of 21
---	---	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9300	11389	RW9300H001847	99921341	

9300/7064/10 Retail

Part Number	Description	Qty	Unit Price	Total Price	Extended Price	Unit Price	Quantity	Unit Price	Extended Price	Unit Price	Quantity
15H558	PIPE PLUG	1.00	2.42	2.42	\$2.42						N
19M7402	Cap Screw	1.00	1.53	1.53	\$1.53						N
AR98492	PACKING	4.00	66.58	66.58	\$266.32						N
JD7760	LUBRICATIO	2.00	1.24	1.24	\$2.48						N
R104769	Wear Plate	2.00	62.19	62.19	\$124.38						N
R104770	Thrust Bearing Race	2.00	304.75	304.75	\$609.50						N
R104771	BEARING RA	2.00	220.93	220.93	\$441.86						N
R120162	UNIVERSAL	1.00	629.68	629.68	\$629.68						N
R135274	SLEEVE	2.00	31.74	31.74	\$63.48						N
R168008	Bushing	3.00	64.96	64.96	\$194.88						N
R78303	WASHER	4.00	7.28	6.72	\$26.88						N
R78304	SHIM	4.00	11.35	11.35	\$45.40						N
R81678	Pin	1.00	224.60	224.60	\$224.60						N
R84624	RETAINER	2.00	37.33	37.33	\$74.66						N
R84824	SEAL	8.00	25.31	25.31	\$202.48						N
R86105	V-RING SEA	1.00	55.67	55.67	\$55.67						N
R93908	Washer	4.00	20.18	20.18	\$80.72						N
R98309	CAP SCREW	1.00	13.25	13.25	\$13.25						N
RE24390	BALL BEARING	1.00	152.16	152.16	\$152.16						N
RE26738	SEAL	2.00	37.93	37.93	\$75.86						N
RE28227	Pin	1.00	626.38	626.38	\$626.38						N
RE328026	Seal	1.00	285.11	285.11	\$285.11						N
RE62901	ISOLATOR	2.00	55.39	55.39	\$110.78						N
RE62910	ISOLATOR	2.00	89.57	89.57	\$179.14						N
TY22467	CLAMP	1.00	1.33	1.33	\$1.33						N
U11017	O-RING	1.00	8.11	8.11	\$8.11						N



BTI Bucklin
 94 SE 30 Road
 Great Bend, KS 67530
 (800) 817-9921
 (620) 793-3500

BTI Bucklin (800) 334-4823 (620) 826-3271
 BTI Greensburg (888) 723-3331 (620) 723-3331
 BTI Ness City (800) 572-2251 (785) 798-2410
 BTI Pratt (800) 573-5606 (620) 672-5606
 BTI Hoxie (844) 688-4362 (785) 675-8207
 BTI Great Bend (800) 817-9921 (620) 793-3500



SERVICE INVOICE

Invoice To Account No: 16803

Deliver To:

VINCENT FREES 430 8TH RD BUSHTON KS 67427	VINCENT FREES 430 8TH RD BUSHTON KS 67427	Invoice Number: 793531
Bus Phone: (620)562-3236	Bus Phone: (620)562-3236	Invoice Date: 3/27/2024
Prv Phone:	Prv Phone:	Location: 7
		Work Order Number: 129322
		Payment Type: Finance
		Page: 5 of 21

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9300	11389	RW9300H001847	99921341	

9300/7064/10 Retail								
W23832	Spacer	1.00	18.40	18.40	\$18.40	N		
72304	HOSE CLAMP M20S	1.00	0.95	0.95	\$0.95	N		
Labor: \$6,600.00	Parts: \$4,518.41	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$11,118.41				

9300/4303/R/10 Retail
 CORRECTION:
 R & I RIGHT SIDE STEERING CYLINDER.
 Disconnected hydraulic lines
 Removed spring pins
 Removed pins and seals

Labor: \$375.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$375.00
------------------------	----------------------	-------------------------	---------------------	----------------------------

GEN-12 Retail
 CORRECTION:
 WASHED OFF STEERING CYLINDER, DISASSEMBLED THE RH STEERING CYLINDER TO RECONDITION IT AND FOUND THAT THE ROD WAS BAD, INFORMED AND DISCUSSED WITH SHOP MANAGER, PRICED THE ROD AND SEAL KIT, ALSO PRICED A NEW STEERING CYLINDER, INFORMED AND DISCUSSED WITH SHOP MANAGER AGAIN AND SAID TO JUST ORDER A NEW STEERING CYLINDER, ORDERED NEW STEERING CYLINDER, DISPOSED OF OLD STEERING CYLINDER.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AHC23068	HYDRAULIC	1.00	1,073.13	1,073.13	\$1,073.13	N
KK75266	Coupling	1.00	19.64	19.64	\$19.64	N
R211864	BUSHING	2.00	45.46	45.46	\$90.92	N
Labor: \$183.00	Parts: \$1,183.69	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,366.69		

9300/1358/EG/10 Retail
 CORRECTION:
 FAN ENGINE - Remove & Install
 Removed RH shields. Removed cap screws securing fan. Removed and installed fan blade. Installed cap screws and tightened to specification. Installed shields



BTI Bucklin
94 SE 30 Road
Great Bend, KS 67530
(800) 817-9921
(620) 793-3500

BTI Bucklin (800) 334-4823 (620) 826-3271
BTI Greensburg (888) 723-3331 (620) 723-3331
BTI Ness City (800) 572-2251 (785) 798-2410
BTI Pratt (800) 573-5606 (620) 672-5606
BTI Hoxie (844) 688-4362 (785) 675-8207
BTI Great Bend (800) 817-9921 (620) 793-3500



SERVICE INVOICE

Invoice To Account No: 16803

Deliver To:

VINCENT FREES 430 8TH RD BUSHTON KS 67427 Bus Phone: (620)562-3236 Prv Phone:	VINCENT FREES 430 8TH RD BUSHTON KS 67427 Bus Phone: (620)562-3236 Prv Phone:	Invoice Number: 793531 Invoice Date: 3/27/2024 Location: 7 Work Order Number: 129322 Payment Type: Finance Page: 6 of 21
---	---	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9300	11389	RW9300H001847	99921341	

9300/1358/EG/10 Retail

Labor: \$462.00 Parts: \$0.00 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$462.00

GEN-14 Retail

CORRECTION:

REPLACE COOLANT HOSE FROM TANK TO THERMOSTAT HOUSING:

-LOOSENED THE HOSE CLAMP, PULLED THE HOSE OFF OF THE FITTING, PLUGGED FITTING, CUTOFF/TRIMMED THE BAD SPOT AT THE END OF THE HOSE, REMOVED PLUG FROM FITTING, SLID THE HOSE BACK ONTO THE FITTING, TIGHTENED HOSE CLAMP.

Labor: \$60.00 Parts: \$0.00 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$60.00

GEN-15 Retail

CORRECTION:

REPLACE FAN BELT IDLER AND TENSIONER IDLER BEARING:

-REMOVED FAN BELT TENSIONER, REMOVED DUST COVER FROM THE TENSIONER IDLER, REMOVED IDLER FROM TENSIONER, REMOVED SNAP RING FROM IDLER, REMOVED BOTH OLD BEARINGS, LOOKED UP AND RETRIEVED PARTS.

-INSTALLED TWO NEW BEARINGS IN IDLER, INSTALLED SNAP RING IN IDLER, INSTALLED IDLER ONTO THE TENSIONER, INSTALLED NEW DUST COVER IN THE TENSIONER IDLER, INSTALLED FAN BELT TENSIONER.

-REMOVED FAN BELT IDLER DUST COVER, REMOVED IDLER, REMOVED SNAP RING FROM IDLER, REMOVED BOTH OLD BEARINGS FROM IDLER, INSTALLED TWO NEW BEARINGS IN IDLER, INSTALLED SNAP RING IN IDLER, INSTALLED FAN BELT IDLER, INSTALLED NEW DUST COVER IN THE FAN BELT IDLER.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
JD7658	BALL BEARI	4.00	39.65	38.87	\$155.48	N
R129083	V-BELT	1.00	81.61	81.61	\$81.61	N
R131083	V-Belt	1.00	49.37	49.37	\$49.37	N
R99590	COVER	2.00	5.09	5.09	\$10.18	N

Labor: \$136.50 Parts: \$296.64 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$433.14



BTI Bucklin
 94 SE 30 Road
 Great Bend, KS 67530
 (800) 817-9921
 (620) 793-3500

BTI Bucklin (800) 334-4823 (620) 826-3271
 BTI Greensburg (888) 723-3331 (620) 723-3331
 BTI Ness City (800) 572-2251 (785) 798-2410
 BTI Pratt (800) 573-5606 (620) 672-5606
 BTI Hoxie (844) 688-4362 (785) 675-8207
 BTI Great Bend (800) 817-9921 (620) 793-3500



SERVICE INVOICE

Invoice To Account No: 16803

Deliver To:

VINCENT FREES 430 8TH RD BUSHTON KS 67427 Bus Phone: (620)562-3236 Prv Phone:	VINCENT FREES 430 8TH RD BUSHTON KS 67427 Bus Phone: (620)562-3236 Prv Phone:	Invoice Number: 793531 Invoice Date: 3/27/2024 Location: 7 Work Order Number: 129322 Payment Type: Finance Page: 7 of 21
---	---	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9300	11389	RW9300H001847	99921341	

GEN-16 Retail

CORRECTION:

RESEAL DRAIN VALVE:

-CLEANED DEBRIS FROM AROUND THE ENGINE OIL PAN DRAIN VALVE, REMOVED DRAIN VALVE, REMOVED THE OLD O-RING FROM DRAIN VALVE, CLEANED DRAIN VALVE, LOOKED UP AND RETRIEVED NEW O-RING, INSTALLED NEW O-RING ON THE DRAIN VALVE, INSTALLED DRAIN VALVE BACK ONTO THE OIL PAN.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
R56751	O-RING	1.00	2.22	2.22	\$2.22	N

Labor: \$105.00 Parts: \$2.22 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$107.22

9300/4060/RR/10 Retail

CORRECTION:

R & I REAR AXLE:

Drained oil from differential and final drive housings. Removed drawbar. Removed drawbar support stabilizer links. Disconnected hoses and wiring harness connectors. Disconnected drive shaft from rear axle yoke. Removed rear wheels. Removed retaining bolts from axle. Removed axle from under tractor. Installed in reverse order.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
14M7276	NUT	6.00	2.37	2.37	\$14.22	N
19M8190	Cap Screw	6.00	12.42	12.42	\$74.52	N
24M7241	WASHER	6.00	1.90	1.90	\$11.40	N
H77698	TIE BAND	12.00	0.78	0.78	\$9.36	N
R44302	TIE BAND	12.00	0.37	0.37	\$4.44	N
R97519	Cover	4.00	24.64	24.64	\$98.56	N

Labor: \$4,905.00 Parts: \$212.50 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$5,117.50

9300/4050/RR/LJ/10 Retail

CORRECTION:

FINAL DRIVE REAR AXLE LEFT - Remove & Install

Install axle in repair stand. Remove final drive from axle. Install final drive



BTI Bucklin
 94 SE 30 Road
 Great Bend, KS 67530
 (800) 817-9921
 (620) 793-3500

BTI Bucklin (800) 334-4823 (620) 826-3271
 BTI Greensburg (888) 723-3331 (620) 723-3331
 BTI Ness City (800) 572-2251 (785) 798-2410
 BTI Pratt (800) 573-5606 (620) 672-5606
 BTI Hoxie (844) 688-4362 (785) 675-8207
 BTI Great Bend (800) 817-9921 (620) 793-3500



Invoice To Account No: 16803

Deliver To:

SERVICE INVOICE

VINCENT FREES 430 8TH RD BUSHTON KS 67427	VINCENT FREES 430 8TH RD BUSHTON KS 67427	Invoice Number: 793531
Bus Phone: (620)562-3236	Bus Phone: (620)562-3236	Invoice Date: 3/27/2024
Prv Phone:	Prv Phone:	Location: 7
		Work Order Number: 129322
		Payment Type: Finance
		Page: 8 of 21

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9300	11389	RW9300H001847	99921341	

9300/4050/RR/L/10 Retail

Labor: \$750.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$750.00
-----------------	---------------	--------------	--------------	---------------------

9300/4050/RR/R/10 Retail

CORRECTION:
 FINAL DRIVE REAR AXLE RIGHT - Remove & Install
 Install axle in repair stand. Remove final drive from axle. Install final drive

Labor: \$750.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$750.00
-----------------	---------------	--------------	--------------	---------------------

9300/4050/20 Retail

CORRECTION:
 REAR FINAL DRIVES - Recondition BOTH
 -Replaced all the needed parts to complete reconditioning job (bearing cups & cones, spacers, pinion shaft, ring gear, shims, bushings, pinion spun gears, lock plates, etc.)

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Inc
14M7452	Lock Nut	6.00	1.15	1.15	\$6.90	N
19M7781	CAP SCREW	8.00	16.99	16.99	\$135.92	N
19M8622	CAP SCREW	28.00	13.40	13.40	\$375.20	N
24M7243	WASHER	8.00	4.42	4.42	\$35.36	N
F2380R	WASHER	2.00	2.46	2.46	\$4.92	N
F3171R	O-RING	2.00	3.00	3.00	\$6.00	N
JD8248	BEARING CU	2.00	60.80	60.80	\$121.60	N
JD9018	BEARING CO	2.00	84.87	84.87	\$169.74	N
PM38657	SEALANT	4.00	27.20	27.20	\$108.80	N
R110303	Spacer	2.00	142.82	142.82	\$285.64	N
R124067	Plate	1.00	449.72	449.72	\$449.72	N
R124815	Piston	2.00	443.61	443.61	\$887.22	N



BTI Bucklin
 94 SE 30 Road
 Great Bend, KS 67530
 (800) 817-9921
 (620) 793-3500

BTI Bucklin (800) 334-4823 (620) 826-3271
 BTI Greensburg (888) 723-3331 (620) 723-3331
 BTI Ness City (800) 572-2251 (785) 798-2410
 BTI Pratt (800) 573-5606 (620) 672-5606
 BTI Hoxie (844) 688-4362 (785) 675-8207
 BTI Great Bend (800) 817-9921 (620) 793-3500



Invoice To Account No: 16803

Deliver To:

SERVICE INVOICE

VINCENT FREES 430 8TH RD BUSHTON KS 67427 Bus Phone: (620)562-3236 Prv Phone:	VINCENT FREES 430 8TH RD BUSHTON KS 67427 Bus Phone: (620)562-3236 Prv Phone:	Invoice Number: 793531 Invoice Date: 3/27/2024 Location: 7 Work Order Number: 129322 Payment Type: Finance Page: 9 of 21
---	---	--

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9300	11389	RW9300H001847	99921341	

9300/4050/20 Retail

R125069	Pinion Shaft	3.00	337.75	337.75	\$1,013.25	N
R125666	Ring	2.00	20.69	20.69	\$41.38	N
R125667	Ring	2.00	22.17	22.17	\$44.34	N
R135543	WASHER	28.00	1.37	1.37	\$38.36	N
R135966	Ring Gear	1.00	3,701.33	3,701.33	\$3,701.33	N
R160837	Spacer	6.00	18.66	18.66	\$111.96	N
R268521	Thrust Washer	12.00	73.22	73.22	\$878.64	N
R328166	Pinion Shaft	1.00	841.34	841.34	\$841.34	N
R52389	SHIM	2.00	11.91	11.24	\$22.48	N
R538301	BUSHING	2.00	111.96	111.96	\$223.92	N
R54380	DOWEL PIN	2.00	10.99	10.99	\$21.98	N
R560119	PLANET PIN	3.00	1,189.87	1,189.87	\$3,569.61	N
R59439	SHIM	3.00	3.54	3.54	\$10.62	N
R59440	SHIM	7.00	5.68	5.68	\$39.76	N
R61461	SHIM	1.00	2.82	2.82	\$2.82	N
R72232	BALL	4.00	0.86	0.86	\$3.44	N
R81162	BOLT	2.00	37.33	36.60	\$73.20	N
R94545	Lock Plate	2.00	22.46	22.46	\$44.92	N
R94655	Needle Roller	408.00	1.31	1.31	\$534.48	N
RE154280	Brake Disk	2.00	218.39	218.39	\$436.78	N
RE168641	SEAL	2.00	122.50	122.50	\$245.00	N
RE50957	TAPERED ROLLER BEARING	2.00	392.06	392.06	\$784.12	N
TY25744	SYNTHETIC GREASE	1.00	17.31	17.31	\$17.31	N
R122535U	FINAL DRIVE HOUSING	1.00	5,344.89	5,344.89	\$5,344.89	N

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
37501	FREIGHT	1.00	385.34	385.34	\$385.34	N

Comments: R122535U HOUSING FREIGHT



BTI Bucklin
 94 SE 30 Road
 Great Bend, KS 67530
 (800) 817-9921
 (620) 793-3500

BTI Bucklin (800) 334-4823 (620) 826-3271
 BTI Greensburg (888) 723-3331 (620) 723-3331
 BTI Ness City (800) 572-2251 (785) 798-2410
 BTI Pratt (800) 573-5606 (620) 672-5606
 BTI Hoxie (844) 688-4362 (785) 675-8207
 BTI Great Bend (800) 817-9921 (620) 793-3500



Invoice To Account No: 16803

Deliver To:

SERVICE INVOICE

VINCENT FREES 430 8TH RD BUSHTON KS 67427 Bus Phone: (620)562-3236 Prv Phone:	VINCENT FREES 430 8TH RD BUSHTON KS 67427 Bus Phone: (620)562-3236 Prv Phone:	Invoice Number: 793531 Invoice Date: 3/27/2024 Location: 7 Work Order Number: 129322 Payment Type: Finance Page: 10 of 21
---	---	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9300	11389	RW9300H001847	99921341	

9300/4050/20 Retail 37501	FREIGHT		1.00	682.18	682.18	\$682.18	N
Labor: \$2,070.00		Parts: \$20,632.95	OL&M: \$0.00	Misc: \$1,067.52	Sub-Total: \$23,770.47		

GEN-21 Retail

CORRECTION:

REPLACE REAR AXLE LUBE RETURN HOSE:
 LOOKED UP AND ORDERED PARTS, REMOVED HOSE CLAMPS, REMOVED OLD REAR AXLE LUBE RETURN HOSE,
 RETRIEVED PARTS, ROUTED AND INSTALLED THE NEW-REAR AXLE LUBE-RETURN HOSE, INSTALLED NEW HOSE
 CLAMPS.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
R129335	Hydraulic Hose	1.00	154.09	154.09	\$154.09	N
Labor: \$70.50		Parts: \$154.09	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$224.59	

9300/7284/BAD/E/10 Retail

CORRECTION:

COVER BREAKAWAY DUST - Remove & Install

Labor: \$54.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$54.00
----------------	---------------	--------------	--------------	--------------------

9300/5057/BAF/10 Retail

CORRECTION:

HOSE BREAKAWAY DRAIN - Remove & Install

Labor: \$82.50	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$82.50
----------------	---------------	--------------	--------------	--------------------

9300/7560/BAE/A/10 Retail

CORRECTION:

O-RING BREAKAWAY COUPLER HOSE TIP ALL - Remove & Install

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------

SERVICE INVOICE

Invoice To Account No: 16803

Deliver To:

VINCENT FREES
430 8TH RD
BUSHTON KS 67427

VINCENT FREES
430 8TH RD
BUSHTON KS 67427

Bus Phone: (620)562-3236
Prv Phone:

Bus Phone: (620)562-3236
Prv Phone:

Invoice Number: **793531**
Invoice Date: 3/27/2024
Location: 7
Work Order Number: 129322
Payment Type: Finance
Page: 11 of 21

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9300	11389	RW9300H001847	99921341	

9300/7560/BAE/A/10 Retail		8.00	2.48	2.48	\$19.84	N
R83630	O-RING					
TY26101	BRAKE AND PARTS CLEANER	1.00	8.88	8.88	\$8.88	N
Labor: \$124.50		Parts: \$28.72	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$153.22	

GEN-25 Retail
CORRECTION:

DIAGNOSE/REPAIR #2 LH COUPLER NOT WORKING:

-FOUND THAT THE #2 LH COUPLER DOES NOT WORK WHILE INSPECTING THE TRACTOR, WHILE OPERATING THE #2 SCV LEVER NOTICED THAT THE DISPLAY SHOWED THAT IT WAS WORKING BUT THERE WAS NOTHING HAPPENING AT THE COUPLER.

-LOOKED ON SERVICE ADVISOR AT THE WIRING DIAGRAM TO DETERMINE WHAT CONNECTORS AND WHICH WIRES TO LOOK AT, DISCONNECTED HARNESS AT THE SOLENOID, CHECKED THE RESISTANCE OF THE SOLENOID, FOUND THAT IT WAS IN SPEC, HAD ANOTHER TECH OPERATE THE #2 SCV LEVER SO I COULD CHECK THE VOLTAGE AT THE SOLENOID CONNECTOR, FOUND THERE WASN'T ANY VOLTAGE TO THAT SOLENOID.

-REMOVED THE REAR CAB PANEL, CLEANED THE DEBRIS FROM AROUND THE CONNECTORS AT THE CONTROLLER, DISCONNECTED HARNESS FROM THE CONTROLLER, LOAD CHECKED BOTH WIRES FOR THAT SOLENOID, BOTH WIRES CHECKED GOOD, INFORMED AND DISCUSSED WITH SHOP MANAGER, SAID TO START PEELING THE WIRE LOOM OFF AND LOOK FOR ANY BAD SPOTS IN THE WIRES.

-WHILE HAVING THE TRACTOR SPLIT FOR A DIFFERENT REPAIR, REMOVED THE WIRE LOOM FROM THE HARNESS, FOUND THAT THE ONLY BAD SPOTS IN THE WIRES WERE BY THE SOLENOID CONNECTOR.

-LOOKED UP AND RETRIEVED PARTS, CUT, TRIMMED, AND SPLICED 16 NEW TERMINALS ONTO THE WIRES, CONNECTED HARNESS BACK INTO THE CONTROLLER, HAD THE SHOP FOREMAN COME BACK AND CHECK THE VOLTAGE AT THE SOLENOID CONNECTOR WHILE I OPERATED THE SCV LEVER, FOUND THAT WE NOW HAD GOOD VOLTAGE AT THE SOLENOID CONNECTOR BUT THERE WAS STILL NOTHING HAPPENING AT THE COUPLER.

-DISCUSSED WITH SHOP FOREMAN AND DECIDED TO REPLACE THE SOLENOID FOR THE #2 SCV COUPLER, LOOKED UP AND ORDERED THE NEW SOLENOID.

-REMOVED BOTH WIRES FROM HARNESS CONNECTOR, REMOVED THE OLD SOLENOID, CHECKED THE OPERATION OF THE PILOT VALVE WHILE THE SOLENOID WAS OFF TO MAKE SURE THAT IT WASN'T STUCK, PILOT VALVE WAS GOOD, INSTALLED THE NEW SOLENOID, TORQUED TO SPEC, INSTALLED BOTH WIRES FOR THE NEW SOLENOID INTO THE HARNESS CONNECTOR.

-HEATED UP THE HYDRAULIC OIL AND WENT THROUGH SCV CALIBRATION, ONCE CALIBRATION WAS DONE, TESTED SCV OPERATION, ALL SCV'S NOW WORKED CORRECTLY, PRESSURE CHECKED #2 LH COUPLER, COUPLER CHECKED GOOD, NO LEAKS AND NO CODES.

-INSTALLED WIRE LOOM BACK ONTO THE HARNESS, HAD TO INSTALL NEW WIRE LOOM IN A FEW SPOTS, ZIP-TIED WIRE LOOM, INSTALLED ALL 3 HARNESS CLAMPS, ZIP-TIED HARNESS INTO PLACE, INSTALLED REAR CAB PANEL.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
57M7258	ELEC. CONN	16.00	0.24	0.24	\$3.84	N



BTI Bucklin
 94 SE 30 Road
 Great Bend, KS 67530
 (800) 817-9921
 (620) 793-3500

BTI Bucklin (800) 334-4823 (620) 826-3271
 BTI Greensburg (888) 723-3331 (620) 723-3331
 BTI Ness City (800) 572-2251 (785) 798-2410
 BTI Pratt (800) 573-5606 (620) 672-5606
 BTI Hoxie (844) 688-4362 (785) 675-8207
 BTI Great Bend (800) 817-9921 (620) 793-3500



Invoice To Account No: 16803

Deliver To:

SERVICE INVOICE

VINCENT FREES 430 8TH RD BUSHTON KS 67427 Bus Phone: (620)562-3236 Prv Phone:	VINCENT FREES 430 8TH RD BUSHTON KS 67427 Bus Phone: (620)562-3236 Prv Phone:	Invoice Number: 793531 Invoice Date: 3/27/2024 Location: 7 Work Order Number: 129322 Payment Type: Finance Page: 12 of 21
---	---	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9300	11389	RW9300H001847	99921341	

GEN-25 Retail

57M7262	Elec. Connector Housing	1.00	9.02	9.02	\$9.02	N
57M7281	Elec.Connect Locking Device	1.00	0.63	0.63	\$0.63	N
57M7291	Electrical Connector Assy	1.00	0.69	0.69	\$0.69	N
H77698	TIE BAND	12.00	0.78	0.78	\$9.36	N
R104846	Elec. Connector Terminal	16.00	0.87	0.87	\$13.92	N
R44302	TIE BAND	12.00	0.37	0.37	\$4.44	N
RE61119	SOLENOID	1.00	350.26	350.26	\$350.26	N
TY26191	Conduit	2.00	2.47	2.47	\$4.94	N

Labor: \$2,436.00 Parts: \$397.10 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$2,833.10

9300/7700/53 Retail
 CORRECTION:
 ENGINE OIL & FILTER - Change

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
DZ118269	Oil Filter	1.00	44.49	44.49	\$44.49	N
TY26682	15W-40 PLUS 50 SHOP BULK QUARTS	45.00	6.00	6.00	\$270.00	N

Labor: \$165.00 Parts: \$314.49 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$479.49

9300/7701/O/53 Retail
 CORRECTION:
 ENGINE AIR FILTER BOTH - Change

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
AH148880	AIR FILTER	1.00	92.88	92.88	\$92.88	N
RE63932	AIR FILTER ELEMENT	1.00	80.96	80.96	\$80.96	N

Labor: \$82.50 Parts: \$173.84 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$256.34



BTI Bucklin
 94 SE 30 Road
 Great Bend, KS 67530
 (800) 817-9921
 (620) 793-3500

BTI Bucklin (800) 334-4823 (620) 826-3271
 BTI Greensburg (888) 723-3331 (620) 723-3331
 BTI Ness City (800) 572-2251 (785) 798-2410
 BTI Pratt (800) 573-5606 (620) 672-5606
 BTI Hoxie (844) 688-4362 (785) 675-8207
 BTI Great Bend (800) 817-9921 (620) 793-3500



SERVICE INVOICE

Invoice To Account No: 16803

Deliver To:

VINCENT FREES 430 8TH RD BUSHTON KS 67427 Bus Phone: (620)562-3236 Prv Phone:	VINCENT FREES 430 8TH RD BUSHTON KS 67427 Bus Phone: (620)562-3236 Prv Phone:	Invoice Number: 793531 Invoice Date: 3/27/2024 Location: 7 Work Order Number: 129322 Payment Type: Finance Page: 13 of 21
---	---	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9300	11389	RW9300H001847	99921341	

9300/1261/53 Retail
 CORRECTION:
 FUEL FILTERS - Change

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE502203	FILTER ELE	1.00	54.41	54.41	\$54.41	N
RE506428	FILTER ELE	1.00	47.05	47.05	\$47.05	N
Labor: \$82.50		Parts: \$101.46	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$183.96	

9300/7705/53 Retail
 CORRECTION:
 HYDRAULIC OIL & FILTER - Change

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
RE174130	OIL FILTER	1.00	134.12	134.12	\$134.12	N
TY22028	SHOP HY-GARD BY THE QUART	160.00	5.35	5.35	\$856.00	N
Labor: \$330.00		Parts: \$990.12	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,320.12	

9300/7707/53 Retail
 CORRECTION:
 OIL & FILTER TRANSMISSION - Change

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
F3171R	O-RING	4.00	3.00	3.00	\$12.00	N
RE174130	OIL FILTER	1.00	134.12	134.12	\$134.12	N
TY22028	SHOP HY-GARD BY THE QUART	43.00	5.35	5.35	\$230.05	N
Labor: \$375.00		Parts: \$376.17	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$751.17	

9300/7717/AJ53 Retail
 CORRECTION:
 CAB FILTER ALL - Change



BTI Bucklin
 94 SE 30 Road
 Great Bend, KS 67530
 (800) 817-9921
 (620) 793-3500

BTI Bucklin (800) 334-4823 (620) 826-3271
 BTI Greensburg (888) 723-3331 (620) 723-3331
 BTI Ness City (800) 572-2251 (785) 798-2410
 BTI Pratt (800) 573-5606 (620) 672-5606
 BTI Hoxie (844) 688-4362 (785) 675-8207
 BTI Great Bend (800) 817-9921 (620) 793-3500



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 16803

Deliver To:

VINCENT FREES 430 8TH RD BUSHTON KS 67427 Bus Phone: (620)562-3236 Prv Phone:	VINCENT FREES 430 8TH RD BUSHTON KS 67427 Bus Phone: (620)562-3236 Prv Phone:	Invoice Number: 793531 Invoice Date: 3/27/2024 Location: 7 Work Order Number: 129322 Payment Type: Finance Page: 14 of 21
---	---	---

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9300	11389	RW9300H001847	99921341	

9300/7717/A/53 Retail

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
R184800	Sealing Washer	1.00	16.74	16.74	\$16.74	N
RE187966	AIR FILTER	1.00	37.41	37.41	\$37.41	N
RE24619	CAB AIR FILTER	1.00	49.44	49.44	\$49.44	N
Labor: \$82.50		Parts: \$103.59		OL&M: \$0.00		Misc: \$0.00
Sub-Total: \$186.09						

9300/9001/CPL/86 Retail
 CORRECTION:
 LUBRICATED COMPLETE TRACTOR

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY6333	GREASE	1.00	9.74	9.74	\$9.74	N
Labor: \$82.50		Parts: \$9.74		OL&M: \$0.00		Misc: \$0.00
Sub-Total: \$92.24						

9300/4483/HFC/70 Retail
 CORRECTION:
 DROVE TRACTOR TO WASH PIT. POWER WASHED COOLING PACKAGE, BLEW COOLING PACKAGE OUT WITH AIR, REPEATED PROCESS UNTIL COOLING PACKAGE WAS CLEAN, DROVE TRACTOR BACK INTO THE SHOP.

Labor: \$523.50		Parts: \$0.00		OL&M: \$0.00		Misc: \$0.00
Sub-Total: \$523.50						

GEN-34 Retail
 CORRECTION:
 WHILE THE HYDRAULIC OIL RESERVOIR WAS DRAINED, REMOVED THE OLD HYDRAULIC OIL RESERVOIR SIGHT GAUGE, INSTALLED THE NEW RESERVOIR OIL LEVEL SIGHT GAUGE.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind



BTI Bucklin
 94 SE 30 Road
 Great Bend, KS 67530
 (800) 817-9921
 (620) 793-3500

BTI Bucklin (800) 334-4823 (620) 826-3271
 BTI Greensburg (888) 723-3331 (620) 723-3331
 BTI Ness City (800) 572-2251 (785) 798-2410
 BTI Pratt (800) 573-5606 (620) 672-5606
 BTI Hoxie (844) 688-4362 (785) 675-8207
 BTI Great Bend (800) 817-9921 (620) 793-3500



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 16803

Deliver To:

VINCENT FREES
 430 8TH RD
 BUSHTON KS 67427

VINCENT FREES
 430 8TH RD
 BUSHTON KS 67427

Bus Phone: (620)562-3236
 Prv Phone:

Bus Phone: (620)562-3236
 Prv Phone:

Invoice Number: **793531**
 Invoice Date: 3/27/2024
 Location: 7
 Work Order Number: 129322
 Payment Type: Finance
 Page: 15 of 21

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9300	11389	RW9300H001847	99921341	

GEN-34 Retail RE187450	GAUGE	1.00	111.23	111.23	\$111.23	N
Labor: \$64.50	Parts: \$111.23	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$175.73		

9300/4049/20 Retail
 CORRECTION:
 REAR DIFFERENTIAL & INPUT HOUSING AND PINION SHAFT - Recondition

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
19M8622	CAP SCREW	2.00	13.40	13.40	\$26.80	N
F3171R	O-RING	4.00	3.00	3.00	\$12.00	N
JD8191	BEARING CO	1.00	59.20	59.20	\$59.20	N
JD8214	Bearing Cup	1.00	41.25	40.84	\$40.84	N
JD8255	BEARING CU	1.00	38.47	37.72	\$37.72	N
JD8941	BEARING CO	1.00	72.97	72.97	\$72.97	N
JD9069	Bearing Cone	1.00	158.37	153.37	\$153.37	N
JD9127	Bearing Cup	1.00	75.26	75.26	\$75.26	N
R100357	SCREW	8.00	8.38	8.38	\$67.04	N
R109483	Piston	1.00	136.54	136.54	\$136.54	N
R109486	CLUTCH DISC BLUE DISC 3" FINE	3.00	61.54	61.54	\$184.62	N
R115567	Screw	3.00	10.90	10.90	\$32.70	N
R119126	Ring	2.00	19.77	19.77	\$39.54	N
R120162	UNIVERSAL	1.00	629.68	629.68	\$629.68	N
R129781	SELF-LOCK	12.00	8.60	8.60	\$103.20	N
R134161	Plate	1.00	33.63	32.97	\$32.97	N
R135543	WASHER	12.00	1.37	1.37	\$16.44	N
R274003	O-Ring	1.00	10.45	10.45	\$10.45	N
R279626	O-RING	1.00	8.79	8.79	\$8.79	N

CONTINUED ON NEXT PAGE->



BTI Bucklin
 94 SE 30 Road
 Great Bend, KS 67530
 (800) 817-9921
 (620) 793-3500

BTI Bucklin (800) 334-4823 (620) 826-3271
 BTI Greensburg (888) 723-3331 (620) 723-3331
 BTI Ness City (800) 572-2251 (785) 798-2410
 BTI Pratt (800) 573-5606 (620) 672-5606
 BTI Hoxie (844) 688-4362 (785) 675-8207
 BTI Great Bend (800) 817-9921 (620) 793-3500



SERVICE INVOICE

Invoice To Account No: 16803

Deliver To:

VINCENT FREES
 430 8TH RD
 BUSHTON KS 67427

VINCENT FREES
 430 8TH RD
 BUSHTON KS 67427

Invoice Number: **793531**
 Invoice Date: 3/27/2024
 Location: 7
 Work Order Number: 129322
 Payment Type: Finance
 Page: 16 of 21

Bus Phone: (620)562-3236
 Prv Phone:

Bus Phone: (620)562-3236
 Prv Phone:

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9300	11389	RW9300H001847	99921341	

Part Number	Description	Unit	Price	Quantity	Ext Price	Ext Price	Ext Price	Ext Price	Ext Price
9300/4049/20 Retail									
R375R	O-RING		4.00	1.36	1.36			\$5.44	N
R55081	NEEDLE ROL		54.00	1.08	1.08			\$58.32	N
R58256	Shim		3.00	3.89	3.89			\$11.67	N
R68166	THRUST WAS		3.00	44.63	44.19			\$132.57	N
R68167	WASHER		6.00	1.52	1.52			\$9.12	N
R81362	Shim		1.00	6.04	6.04			\$6.04	N
R81364	SHIM		3.00	6.42	6.42			\$19.26	N
R98309	CAP SCREW		1.00	13.25	13.25			\$13.25	N
R99466	THRUST WAS		2.00	36.78	36.06			\$72.12	N
RE158082	SEAL		1.00	75.40	75.40			\$75.40	N
RE218590	Elbow Fitting		1.00	129.46	129.46			\$129.46	N
RE294022	DISK WITH		3.00	83.42	83.42			\$250.26	N
RE40112	CROSS AND		1.00	262.91	262.91			\$262.91	N
RE48761	TAPERED RO		1.00	788.59	788.59			\$788.59	N
U10289	O-RING		1.00	4.51	4.51			\$4.51	N
U11017	O-RING		1.00	8.11	8.11			\$8.11	N
W23832	Spacer		1.00	18.40	18.40			\$18.40	N
73209	NORTON SURF BLUE DISC 3" FINE		3.00	5.13	5.13			\$15.39	N
73424	3M SEC CND DISC 3 CRS		4.00	4.93	4.93			\$19.72	N
Labor: \$4,762.50									
Parts: \$3,640.67									
OL&M: \$0.00									
Misc: \$0.00									
								Sub-Total: \$8,403.17	

WASH FOR SERVICE Retail
 CORRECTION:
 WASH MACHINE FOR SERVICE/REPAIRS



BTI Bucklin
 94 SE 30 Road
 Great Bend, KS 67530
 (800) 817-9921
 (620) 793-3500

BTI Bucklin (800) 334-4823 (620) 826-3271
 BTI Greensburg (888) 723-3331 (620) 723-3331
 BTI Ness City (800) 572-2251 (785) 798-2410
 BTI Pratt (800) 573-5606 (620) 672-5606
 BTI Hoxie (844) 688-4362 (785) 675-8207
 BTI Great Bend (800) 817-9921 (620) 793-3500



SERVICE INVOICE

Invoice To Account No: 16803

Deliver To:

VINCENT FREES 430 8TH RD BUSHTON KS 67427	VINCENT FREES 430 8TH RD BUSHTON KS 67427	Invoice Number: 793531	Invoice Date: 3/27/2024
Bus Phone: (620)562-3236	Bus Phone: (620)562-3236	Location: 7	Work Order Number: 129322
Prv Phone:	Prv Phone:	Payment Type: Finance	Page: 17 of 21

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9300	11389	RW9300H001847	99921341	

WASH FOR SERVICE Retail

Labor: \$312.00	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$312.00
-----------------	---------------	--------------	--------------	---------------------

GEN-37 Retail

CORRECTION:

INSPECT LH FINAL DRIVE HOUSING FOR CRACKS:
 -POWER WASHED/CLEANED LH FINAL DRIVE HOUSING, BUFFED MATING SURFACE, FOUND WHAT APPEARED TO BE A CRACK WHERE THE RING GEAR ATTACHES TO THE FINAL DRIVE HOUSING. -HAD ANOTHER TECH (DUANE) COME BACK AND LOOK AT IT, SAID TO USE THE DYE-KIT FOR DETECTING CRACKS, RETRIEVED KIT, WENT THROUGH THE 3 STEP PROCESS, CLEANED AREA ON FINAL DRIVE HOUSING, APPLIED RED DYE THEN ALLOWED ENOUGH TIME FOR THE DYE TO PENETRATE ANY CRACKS IF THERE WERE ANY, CLEANED OFF EXCESS DYE, APPLIED THE DEVELOPER, FOUND THERE WERE A COUPLER CRACKS IN THE FINAL DRIVE HOUSING.
 -LOOKED UP NEW FINAL DRIVE HOUSING, FOUND THAT THERE WERE NONE AVAILABLE THROUGH DEERE, AFTER CALLING 3 PLACES FINALLY FOUND ONE, INFORMED SHOP MANAGER WHAT WAS GOING ON AND SAID TO GET IT ORDERED, ORDERED NEW FINAL DRIVE HOUSING.

Labor: \$217.50	Parts: \$0.00	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$217.50
-----------------	---------------	--------------	--------------	---------------------

GEN-38 Retail

CORRECTION:

PAINTED THE NEW LH FINAL DRIVE HOUSING.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY25624	Paint 12 Oz. AG CCE Green	1.00	14.29	14.29	\$14.29	Y
Labor: \$145.50	Parts: \$14.29	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$159.79		

9300/4483/FAX/10 Retail

CORRECTION:

ASSEMBLY AXLE FRONT - Remove & Install

Drained oil from differential and final drive housings. Disconnected drive shaft. Disconnected hoses and wiring harness. Installed JDG660B gudgeon oscillation stop. Installed support stands. Removed wheels from axle. Attached hoist and straps. Removed axle mounting cap screws. Removed axle from tractor.

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
-------------	-------------	----------	------------	-----------	----------------	-----------



BTI Bucklin
 94 SE 30 Road
 Great Bend, KS 67530
 (800) 817-9921
 (620) 793-3500

BTI Bucklin (800) 334-4823 (620) 826-3271
 BTI Greensburg (888) 723-3331 (620) 723-3331
 BTI Ness City (800) 572-2251 (785) 798-2410
 BTI Pratt (800) 573-5606 (620) 672-5606
 BTI Hoxie (844) 688-4362 (785) 675-8207
 BTI Great Bend (800) 817-9921 (620) 793-3500



JOHN DEERE

SERVICE INVOICE

Invoice To Account No: 16803

Deliver To:

VINCENT FREES 430 8TH RD BUSHTON KS 67427	VINCENT FREES 430 8TH RD BUSHTON KS 67427	Invoice Number: 793531
Bus Phone: (620)562-3236	Bus Phone: (620)562-3236	Invoice Date: 3/27/2024
Prv Phone:	Prv Phone:	Location: 7
		Work Order Number: 129322
		Payment Type: Finance
		Page: 18 of 21

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9300	11389	RW9300H001847	99921341	

9300/4483/FAX/10 Retail R100357	SCREW	4.00	8.38	8.38	\$33.52	N
Labor: \$4,050.00	Parts: \$33.52	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$4,083.52		

9300/4050/B/20 Retail
 CORRECTION:
 RECONDITIONED BOTH FINAL DRIVES AS NEEDED

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Inc
14M7452	Lock Nut	6.00	1.15	1.15	\$6.90	N
19M7781	CAP SCREW	8.00	16.99	16.99	\$135.92	N
19M8622	CAP SCREW	28.00	13.40	13.40	\$375.20	N
24M7243	WASHER	8.00	4.42	4.42	\$35.36	N
F2380R	WASHER	2.00	2.46	2.46	\$4.92	N
F3171R	O-RING	2.00	3.00	3.00	\$6.00	N
JD8248	BEARING CU	2.00	60.80	60.80	\$121.60	N
JD9018	BEARING CO	2.00	84.87	84.87	\$169.74	N
R125666	Ring	2.00	20.69	20.69	\$41.38	N
R125667	Ring	2.00	22.17	22.17	\$44.34	N
R135543	WASHER	28.00	1.37	1.37	\$38.36	N
R182695	Bolt	6.00	4.47	4.47	\$26.82	N
R268521	Thrust Washer	12.00	73.22	73.22	\$878.64	N
R52389	SHIM	2.00	11.91	11.24	\$22.48	N
R538301	BUSHING	2.00	111.96	111.96	\$223.92	N
R59439	SHIM	6.00	3.54	3.54	\$21.24	N
R59440	SHIM	5.00	5.68	5.68	\$28.40	N
R61461	SHIM	3.00	2.82	2.82	\$8.46	N
R72232	BALL	4.00	0.86	0.86	\$3.44	N



BTI Bucklin
 94 SE 30 Road
 Great Bend, KS 67530
 (800) 817-9921
 (620) 793-3500

BTI Bucklin (800) 334-4823 (620) 826-3271
 BTI Greensburg (888) 723-3331 (620) 723-3331
 BTI Ness City (800) 572-2251 (785) 798-2410
 BTI Pratt (800) 573-5606 (620) 672-5606
 BTI Hoxie (844) 688-4362 (785) 675-8207
 BTI Great Bend (800) 817-9921 (620) 793-3500



SERVICE INVOICE

Invoice To Account No: 16803

Deliver To:

VINCENT FREES 430 8TH RD BUSHTON KS 67427	VINCENT FREES 430 8TH RD BUSHTON KS 67427	Invoice Number: 793531
Bus Phone: (620)562-3236	Bus Phone: (620)562-3236	Invoice Date: 3/27/2024
Prv Phone:	Prv Phone:	Location: 7
		Work Order Number: 129322
		Payment Type: Finance
		Page: 19 of 21

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9300	11389	RW9300H001847	99921341	

Part Number	Description	QTY	Unit Price	Ext Price	Tax	Inc
9300/4050/B/20 Retail						
R78303	WASHER	-1.00	7.28	6.72	(\$6.72)	N
R81162	BOLT	2.00	37.33	37.33	\$74.66	N
R94545	Lock Plate	2.00	22.46	22.46	\$44.92	N
R94655	Needle Roller	408.00	1.31	1.31	\$534.48	N
RE154280	Brake Disk	2.00	218.39	218.39	\$436.78	N
RE168641	SEAL	2.00	122.50	122.50	\$245.00	N
RE50957	TAPERED ROLLER BEARING	2.00	392.06	392.06	\$784.12	N

Labor: \$2,070.00 Parts: \$4,306.36 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$6,376.36

9300/4050/FAX/L/10 Retail
 CORRECTION:
 FINAL DRIVE FRONT AXLE LEFT - Remove & Install

Labor: \$750.00 Parts: \$0.00 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$750.00

9300/4050/FAX/R/10 Retail
 CORRECTION:
 FINAL DRIVE FRONT AXLE RIGHT - Remove & Install

Labor: \$750.00 Parts: \$0.00 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$750.00

9200/4049/20 Retail
 CORRECTION:
 RECONDITIONED FRONT DIFFERENTIAL

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Inc
F3171R	O-RING	4.00	3.00	3.00	\$12.00	N
JD8191	BEARING CO	1.00	59.20	59.20	\$59.20	N



BTI Bucklin
 94 SE 30 Road
 Great Bend, KS 67530
 (800) 817-9921
 (620) 793-3500

BTI Bucklin (800) 334-4823 (620) 826-3271
 BTI Greensburg (888) 723-3331 (620) 723-3331
 BTI Ness City (800) 572-2251 (785) 798-2410
 BTI Pratt (800) 573-5606 (620) 672-5606
 BTI Hoxie (844) 688-4362 (785) 675-8207
 BTI Great Bend (800) 817-9921 (620) 793-3500



Invoice To Account No: 16803

Deliver To:


SERVICE INVOICE

VINCENT FREES 430 8TH RD BUSHTON KS 67427	VINCENT FREES 430 8TH RD BUSHTON KS 67427	Invoice Number: 793531
Bus Phone: (620)562-3236	Bus Phone: (620)562-3236	Invoice Date: 3/27/2024
Prv Phone:	Prv Phone:	Location: 7
		Work Order Number: 129322
		Payment Type: Finance
		Page: 20 of 21

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9300	11389	RW9300H001847	99921341	

9200/4049/20 Retail

JD8214	Bearing Cup	1.00	41.25	41.25	\$41.25	N
JD8255	BEARING CU	1.00	38.47	38.47	\$38.47	N
JD8941	BEARING CO	1.00	72.97	72.97	\$72.97	N
JD9069	Bearing Cone	1.00	153.37	153.37	\$153.37	N
JD9127	Bearing Cup	1.00	75.26	75.26	\$75.26	N
R109483	Piston	1.00	136.54	136.54	\$136.54	N
R109486	CLUTCH DIS	3.00	61.54	61.54	\$184.62	N
R115567	Screw	3.00	10.90	10.90	\$32.70	N
R119126	Ring	2.00	19.77	19.77	\$39.54	N
R120162	UNIVERSAL	1.00	629.68	629.68	\$629.68	N
R129781	SELF-LOCKI	12.00	8.60	8.60	\$103.20	N
R134161	Plate	1.00	33.63	33.63	\$33.63	N
R135543	WASHER	12.00	1.37	1.37	\$16.44	N
R274003	O-Ring	1.00	10.45	10.45	\$10.45	N
R279626	O-RING	1.00	8.79	8.79	\$8.79	N
R375R	O-RING	4.00	1.36	1.36	\$5.44	N
R55081	NEEDLE ROL	54.00	1.08	1.08	\$58.32	N
R58255	Shim	2.00	2.96	2.96	\$5.92	N
R58257	Shim	1.00	4.14	4.14	\$4.14	N
R68166	THRUST WAS	3.00	44.63	44.63	\$133.89	N
R68167	WASHER	6.00	1.52	1.52	\$9.12	N
R81362	Shim	3.00	6.04	6.04	\$18.12	N
R81364	SHIM	1.00	6.42	6.42	\$6.42	N
R98309	CAP SCREW	1.00	13.25	13.25	\$13.25	N
R99466	THRUST WAS	2.00	36.78	36.78	\$73.56	N
RE158082	SEAL	1.00	75.40	75.40	\$75.40	N

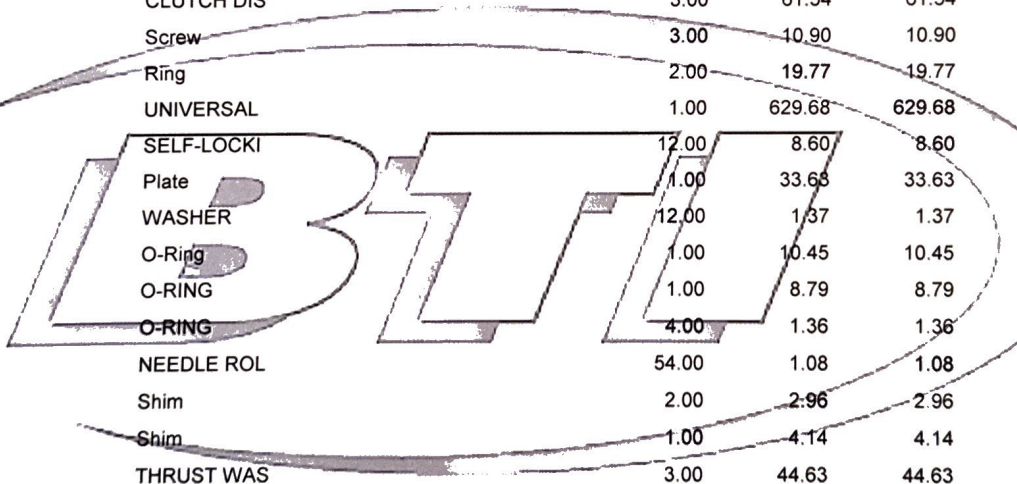



BTI Bucklin
 94 SE 30 Road
 Great Bend, KS 67530
 (800) 817-9921
 (620) 793-3500

BTI Bucklin (800) 334-4823 (620) 826-3271
 BTI Greensburg (888) 723-3331 (620) 723-3331
 BTI Ness City (800) 573-2351 (785) 798-2410
 BTI Pratt (800) 573-5606 (620) 672-5606
 BTI Hoxie (844) 688-4362 (785) 675-8207
 BTI Great Bend (800) 817-9921 (620) 793-3500



SERVICE INVOICE

Invoice To Account No: 16803

Deliver To:

VINCENT FREES 430 8TH RD BUSHTON KS 67427	VINCENT FREES 430 8TH RD BUSHTON KS 67427	Invoice Number: 793531
Bus Phone: (620)562-3236	Bus Phone: (620)662-3236	Invoice Date: 3/27/2024
Prv Phone:	Prv Phone:	Location: 7
		Work Order Number: 129322
		Payment Type: Finance
		Page: 21 of 21

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9300	11389	RW9300H001847	99921341	

9200/4049/20 Retail						
RE294022	DISK WITH	3.00	83.42	83.42	\$260.26	N
RE48761	TAPERED RO	1.00	788.59	788.59	\$788.59	N
T77613	O-RING	3.00	1.64	1.64	\$4.92	N
T77814	O-RING	4.00	1.63	1.63	\$6.12	N
T77857	O-RING	1.00	1.68	1.68	\$1.68	N
U10269	O-RING	1.00	4.51	4.51	\$4.51	N
U11017	O-RING	1.00	8.11	8.11	\$8.11	N
W23832	Spacer	1.00	18.40	18.40	\$18.40	N
73209	NORTON SURF BLUE DISC 3" FINE	2.00	5.13	3.79	\$7.58	N
73424	3M BFG CND DISC 3 CR5	4.00	4.93	4.93	\$19.72	N

Labor: \$4,762.50 Parts: \$3,161.58 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$7,924.08

INVOICE CONTAINS \$17.76 DISCOUNT

Customer PO No:	Type: Multi-Use Acct US	Auth. No: 469627	Labor:	\$40,995.00
Tax Exempt No: REC'D/PORTAL	Merchant No: 37000371		Parts:	\$41,463.09
Advisor: STEVE BRUMMER	Card No: XXXXXXXXXXXX6644		OL&M:	\$0.00
	Bill Code: 783 - PERFORMAX INSPECTION - TRACT		Misc:	(\$1,905.63)
	Credit Plan: 12041 - DEERE AG NO PAYMENTS/NO INTEREST WAIVER UNTIL		Sales Tax:	\$1.07
			Grand Total:	\$80,553.53

*** DOCUMENT COPY ***

TERMS AND CONDITIONS
 This purchase(s) is subject to the terms of the Multi-Use Account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.
 This purchase(s) is subject to the terms of the multi-use account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.

Received by: Date: