



BTI Hoxie
 1361 West Hwy 24
 Hoxie, KS 67740
 (844) 688-4362
 (785) 675-8207

BTI Bucklin (800) 334-4823 (620) 826-3271
 BTI Greensburg (888) 723-3331 (620) 723-3331
 BTI Ness City (800) 572-2251 (785) 798-2410
 BTI Pratt (800) 573-5606 (620) 672-5606
 BTI Hoxie (844) 688-4362 (785) 675-8207
 BTI Great Bend (800) 817-9921 (620) 793-3500



Invoice To Account No: 3408

Deliver To:

T L MOSS, INC
 TIM MOSS
 9915 W RD 40 N
 SELDEN KS 67757

T L MOSS, INC
 9915 W RD 40 N
 SELDEN KS 67757

Bus Phone:
 Prv Phone:

Bus Phone:
 Prv Phone:

SERVICE INVOICE

Invoice Number: **776385**
 Invoice Date: 12/5/2023
 Location: 6
 Work Order Number: 128946
 Payment Type: Finance
 Page: 1 of 11

Make/Model: JOHN DEERE 9770	Meter:	Serial Number: 1H09770SHA0735954	Eq ID: TLM9770	Fleet No:
--------------------------------	--------	-------------------------------------	-------------------	-----------

9770STS/3105/GTVA/10 Retail

CORRECTION:

R&I VERTICAL AUGER GEAR CASE


-
- Loosened and removed drive chain
- Removed chain guard and drive sprocket
- Attached stand to gear case
- Loosened and removed all hardware and lower gear case
- Installed in reverse order
-

Labor: \$480.00 Parts: \$0.00 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$480.00

9770STS/3105/GTVA/20 Retail

CORRECTION:

- Recon grain tank vertical auger gear case
- Disassembled gear case
- Replaced all required bearings
- Replaced shafts
- Replaced gears
- Replaced shims, etc
- Reassembled in reverse order
- Set up per TM manual

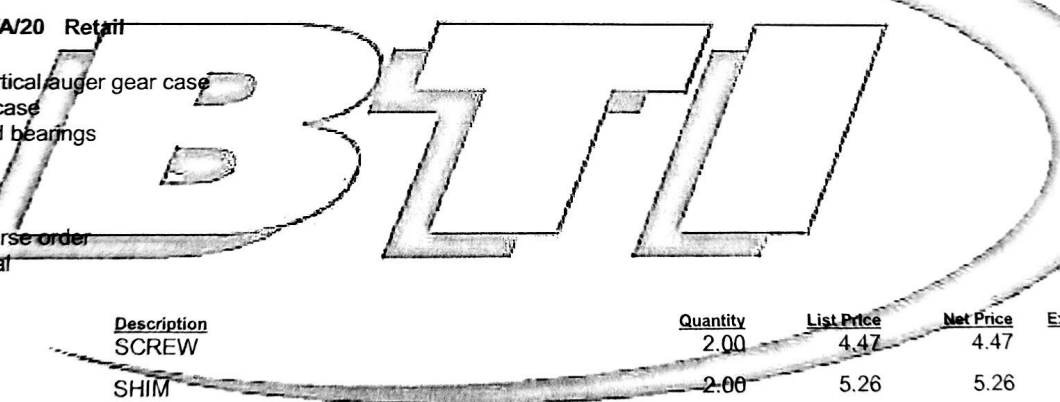

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
19M7843	SCREW	2.00	4.47	4.47	\$8.94	N
24H1533	SHIM	2.00	5.26	5.26	\$10.52	N
AH138955	SHIM KIT	1.00	12.98	12.98	\$12.98	N
AH211923	HOUSING, A	1.00	552.40	552.40	\$552.40	N
AH90963	SEAL	2.00	28.10	28.10	\$56.20	N
AH96585	BALL BEARI	2.00	32.39	32.39	\$64.78	N
H130137	HOUSING	1.00	985.99	985.99	\$985.99	N
H215085	SHAFT, LOW	1.00	146.96	146.96	\$146.96	N
H77698	TIE BAND	30.00	0.78	0.78	\$23.40	N



BTI Hoxie
 1361 West Hwy 24
 Hoxie, KS 67740
 (844) 688-4362
 (785) 675-8207

BTI Bucklin (800) 334-4823 (620) 826-3271
BTI Greensburg (888) 723-3331 (620) 723-3331
BTI Ness City (800) 572-2251 (785) 798-2410
BTI Pratt (800) 573-5606 (620) 672-5606
BTI Hoxie (844) 688-4362 (785) 675-8207
BTI Great Bend (800) 817-9921 (620) 793-3500



JOHN DEERE

Invoice To Account No: 3408

Deliver To:

SERVICE INVOICE

T L MOSS, INC TIM MOSS 9915 W RD 40 N SELDEN KS 67757 Bus Phone: Prv Phone:		T L MOSS, INC 9915 W RD 40 N SELDEN KS 67757 Bus Phone: Prv Phone:		Invoice Number: 776385 Invoice Date: 12/5/2023 Location: 6 Work Order Number: 128946 Payment Type: Finance Page: 2 of 11	
Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:	
JOHN DEERE 9770		1H09770SHA0735954	TLM9770		

9770STS/3105/GTVA/20 Retail

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
H96149	BUSHING	1.00	34.70	34.70	\$34.70	N
H96267	COMPRESSIO	1.00	8.12	8.12	\$8.12	N
H96294	GEAR	2.00	264.95	264.95	\$529.90	N
JD8524	BALL BEARI	2.00	26.33	26.33	\$52.66	N
N71921	SNAP RING	2.00	7.14	7.14	\$14.28	N
T146246	WASHER	2.00	3.92	3.92	\$7.84	N

Labor: \$495.00 Parts: \$2,509.67 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$3,004.67

9770STS/6403/A/25 Retail

CORRECTION:
 Adjusted all chains & belts
 Loosened jam nuts
 Adjusted all chains and belts
 Tightened jam nuts



Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
03M7359	BOLT	2.00	4.00	4.00	\$8.00	N
H223212	V-BELT LOW	1.00	197.78	197.78	\$197.78	N

Labor: \$441.00 Parts: \$205.78 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$646.78

ALL/9002/SHP/590 Retail

CORRECTION:
 Performed John Deere Inspection on combine in shop

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
37900	PTS DISC ALLOW	-1.00	336.60	336.60	(\$336.60)	N
ROLLBACK6	SVC ROLLBACK INSPECTION DISC/H	-1.00	1,050.00	1,050.00	(\$1,050.00)	N

Labor: \$1,050.00 Parts: \$0.00 OL&M: \$0.00 Misc: (\$1,386.60) Sub-Total: (\$336.60)



BTI Hoxie
 1361 West Hwy 24
 Hoxie, KS 67740
 (844) 688-4362
 (785) 675-8207

BTI Bucklin (800) 573-5271
 BTI Greensburg (888) 723-3331 (620) 723-3331
 BTI Ness City (800) 572-2251 (785) 798-2410
 BTI Pratt (800) 573-5606 (620) 672-5606
 BTI Hoxie (844) 688-4362 (785) 675-8207
 BTI Great Bend (800) 817-9921 (620) 793-3500



SERVICE INVOICE

Invoice To Account No: 3408

Deliver To:

T L MOSS, INC
 TIM MOSS
 9915 W RD 40 N
 SELDEN KS 67757

T L MOSS, INC
 9915 W RD 40 N
 SELDEN KS 67757

Invoice Number:
 Invoice Date:
 Location:
 Work Order Number:
 Payment Type:

Bus Phone:
 Prv Phone:

Bus Phone:
 Prv Phone:

Page:

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

JOHN DEERE 9770

1H09770SHA0735954

TLM9770

9770STS/6404/FHD/10 Retail

CORRECTION:

R&I feeder house drive chain
 Removed shields
 Separated and replaced drive chain
 Replaced chain idlers as needed
 Adjusted chain and reinstalled shields

Part Number	Description	Quantity	List Price	Net Price	Extended Price
AFH205780	IDLER SPRO	2.00	47.75	47.75	\$95.50
AXE80366	LINK CHAIN	1.00	145.94	145.94	\$145.94
H172475	GUIDE	1.00	32.94	32.94	\$32.94

Labor: ~~\$88.50~~

Parts: \$274.38

OL&M: \$0.00

Misc: \$0.00

Sub-Total: \$362.88

9770STS/3051/10 Retail

CORRECTION:

R&I SLIP CLUTCH

Loosened chain tension
 Removed and replaced complete slip clutch assembly
 Reassembled on combine


Labor: \$229.50

Parts: \$0.00

OL&M: \$0.00

Misc: \$0.00

Sub-Total: \$229.50

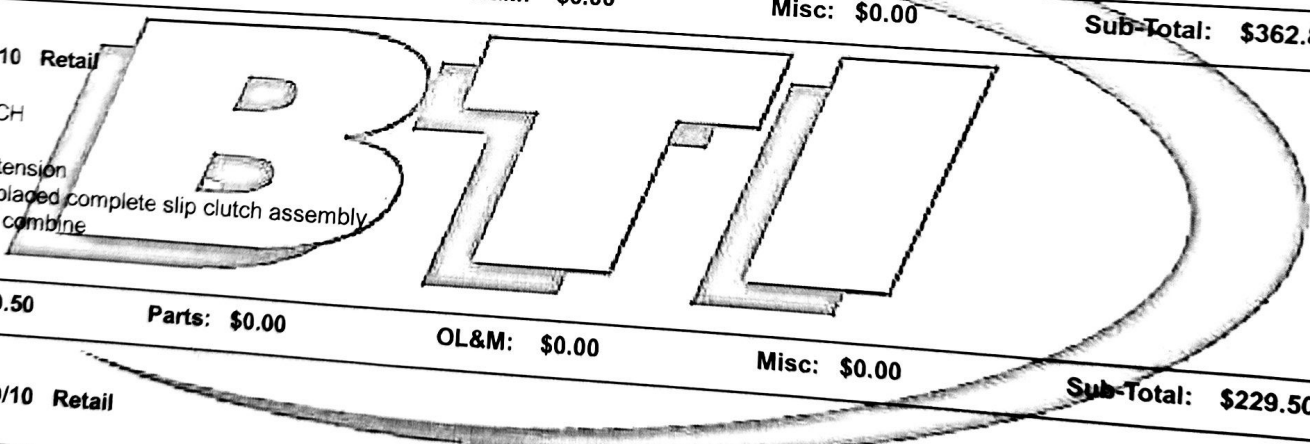

9770STS/7555/TD/10 Retail

CORRECTION:

R&I TOP DOOR SEAL

Removed door and installed new seal
 Reassembled to specification

Labor: \$177.00

Parts: \$0.00

OL&M: \$0.00

Misc: \$0.00

Sub-Total: \$177.00

Invoice To Account No: 3408

SERVICE INVOICE

T L MOSS, INC
TIM MOSS
9915 W RD 40 N
SELDEN KS 67757

Deliver To:

T L MOSS, INC
9915 W RD 40 N
SELDEN KS 67757

Bus Phone:
Prv Phone:

Bus Phone:
Prv Phone:

Invoice Number: **776385**
Invoice Date: 12/5/2023
Location: 6
Work Order Number: 128946
Payment Type: Finance
Page: 5 of 11

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet No:

JOHN DEERE 9770

1H09770SHA0735954

TLM9770

9770STS/1357/UAD/10 Retail

Labor: \$177.00 Parts: \$0.00 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$177.00

9770STS/5183/UAD/10 Retail

CORRECTION:

R&I UNLOADING AUGER DRIVE PULLEY

Removed unloading auger drive belt from gearcase drive pulley
Removed self locking nut from gear case pulley
Installed pulley to remove pulley
Reinstalled in reverse order
Torqued as required and tested

Part Number
AH151653

H82619

Description
BALL BEAR
LOCK NUT

Quantity

List Price

Net Price

Extended Price

Taxed Ind

1.00
1.00106.22
8.05106.22
8.05\$106.22
\$8.05N
N

Labor: \$43.50

Parts: \$114.27

OL&M: \$0.00

Misc: \$0.00

Sub-Total: \$157.77

9770STS/5105/UAD/10 Retail

CORRECTION:

R&I UNLOADING AUGER DRIVE CYLINDER

Relieved pressure to unloading auger engage cylinder and removed hoses
Removed pins at each end of cylinder
Removed & reinstalled in reverse order as required & tested

Part Number
AH176248

Description
HYDRAULIC

Quantity
1.00List Price
575.78Net Price
575.78Extended Price
\$575.78Taxed Ind
N

Labor: \$88.50

Parts: \$575.78

OL&M: \$0.00

Misc: \$0.00

Sub-Total: \$664.28

9770STS/6080/A/18 Retail

CORRECTION:

Invoice To Account No: 3408

L MOSS, INC
IM MOSS
915 W RD 40 N
SELDEN KS 67757

Deliver To:

T L MOSS, INC
9915 W RD 40 N
SELDEN KS 67757

SERVICE

Invoice Number:
Invoice Date:
Location:
Work Order Number:
Payment Type:

Bus Phone:
Prv Phone:

Bus Phone:
Prv Phone:

Page:

Make/Model:

Meter:

Serial Number:

Eq ID:

Fleet

JOHN DEERE 9770

1H09770SHA0735954

TLM9770

9770STS/6080/A/18 Retail

ROTATED ALL DISCHARGE BEATER STRIPS

-
- Raised chopper up and lowered bottom plate
- Loosened and removed drive belt
- Removed bolts from strips and removed
- Rotated strips
- Installed and put together in reverse order
- Verified operation

Labor: \$442.50 Parts: \$0.00 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$

9770STS/5183/SFA/10 Retail

**CORRECTION:
R&I SHOE FAN & CONVEYOR AUGER PULLEY**

-
- Loosened shoe fan and conveyor belt
- Removed hardware attaching pulley
- Removed and installed new pulley
- Installed hardware and tightened to specification
- Tightened belt to specification

Labor: \$52.50 Parts: \$0.00 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$5

9770STS/1357/SFA/10 Retail

**CORRECTION:
R&I SHOE FAN & CONVEYOR AUGER BELT**

-
- Removed belt
- Installed belt

Quantity	List Price	Net Price	Extended
1.00	163.69	163.69	\$163.69
1.00	50.10	50.10	\$50.10

Part Number
AH220916
AH97031

Description
PULLEY
IDLER, IDL



BTI Hoxie
 1361 West Hwy 24
 Hoxie, KS 67740
 (844) 688-4362
 (785) 675-8207

BTI Greensburg (888) 725-7251 (785) 798-2410
 BTI Ness City (800) 572-2251 (620) 672-5606
 BTI Pratt (800) 573-5606 (785) 675-8207
 BTI Hoxie (844) 688-4362 (785) 675-8207
 BTI Great Bend (800) 817-9921 (620) 793-3500

SERVICE I

Invoice To Account No: 3408

Deliver To:

T L MOSS, INC
 TIM MOSS
 9915 W RD 40 N
 SELDEN KS 67757

T L MOSS, INC
 9915 W RD 40 N
 SELDEN KS 67757

Invoice Number:
 Invoice Date:
 Location:
 Work Order Number:
 Payment Type:

Page:

Bus Phone:
 Prv Phone:

Bus Phone:
 Prv Phone:

Eq ID:

Fleet

Make/Model:

Meter:

Serial Number:

TLM9770

JOHN DEERE 9770

1H09770SHA0735954

9770STS/1357/SFA/10 Retail

HDW

Bulk Hardware

11.00

0.71

0.71

Labor: \$265.50

Parts: \$221.60

OL&M: \$0.00

Misc: \$0.00

Sub-Total: \$

9770STS/6404/TED/10 Retail

CORRECTION:

R&I TAILING ELEVATOR RETURN AUGER DRIVE CHAIN

Loosened chain tensioner
 Removed chain
 Installed new chain
 Tightened chain tensioner

Part Number
 AE23539

Description
 LINK CHAIN

Quantity
 1.00

List Price
 43.36

Net Price
 43.36

Extend

Labor: \$61.50

Parts: \$43.36

OL&M: \$0.00

Misc: \$0.00

Sub-Total: \$

9770STS/4159/CGD/10 Retail

CORRECTION:

R&I clean grain drive idler (each)
 Loosened belt
 Replaced idler
 Adjusted belt to gauge

Labor: \$52.50

Parts: \$0.00

OL&M: \$0.00

Misc: \$0.00

Sub-Total:

9770STS/3351/UTA/10 Retail

CORRECTION:



BTI Hoxie
 1361 West Hwy 24
 Hoxie, KS 67740
 (844) 688-4362
 (785) 675-8207

BTI Bucklin (800) 334-4823 (620) 826-3271
BTI Greensburg (888) 723-3331 (620) 723-3331
BTI Ness City (800) 572-2251 (785) 798-2410
BTI Pratt (800) 573-5606 (620) 672-5606
BTI Hoxie (844) 688-4362 (785) 675-8207
BTI Great Bend (800) 817-9921 (620) 793-3500



Invoice To Account No: 3408

T L MOSS, INC
 TIM MOSS
 9915 W RD 40 N
 SELDEN KS 67757

Deliver To:
 T L MOSS, INC
 9915 W RD 40 N
 SELDEN KS 67757

SERVICE INVOICE

Invoice Number: **776385**
 Invoice Date: 12/5/2023
 Location: 6
 Work Order Number: 128946
 Payment Type: Finance
 Page: 8 of 11

Bus Phone:
 Prv Phone:

Bus Phone:
 Prv Phone:

Make/Model: JOHN DEERE 9770 Meter: Serial Number: 1H09770SHA0735954 Eq ID: TLM9770 Fleet No:

9770STS/3351/UTA/10 Retail

Removed & Installed upper tailing auger bearing.
 Removed upper tailings drive chain.
 Removed sprocket.
 Removed bearings.
 Installed new bearings.
 Reinstalled in reverse.
 Reinstalled in reverse

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed
26M6787	SHAFT KEY	2.00	11.07	11.07	\$22.14	
26M7008	SHAFT KEY	1.00	10.60	10.60	\$10.60	
AH133191	ECCENTRIC	2.00	16.83	16.83	\$33.66	
AH173040	PULLEY	1.00	320.82	320.82	\$320.82	
H103265	PRESSED FL	1.00	7.08	7.08	\$28.32	
H154731	V-BELT	1.00	42.13	42.13	\$42.13	
JD39104	BALL BEAR	2.00	40.75	40.75	\$81.50	
Miscellaneous 37501	FREIGHT	1.00	94.05	94.05	\$94.05	
Labor: \$352.50				Parts: \$538.17		
			OL&M: \$0.00	Misc: \$94.05	Sub-Total: \$985.72	

9770STS/1351/RAD/10 Retail

CORRECTION:
R&I RADIATOR PROPELLER
 - Removed and replaced radiator propeller including bearing as required
 Tested for proper operation

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed
Z33854	PRESSED FL	1.00	10.88	10.88	\$10.88	
Labor: \$58.50				Parts: \$10.88		
			OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$69.38	



BTI Hoxie
1361 West Hwy 24
Hoxie, KS 67740
(844) 688-4362
(785) 675-8207


BTI Bucklin (888) 723-3333 (785) 798-2410
BTI Greensburg (800) 572-2251 (620) 672-5606
BTI Ness City (800) 573-5606 (785) 675-8207
BTI Pratt (844) 688-4362 (620) 793-3500
BTI Hoxie (800) 817-9921
BTI Great Bend



SERVICE INVOICE

Invoice To Account No: 3408	Deliver To:	Invoice Number: 776	12/5
T L MOSS, INC TIM MOSS 9915 W RD 40 N SELDEN KS 67757	T L MOSS, INC 9915 W RD 40 N SELDEN KS 67757	Invoice Date:	12
Bus Phone:	Bus Phone:	Location:	Fin
Prv Phone:	Prv Phone:	Work Order Number:	
		Payment Type:	
		Page:	
Make/Model:	Meter:	Serial Number:	Fleet No:
JOHN DEERE 9770		1H09770SHA0735954	
		Eq ID: TLM9770	

9770STS/9002/CMS/41 Retail
CORRECTION:
Performed complete combine machine service.
Changed engine oil and filter.
Changed engine air filters.
Changed engine gear case oil and filter.
Changed hydraulic oil and filter.
Changed hydro filter.
Changed cab filters.
Changed reverser oil.
Changed rotor gear case oil.
Changed primary countershaft gear case oil.
Changed transmission oil.
Changed final drive oil.
Changed water separator.
Greased entire machine.
Cleaned out radiator and oil coolers.

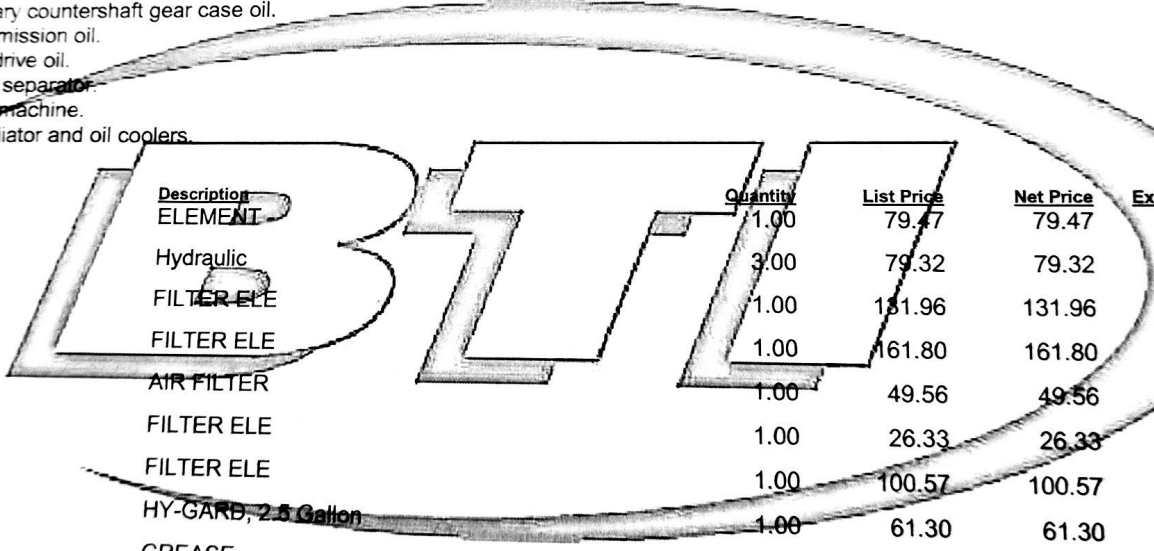

Part Number	Description	Quantity	List Price	Net Price	Extended Price
AH115833	ELEMENT	1.00	79.47	79.47	\$79.47
AH128449	Hydraulic	3.00	79.32	79.32	\$237.96
AH212295	FILTER ELE	1.00	131.96	131.96	\$131.96
AH222225	FILTER ELE	1.00	161.80	161.80	\$161.80
H220870	AIR FILTER	1.00	49.56	49.56	\$49.56
RE509672	FILTER ELE	1.00	26.33	26.33	\$26.33
RE525523	FILTER ELE	1.00	100.57	100.57	\$100.57
TY22062	HY-GARD, 2.5 Gallon	1.00	61.30	61.30	\$61.30
TY24416	GREASE	2.00	7.49	7.49	\$14.98
TY26815	80W-90 Oil Gallon	5.00	40.62	40.62	\$203.10
TY6296	80W90 QUART	14.00	12.06	12.06	\$168.84

Labor: \$1,188.00 Parts: \$1,235.87 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$2,423.87

9770STS/6063/TB/E/10 Retail
CORRECTION:



Hoxie
 1361 West Hwy 24
 Hoxie, KS 67740
 (844) 688-4362
 (785) 675-8207

BTI Bucklin (800) 334-4823 (620) 826-3271
 BTI Greensburg (888) 723-3331 (620) 723-3331
 BTI Ness City (800) 572-2251 (785) 798-2410
 BTI Pratt (800) 573-5606 (620) 672-5606
 BTI Hoxie (844) 688-4362 (785) 675-8207
 BTI Great Bend (800) 817-9921 (620) 793-3500



JOHN DEERE

Invoice To Account No: 3408

T L MOSS, INC
 TIM MOSS
 9915 W RD 40 N
 SELDEN KS 67757

Bus Phone:
 Prv Phone:

Deliver To:
 T L MOSS, INC
 9915 W RD 40 N
 SELDEN KS 67757

Bus Phone:
 Prv Phone:

SERVICE INVOICE


Invoice Number: 776385
 Invoice Date: 12/5/2023
 Location: 6
 Work Order Number: 128946
 Payment Type: Finance
 Page: 10 of 11

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9770		1H09770SHA0735954	TLM9770	

9770STS/6063/TB/E/10 Retail

R&I tail board vane (each)
 Lowered chopper fully
 Removed chopper tailboard vane hardware
 Reinstalled in reverse

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Inc
19M7866	SCREW	26.00	1.31	1.31	\$34.06	N
H137328	LOCK NUT	36.00	1.13	1.13	\$40.68	N
HXE36439	Vane, LH,	2.00	57.87	57.87	\$115.74	N
HXE36441	VANE	1.00	51.25	51.25	\$51.25	N
HXE36443	Vane, LH,	2.00	54.82	54.82	\$109.64	N
HXE36445	VANE	2.00	69.26	69.26	\$138.52	N
HXE80252	VANE	1.00	54.02	54.02	\$54.02	N
HXE80254	VANE	2.00	59.56	59.56	\$119.12	N

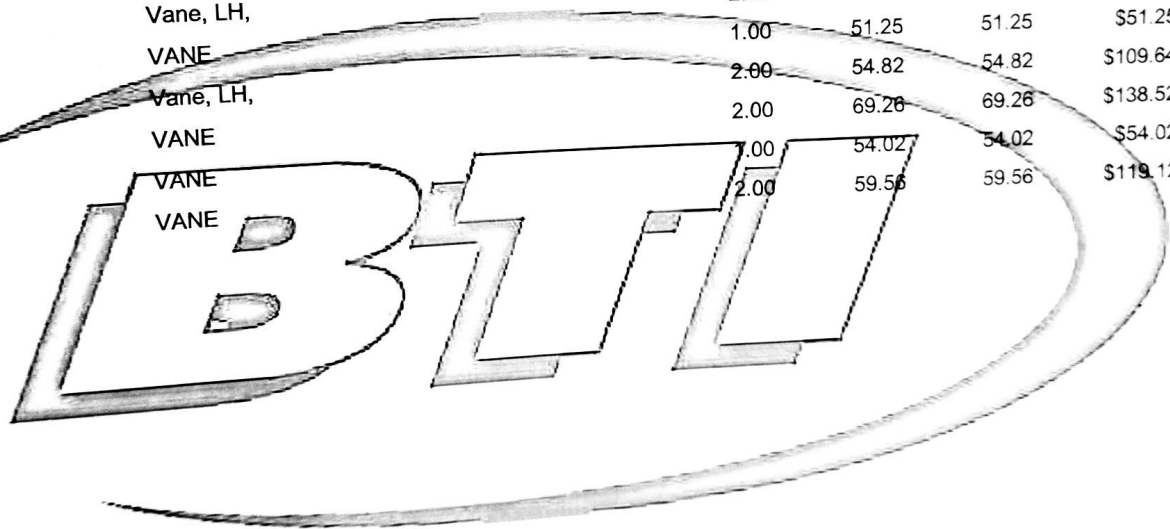



BTI Hoxie
 1361 West Hwy 24
 Hoxie, KS 67740
 (844) 688-4362
 (785) 675-8207

BTI Bucklin (800) 334-4823 (620) 826-3271
 BTI Greensburg (888) 723-3331 (620) 723-3331
 BTI Ness City (800) 572-2251 (785) 798-2410
 BTI Pratt (800) 573-5606 (620) 672-5606
 BTI Hoxie (844) 688-4362 (785) 675-8207
 BTI Great Bend (800) 817-9921 (620) 793-3500



SERVICE INVOICE

Invoice To Account No: 3408

Deliver To:

T L MOSS, INC
 TIM MOSS
 9915 W RD 40 N
 SELDEN KS 67757

Bus Phone:
 Prv Phone:

T L MOSS, INC
 9915 W RD 40 N
 SELDEN KS 67757

Bus Phone:
 Prv Phone:

Invoice Number: **776385**
 Invoice Date: 12/5/2023
 Location: 6
 Work Order Number: 128946
 Payment Type: Finance
 Page: 11 of 11

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9770		1H09770SHA0735954	TLM9770	


9770STS/6063/TB/E/10 Retail						
HXE80255	Vane, TAIL	2.00	69.54	69.54	\$139.08	N
Labor: \$472.50	Parts: \$802.11	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,274.61		

Finance Information

Customer PO No:	Type: Multi-use Acct US	Auth. No: 419646
Tax Exempt No: REC'D	Merchant No: 37000349	
Advisor: DAN MOREORD	Card No: xxxxxxxxxxxx0336	
	Bill Code: 784 - PERFORMAX INSPECTION - COMBIN	
	Credit Plan: 12041 - DEERE AG NO PAYMENTS/NO INTEREST WAIVER UNTIL	

Labor: \$6,646.50
Parts: \$6,637.88
OL&M: \$0.00
Misc: (\$1,292.55)
Sales Tax: \$0.00
Grand Total: \$11,991.83

*** DOCUMENT COPY ***

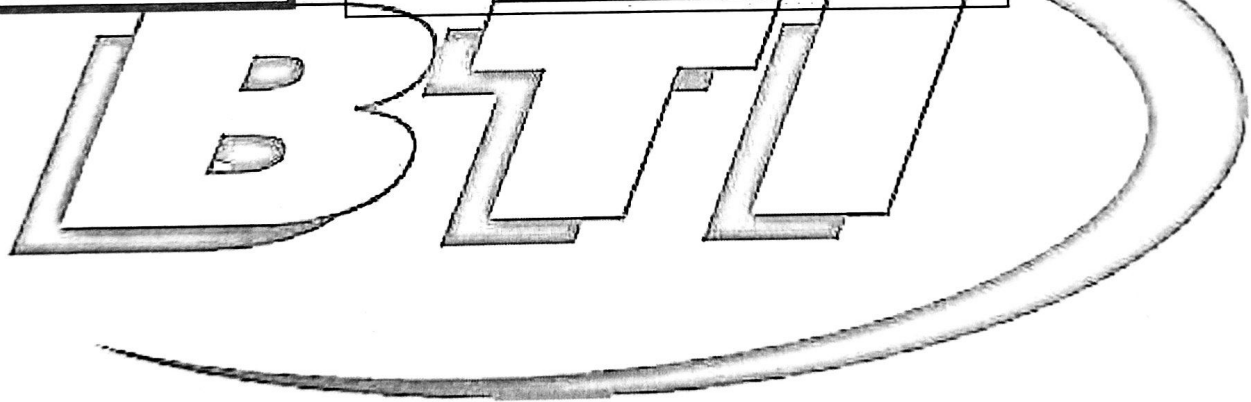

TERMS AND CONDITIONS

This purchase(s) is subject to the terms of the Multi-Use Account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.

This purchase(s) is subject to the terms of the multi-use account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.



BTI Hoxie
 1361 West Hwy 24
 Hoxie, KS 67740
 (844) 688 4362
 (785) 675 8207

BTI Bucklin (800) 334 4823 (620) 826 3271
BTI Greensburg (888) 723 3331 (620) 723 3331
BTI Ness City (800) 572 2251 (785) 798 2410
BTI Pratt (800) 573 5606 (620) 672 5606
BTI Hoxie (844) 688 4362 (785) 675 8207
BTI Great Bend (800) 817 9921 (620) 793 3500



Invoice To Account No 3408

Deliver To

SERVICE INVOICE

T L MOSS, INC
 TIM MOSS
 9915 W RD 40 N
 SELDEN KS 67757

Bus Phone:
 Prv Phone:

T L MOSS, INC
 9915 W RD 40 N
 SELDEN KS 67757

Bus Phone:
 Prv Phone:

Invoice Number: 697546
Invoice Date: 11/15/2022
Location: 6
Work Order Number: 116089
Payment Type: Finance

Page 1 of 1

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9770	2763	1H09770SHA0735954	FLM9770	

/B130-006 F-0006895 Retail
 CORRECTION

Labor: \$140.00 Parts: \$0.00 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$140.00

ALL/9010/120/38 Retail
 CORRECTION:

Diagnose issue with not able to adjust sieve and chaffer from cab
 recalibrated sieve and chaffer. opened and closed and didn't throw a code or alarm.

Labor: \$280.00 Parts: \$0.00 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$280.00

Finance Information

Customer PO No:
Tax Exempt No: REC'D
Advisor: DAN MORFORD

Type: Multi-Use/Acct US **Auth. No:** 508733
Merchant No: 37000349
Card No: xxxxxxxxxxxx0336
Bill Code: 705 - JD COMBINE/PARTS/SERVICE
Credit Plan: 240 - PURCHASE

Labor: \$420.00
Parts: \$0.00
OL&M: \$0.00
Misc: \$0.00
Sales Tax: \$0.00
Grand Total: \$420.00

*** DOCUMENT COPY ***

TERMS AND CONDITIONS

This purchase(s) is subject to the terms of the Multi-Use Account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.

This purchase(s) is subject to the terms of the multi-use account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.

Invoice To Account No: 3408

Deliver To:

SERVICE INVOICE

T L MOSS, INC
TIM MOSS
9915 W RD 40 N
SELDEN KS 67757

Bus Phone:
Prv Phone:

T L MOSS, INC
9915 W RD 40 N
SELDEN KS 67757

Bus Phone:
Prv Phone:

Invoice Number: 6273
Invoice Date: 12/8/20
Location:
Work Order Number: 103
Payment Type: Final

Page: 1 of 1

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9770		1H09770SHA0735954	TLM9770	

ALL/9002/SHP/590 Retail

CORRECTION:


Performed John Deere Inspection on combine in shop

Miscellaneous	Description	Quantity	List Price	Net Price	Extended Price	Tax
37900	PTS DISC ALLOW	-1.00	1,167.76	1,167.76	(\$1,167.76)	
ROLLBACK6	SVC ROLLBACK INSPECTION DISC/H	-1.00	910.00	910.00	(\$910.00)	
Labor: \$910.00		Parts: \$0.00	OL&M: \$0.00	Misc: (\$2,077.76)	Sub-Total: (\$1,167.76)	

9770STS/6949/FHDM/20 Retail

CORRECTION:

Reconditioned feeder house drum shaft & bearing
 Removed mounting hardware and links
 Removed front dust shield
 Loosened and separated chain
 Removed front drum
 Replaced bearings and bearing retainers
 Replaced shaft as necessary
 Reassembled front drum
 Adjusted chain tension

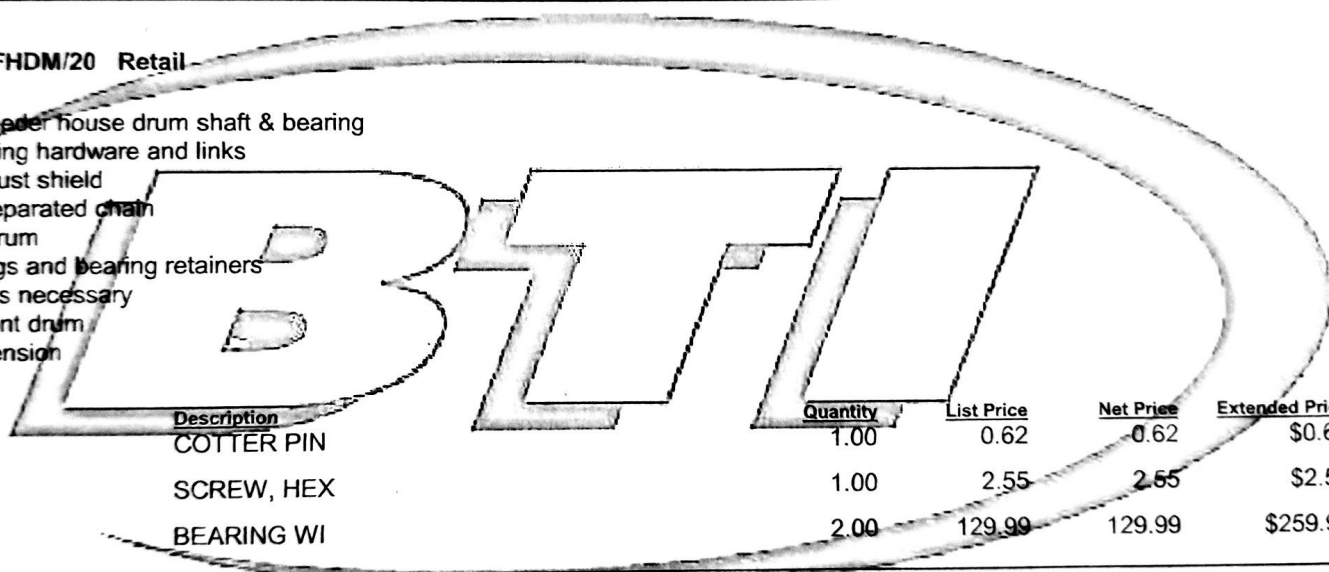

Part Number	Description	Quantity	List Price	Net Price	Extended Price
11M7032	COTTER PIN	1.00	0.62	0.62	\$0.62
21M7584	SCREW, HEX	1.00	2.55	2.55	\$2.55
AH219987	BEARING WI	2.00	129.99	129.99	\$259.98
Labor: \$572.00		Parts: \$263.15	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$835.15

9770STS/5102/20 Retail

CORRECTION:

Reconditioned lift cylinder
 Put cylinder in vise
 Removed end cap from cylinder
 Removed ram out of cylinder housing
 Installed new seal kit



1361 West Hwy 24
Hoxie, KS 67740
(844) 688-4362
(785) 675-8207

BTI Greensburg (888) 723-3331 (620) 723-3331
BTI Ness City (800) 572-2251 (785) 798-2410
BTI Pratt (800) 573-5606 (620) 672-5606
BTI Hoxie (844) 688-4362 (785) 675-8207
BTI Great Bend (800) 817-9921 (620) 793-3500



JOHN DEERE

Invoice To Account No: 3408

Deliver To:

SERVICE INVOICE

T L MOSS, INC
TIM MOSS
9915 W RD 40 N
SELDEN KS 67757

Bus Phone:
Prv Phone:

T L MOSS, INC
9915 W RD 40 N
SELDEN KS 67757

Bus Phone:
Prv Phone:

Invoice Number: **627352**
Invoice Date: 12/8/2021
Location: 6
Work Order Number: 103267
Payment Type: Finance
Page: 2 of 17

Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9770		1H09770SHA0735954	TLM9770	


9770STS/5102/20 Retail

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed In	
AHC11572	HYDRAULIC	1.00	81.20	81.20	\$81.20	N	
AHC22107	HYDRAULIC	1.00	66.82	66.82	\$66.82	N	
Labor: \$153.40		Parts: \$148.02		OL&M: \$0.00		Misc: \$0.00	
						Sub-Total: \$301.42	

9770STS/3352/SANA/10 Retail

CORRECTION:

Removed & Installed all shoe auger new style front bearings
Removed right hand wheel(s)
Loosened nuts to relieve belt tension and removed belt
Removed nut, sheave and woodruff key
Loosened set screw and removed locking collar
Removed nuts and outside flange and bearing
Repeated for left side
Installed new bearing and put together in reverse

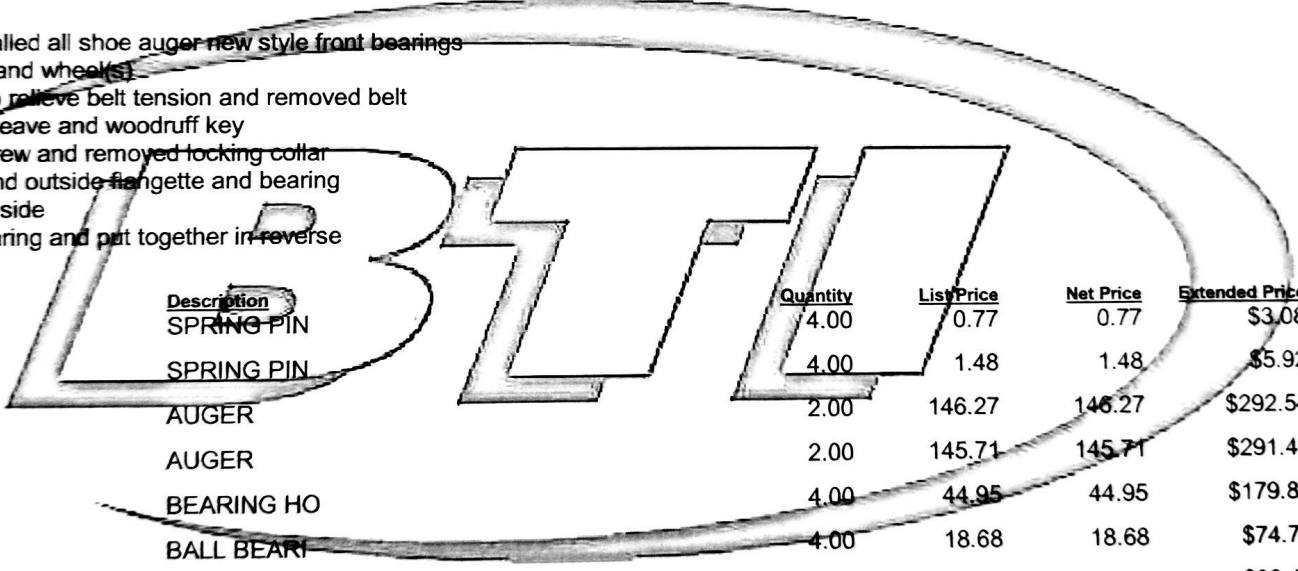

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed In
34H286	SPRING PIN	4.00	0.77	0.77	\$3.08	N
34H333	SPRING PIN	4.00	1.48	1.48	\$5.92	N
AH146786	AUGER	2.00	146.27	146.27	\$292.54	N
AH146787	AUGER	2.00	145.71	145.71	\$291.42	N
AH163056	BEARING HO	4.00	44.95	44.95	\$179.80	N
AH214862	BALL BEAR	4.00	18.68	18.68	\$74.72	N
H103264	PRESSED FL	14.00	2.32	2.32	\$32.48	N
H137215	GEAR	4.00	29.55	29.55	\$118.20	N
HDW	Bulk Hardware	7.00	0.72	0.72	\$5.04	N
JD8554	ECCENTRIC	4.00	6.76	6.76	\$27.04	N

Invoice To Account No: 3408	Deliver To:	Invoice Number:
T L MOSS, INC TIM MOSS 9915 W RD 40 N SELDEN KS 67757	T L MOSS, INC 9915 W RD 40 N SELDEN KS 67757	Invoice Date: Location: Work Order Number: Payment Type:
Bus Phone: Prv Phone:	Bus Phone: Prv Phone:	Page:
Make Model:	Meter:	Serial Number:
JOHN DEERE 9770		1H09770SHA0735954
		Eq ID: TLM9770


9770STS/3352/SANA/10 Retail		5.00	2.04
M72598	PIN, LYNCH		
Labor: \$917.80	Parts: \$1,040.44	OL&M: \$0.00	Misc: \$0.00

9770STS/3259/SA/10 Retail

CORRECTION:

REMOVED & INSTALLED SHOE AUGER DRIVE SHAFT

- Removed right hand wheel(s)
- Loosened nuts to relieve belt tension and removed belt
- Removed nut and sheave and key
- Loosened set screw and removed locking collar
- Removed nuts and outside flange and bearing
- Repeated for left side
- Removed speed sensor
- Moved inside flange away and bearing
- Loosened clamp, slide away and removed keys
- Loosened set screw on center collar and removed
- Removed shaft out right side of machine

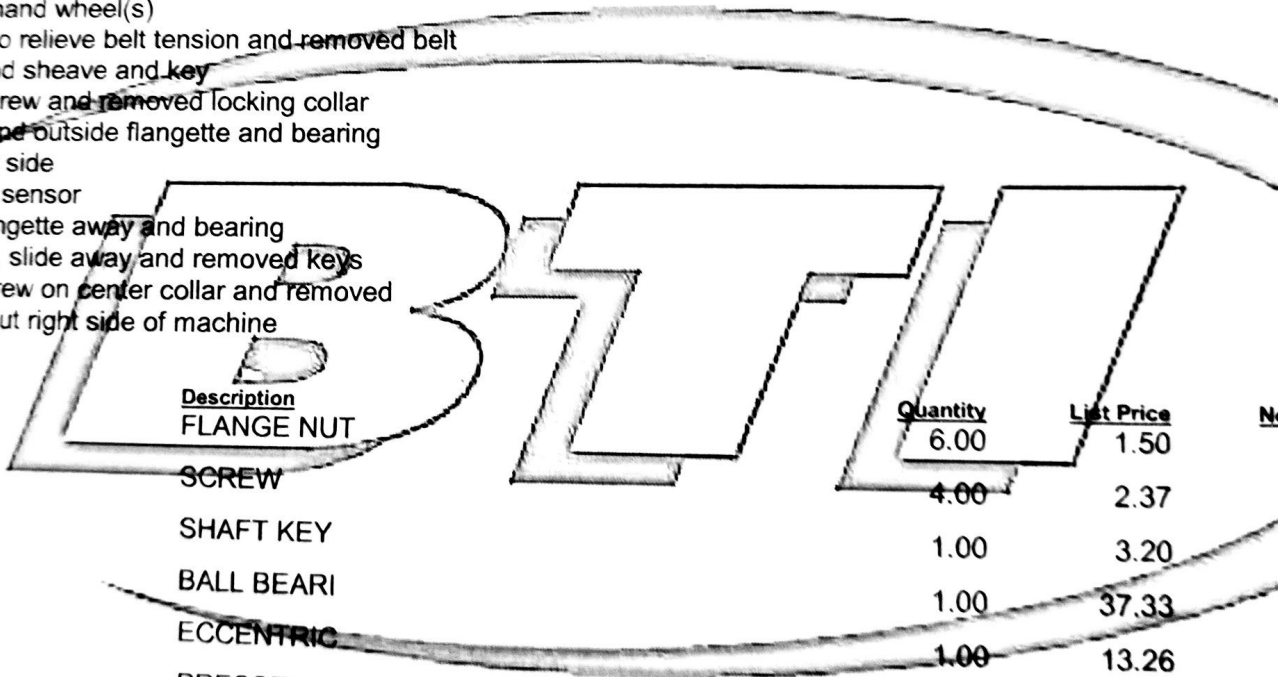

Part Number	Description	Quantity	List Price
14M7296	FLANGE NUT	6.00	1.50
19M7804	SCREW	4.00	2.37
26M4226	SHAFT KEY	1.00	3.20
AH129451	BALL BEARI	1.00	37.33
AH129452	ECCENTRIC	1.00	13.26
E10018	PRESSED FL	1.00	3.40
H141123	PUSH NUT	3.00	1.61
H145112	CLAMP	4.00	11.88
H171186	SHAFT	1.00	271.42
H211285	BEVEL GEAR	4.00	38.40
HDW	Bulk Hardware	8.00	0.72
JD8554	ECCENTRIC	6.00	6.76



1361 West Hwy 24
 Hoxie, KS 67740
 (844) 688-4362
 (785) 675-8207

BTI Greensburg (888) 723-3331 (620) 723-3331
 BTI Ness City (800) 572-2251 (785) 798-2410
 BTI Pratt (800) 573-5606 (620) 672-5606
 BTI Hoxie (844) 688-4362 (785) 675-8207
 BTI Great Bend (800) 817-9921 (620) 793-3500



SERVICE INV

Invoice To Account No: 3408

Deliver To:

T L MOSS, INC
 TIM MOSS
 9915 W RD 40 N
 SELDEN KS 67757

Bus Phone:
 Prv Phone:

T L MOSS, INC
 9915 W RD 40 N
 SELDEN KS 67757

Bus Phone:
 Prv Phone:

Invoice Number:
 Invoice Date:
 Location:
 Work Order Number:
 Payment Type:

Page:


Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9770		1H09770SHA0735954	TLM9770	

9770STS/3259/SA/10 Retail					
JD8665	BALL BEARI	3.00	13.15	13.15	\$39
M48583	SHAFT KEY	4.00	8.91	8.91	\$35
M84309	NUT	11.00	1.46	1.46	\$16
Labor: \$689.00	Parts: \$690.51	OL&M: \$0.00	Misc: \$0.00	Sub-Total: \$1,3	

9770STS/4164/UCC/10 Retail

CORRECTION:
 REMOVED & INSTALLED UPPER CONVEYOR CHAIN DRIVE SPROCKET
 -
 Removed necessary components in order to remove feeder house from machine

Separated chain, removed slip clutch and removed wear plates
 Loosened sprockets and removed shaft from machine
 Installed new sprockets and hardware
 Reinstalled shaft and reassembled feeder house
 Reinstalled on machine

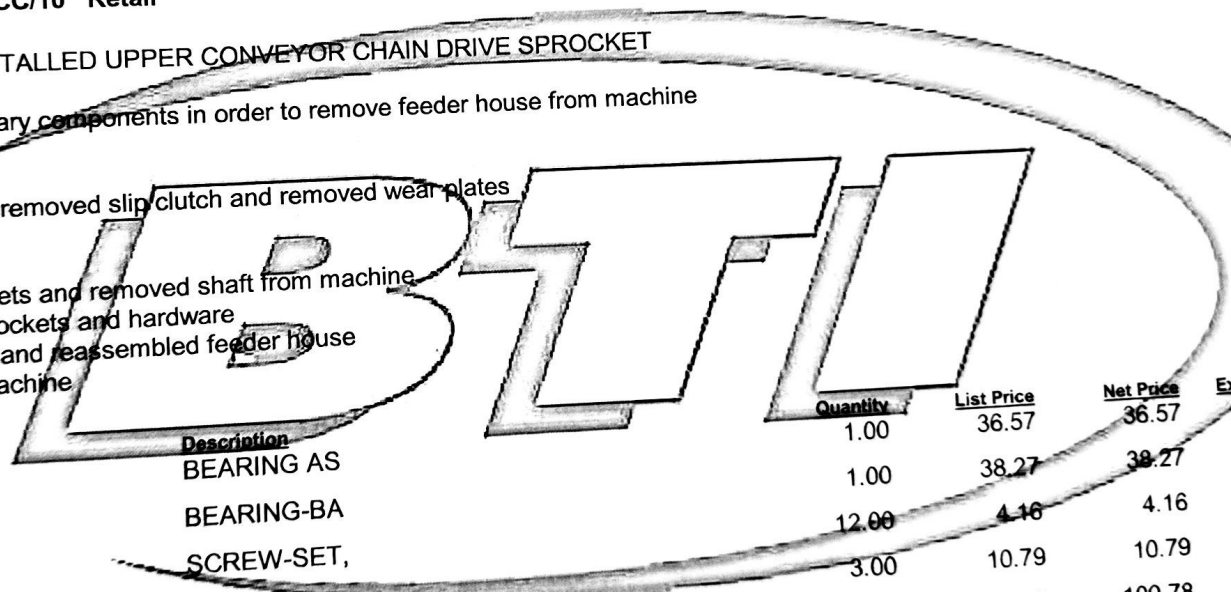

Part Number	Description	Quantity	List Price	Net Price	Exten
JD10020	BEARING AS	1.00	36.57	36.57	
JD9373	BEARING-BA	1.00	38.27	38.27	
H156580	SCREW-SET,	12.00	4.16	4.16	
H229470	SHAFT KEY	3.00	10.79	10.79	
HXE123463	CHAIN SPRO	3.00	109.78	109.78	
Labor: \$1,224.60	Parts: \$486.47	OL&M: \$0.00	Misc: \$0.00	Sub-Total:	

9770STS/6404/CV/10 Retail
CORRECTION:



BTI Hoxle
 1361 West Hwy 24
 Hoxle, KS 67740
 (844) 688-4362
 (785) 675-8207

BTI Bucklin (800) 334-4823 (620) 826-3273
 BTI Greensburg (888) 723-3331 (620) 723-3331
 BTI Ness City (800) 572-2251 (785) 798-2410
 BTI Pratt (800) 573-5606 (620) 672-5606
 BTI Hoxle (844) 688-4362 (785) 675-8207
 BTI Great Bend (800) 817-9921 (620) 793-3500

SERVICE INVOICE

Invoice To Account No: 3408		Deliver To		Invoice Number:	
T L MOSS, INC TIM MOSS 9915 W RD 40 N SELDEN KS 67757		T L MOSS, INC 9915 W RD 40 N SELDEN KS 67757		Invoice Date:	
Bus Phone:		Bus Phone:		Location:	
Prv Phone:		Prv Phone:		Work Order Number:	
				Payment Type:	
				Page:	
Make/Model	Meter:	Serial Number:	Eq ID:	Fleet No:	
JOHN DEERE 9770		1H09770SHA0735954	TLM9770		

9770STS/6404/CV/10 Retail

- Removed & Installed conveyor chain
- Removed feeder house drive chain
- Loosened feeder house conveyor chain
- Rolled feeder house connect links to the front so they are facing you
- Removed from chain
- Hooked new chain to old chain with old connect links and pulled into feeder house
- Installed new connect links onto new chain
- Set conveyor chain to specs
- Reinstalled feeder house drive chain

Part Number	Description	Quantity	List Price	Net Price	Extended Price
AH220541	CHAIN LINK	3.00	41.13	11.13	\$33.39
AXE24307	ROLLER CHA	1.00	1,688.99	1,688.99	\$1,688.99
Labor: \$397.80		Parts: \$1,722.38		OL&M: \$0.00	
				Mjsc: \$0.00	
					Sub-Total: \$2,120.00

9770STS/3351/RHFA/10 Retail

- CORRECTION:
 REMOVED & INSTALLED RIGHT HAND FEED ACCELERATOR BEARING
 Loosened feed accelerator drive belt and removed from pulley
- Removed pulley
 - Removed bearing locking collar
 - Removed bearing with flange from shaft
 - Removed bearing from flange
 - Reassembled in reverse order

Part Number	Description	Quantity	List Price	Net Price	Extended Price
AXE60582	BALL BEAR	1.00	63.39	63.39	\$63.39
RE12	12oz Penetrant	1.00	12.86	12.86	\$12.86
Labor: \$371.80		Parts: \$76.25		OL&M: \$0.00	
				Misc: \$0.00	
					Sub-Total: \$448.05

9770STS/3351/LHFA/10 Retail
 CORRECTION:

Bus Phone:

Prv Phone:

Bus Phone:

Prv Phone:

Make/Model:

Meter:

Serial Number

JOHN DEERE 9770

1H09770SHA

9770STS/3351/LHFA/10 Retail

REMOVED & INSTALLED LEFT HAND FEED ACCELERATOR BEARING

-
- Removed bearing locking collar
- Removed bearing with flange from shaft
- Removed bearing from flange
- Reassembled in reverse order

Part Number
AXE60582

Description
BALL BEARI

Labor: \$143.00

Parts: \$63.39

OL&M: \$0.00

9770STS/7558/SD/10 Retail

CORRECTION:

REMOVED & INSTALLED SERRATED WEAR STRIPS

-
- Lowered feeder house all the way down and shut engine off
- Removed both feeder house top doors
- Unbolted wear strips, removed and installed
(Torqued bolts 70 Nm or 52 lb ft)
- Put together in reverse order

Part Number
H165407

Description
PLATE

Labor: \$535.60

Parts: \$573.00

OL&M: \$0.00

9770STS/5902/20 Retail

CORRECTION:

9770STS/5902/20 Retail

Reconditioned reel pump drive
 Removed nut from pump shaft
 Removed pump drive assembly from pump
 Removed inner and outer bearings from drive assembly
 Cleaned all old grease from drive assembly cavity
 Installed new bearings and filled assembly with new grease
 Installed drive assembly onto pump
 Made sure woodruff key is in pump shaft
 Installed nut on pump shaft
 Torqued to specification

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>Est</u>
AH201038	BALL BEARI	1.00	15
AH201531	BALL BEARI	1.00	2
TY25744	GREASE	1.00	
Labor: \$305.50			
Parts: \$212.10			
OL&M: \$0.00			
Misc: \$0.00			

9770STS/3351/DB/10 Retail

CORRECTION:

Removed & Installed discharge beater bearing

Right side:

Removed sensor and mag

Loosened and removed locking collar

Blocked up beater

Removed nut from flanges and removed bearing

Installed in reverse order

Left side:

Removed shield and loosened and removed belt

Removed pulley and hub

Blocked up beater

Loosened and removed locking collar

Removed nuts from flange and removed bearing

Part Number
TY24753

Description
EMERY CLOT

Quantity
1.00

9770STS/3351/DB/10 Retail
AH139296

BALL BEARI

Labor: \$612.30

Parts: \$67.56

OL&M: \$0.00

9770STS/6203/SI/10 Retail

CORRECTION:

REMOVED & INSTALLED SIEVE ACTUATOR

Raised chopper and lowered bottom plate
Unplugged harness (L side) removed ~~cover over~~ actuator
Removed retaining bolts and ~~removed chaffer~~
Removed cover from ~~actuator~~ on sieve
Unhooked ~~harness~~ and removed nut from adjustment arm
Unbolted and removed actuator
Installed and put together in reverse order
Checked adjustment in cab
Recalibrated if needed

Part Number
AH223322

Description
ACTUATOR

Labor: \$642.20

Parts: \$728.83

OL&M: \$0.00

9770STS/4318/E/10 Retail

CORRECTION:

Removed & Installed steering tie rod (each)
Removed cotter keys and nut from tie rod end at spindles and removed
Unscrewed from both ends of steering cylinder
Put together in reverse order

Part Number
11M7087

Description
COTTER PIN

AH155001

BALL JOINT

AH231494

TIE ROD AS

9770STS/4318/E/10 Retail
H161582

TUBE

1.0

Labor: \$382.20

Parts: \$825.44

OL&M: \$0.00

Mi:

9770STS/6935/10 Retail

CORRECTION:

- Removed & Installed chopper
- Raised chopper and removed drive belt shielding
- Removed drive belt from chopper
- Lowered chopper fully
- Supported chopper with proper lifting equipment
- Removed all chopper attaching hardware and actuator attaching hardware
- Removed chopper
- Reinstalled in reverse order and tested

Part Number
H215050

Description
SHEET

Labor: \$535.60

Parts: \$312.52

OL&M: \$0.00

9770STS/4059/LRC/10 Retail

CORRECTION:

- Removed & Installed Lower Chopper Housing
-
- Raised chopper to windrow position
- Removed stationary knife bank
- Removed front tail board pivot bolts to remove housing carriage bolts close to the pivot p
- Removed remaining lower housing hardware and knife bank linkage
- Removed lower housing
- Installed new lower housing and hardware, knife bank linkage and knife bank, tail board
- Lowered chopper into operating position
- Ran and checked operation

Labor: \$303.50

Parts: \$738.80

OL&M: \$0.00

9770STS/1357/FED/10 Retail

CORRECTION:

- Removed & Installed feed accelerator drive belt
- Released tension on accelerator belt, Jackshaft belt and shoe supply auger belt
- Removed all belts from Jackshaft
- Installed new accelerator belt
- Reset tension on jackshaft, accelerator and shoe auger belts
- Test ran

Part Number

H173900

HXE95511

Miscellaneous

37501


Description

PIVOT

V-BELT, BE

Description

FREIGHT

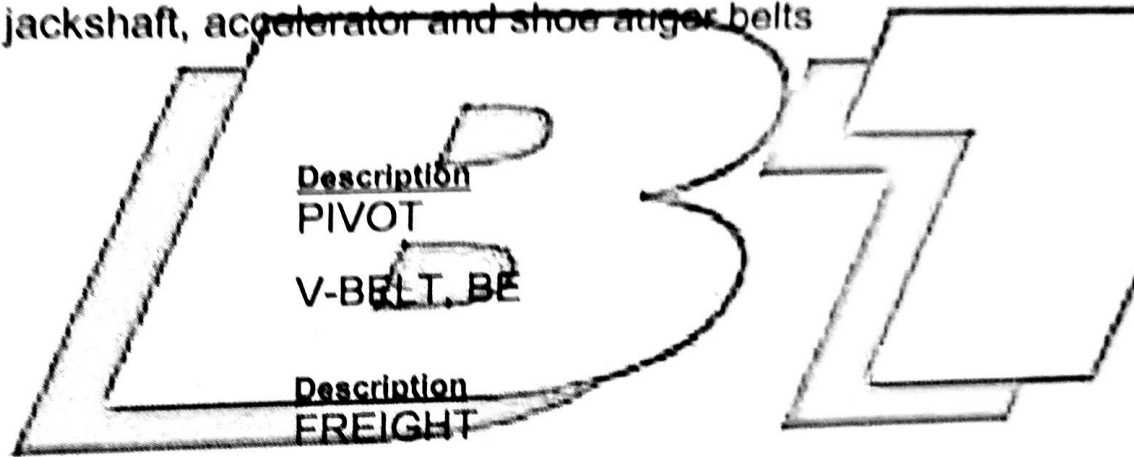

Labor: \$153.40

Parts: \$159.43

OL&M: \$0.00

9770STS/1357/FCS/10 Retail

CORRECTION:

- Removed & Installed front counter shaft belt
- Loosened spring assembly from idler to loosen belt
- Removed four upper bolts and two lower bolts that hold shield and support onto side
- Removed belt from pulleys
- Installed in reverse order

Part Number

Description

Make/Model:

JOHN DEERE 9770

9770STS/1357/FCS/10 Retail

AH150678

BELT SET

Labor: \$230.10

Parts: \$125.37

OL&M: \$

9770STS/4159/CGD/10 Retail

CORRECTION:

Removed & Installed clean grain drive idler (each)

Loosened belt

Replaced idler

Adjusted belt to gauge

Part Number

AH220915

Description

PULLEY

Labor: \$45.50

Parts: \$624.81

OL&M:

9770STS/1357/RS/10 Retail

CORRECTION:

REMOVED AND INSTALLED ROTARY SCREEN BELT

Loosened tensioner for belt assembly

Removed belt

Reinstalled and retightened tensioner

Part Number

AZ10044

Description

SPANNRING

H221273

V-BELT

Labor: \$92.30

Parts: \$53.52

OL&

9770STS/3351/RSJ/10 Retail

CORRECTION:

9770STS/3351/RSJ/10 Retail

REMOVED & INSTALLED ROTARY SCREEN JACKSHAFT BEARING

- Removed jackshaft drive belt
- Removed jackshaft assembly
- Removed sheaves and bearings
- Installed new bearings and reassembled


<u>Part Number</u>	<u>Description</u>
AH140497	CENTER SHE
H213353	V-BELT
JD39102	RADLAGER

Labor: \$299.00 Parts: \$100.85 OL&M: \$0.00

9770STS/1357/ALT/10 Retail

CORRECTION:

- Removed & Installed alternator belt
- Opened access door to engine
- Relieved belt tension and removed old belt
- Installed new belt and set tensioner

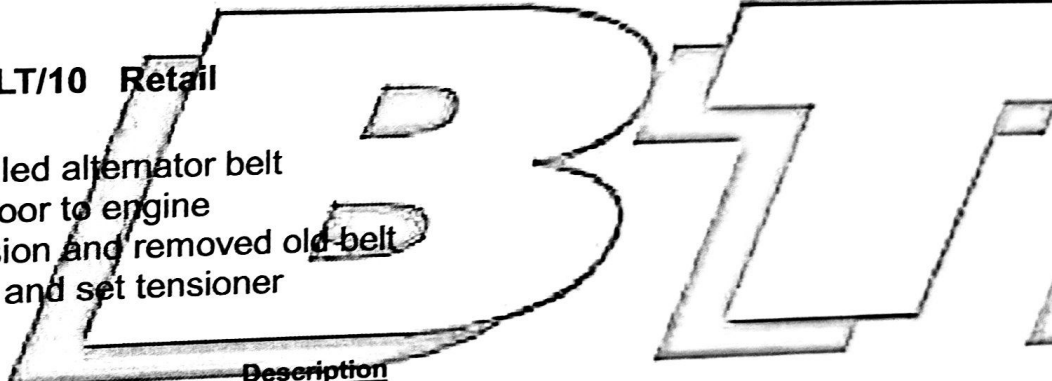

<u>Part Number</u>	<u>Description</u>
HXE32806	V-BELT

Labor: \$100.10 Parts: \$58.37 OL&M: \$0.00

9770STS/1351/RAD/10 Retail

CORRECTION:

REMOVED & INSTALLED RADIATOR PROPELLER

- Removed and replaced radiator propeller including bearing as required

Tested for proper operation

<u>Part Number</u>	<u>Description</u>
--------------------	--------------------

Bus Phone:

Prv Phone:

Meter:

1H09770SH

Make/Model:

JOHN DEERE 9770

9770STS/1351/RAD/10 Retail

JD29980

BALL BEAR

Labor: \$50.70

Parts: \$15.60

OL&M: \$0.00

9770STS/1056/10 Retail

CORRECTION:

REMOVED & INSTALLED TURBO ACTUATOR

- Turned key to off position and disconnected battery power
- Gained access to engine compartment turbo area
- Removed electrical connection to actuator
- Drained engine coolant to remove coolant lines to actuator
- Removed actuator mounting hardware per TM
- Reinstalled in reverse order
- Calibrated and tested for proper operation

Part Number
RE535990

Description
LINKAGE

Labor: \$458.90

Parts: \$397.23

OL&M: \$0.00

9770STS/3105/R/20 Retail

CORRECTION:

- Reconditioned rotor gear case
- Drained gear case oil and removed drain hose
- Removed dipstick
- Removed plug, spring and pin from cover
- Removed cap screws from gear case
- Removed cover
- Cleaned cover and housing mating surfaces and applied PM37521 RTV Sealant
- Installed cover and tightened cap screws to specification
- Installed pin, spring and plug
- Installed oil drain hose
- Filled gear case to mark on dipstick with gear lube

Part Number
AN102562

Description
LUBRICANT

9770STS/3105/R/20 Retail


JD7759	LUBRICATIO	1.00
JD7798	LUBRICATIO	1.00
TY25744	GREASE	1.00

Labor: \$765.70 Parts: \$41.47 OL&M: \$0.00 Misc: \$0.00

9770STS/4059/LA/10 Retail

**CORRECTION:
REMOVED & INSTALLED LOADING AUGER HOUSING**

- Removed tube
- Removed auger
- Removed bearing
- Removed bracket
- Switched bearing holder and latches to new spout
- Reinstalled tube and auger with new bearing
- Test ran

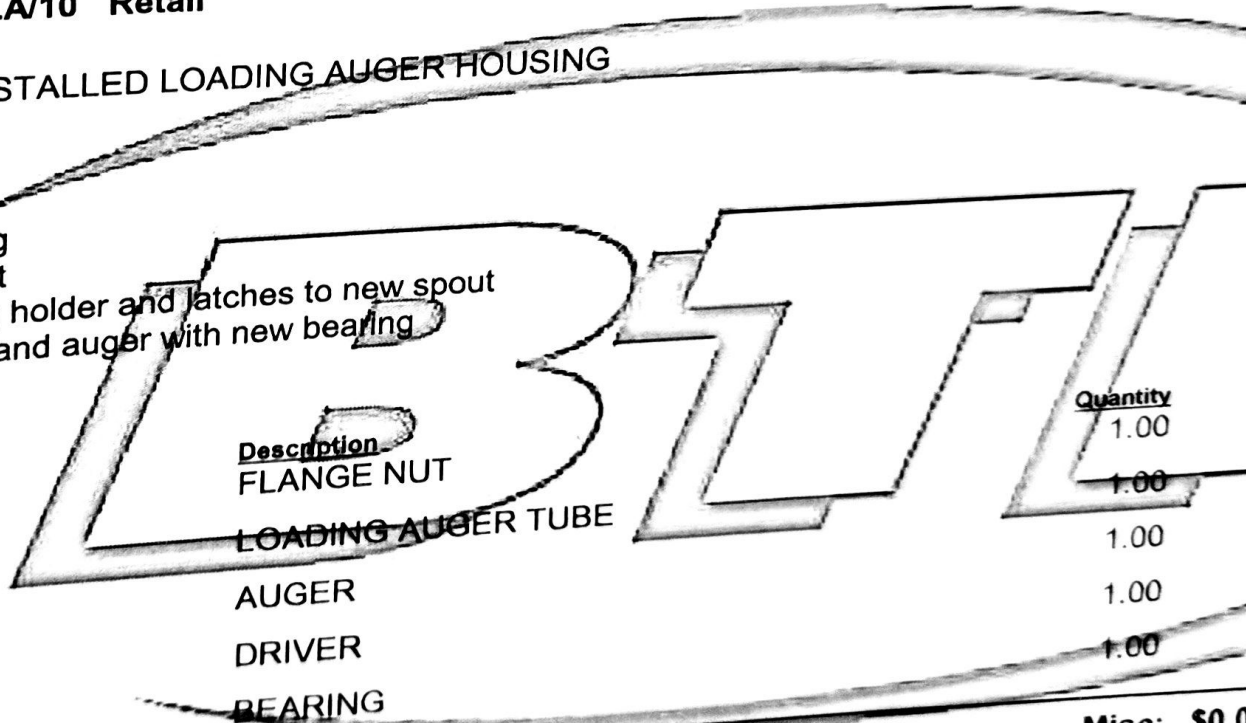

Part Number
14M7291
AH217983
AH230013
H136186
JD10384

Description
FLANGE NUT
LOADING AUGER TUBE
AUGER
DRIVER
BEARING

Quantity
1.00
1.00
1.00
1.00
1.00

Labor: \$230.10 Parts: \$1,586.92 OL&M: \$0.00 Misc: \$0.00

9770STS/7203/HUA/10 Retail
CORRECTION:

REMOVED & INSTALLED HORIZONTAL UNLOADING AUGER GRAIN SAVER DOOR

Unbolted and removed boot
 Unbolted and removed hinge and door
 Installed in reverse order

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>Li</u>
11M7012	COTTER PIN	1.00	
24M7106	WASHER	1.00	
AH214614	ISOLATOR	4.00	
AH221739	BRACKET	1.00	
AXE71684	DOOR	1.00	
H217334	TORSION SP	1.00	
H229359	PIN FASTEN	1.00	
Labor: \$153.40		Parts: \$312.89	OL&M: \$0.00
			Misc: \$0.00

9770STS/7286/HUA/10 Retail

CORRECTION:

REMOVED & INSTALLED HORIZONTAL UNLOADING AUGER BOOT

Removed all bolts holding boot on
 Removed boot
 Installed in reverse order

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>
AXE71684	DOOR	1.00
H165407	PLATE	1.00
H207377	BOOT	1.00
H208234	SHEET,MAST	1.00
H211791	STRIP	1.00

HDW

Bulk Hardware

Labor: \$153.40

Parts: \$354.84

OL&M: \$0.00

Misc: \$0.00

4.00

9770STS/1409/E/10 Retail

CORRECTION:

Removed & Installed lift light bulb (each)

<u>Part Number</u>	<u>Description</u>	<u>Quantity</u>	<u>List</u>
AD2062R	BULB	2.00	
AXE52986	LAMP, ASSY	2.00	34
AZ101891	REVOLVING	1.00	72

Labor: \$31.20

Parts: \$148.71

OL&M: \$0.00

Misc: \$0.00

9770STS/9002/PMS/41 Retail

CORRECTION:

- Performed partial machine service
- Changed oil in engine crank case
- Changed engine oil filter
- Changed all engine air filters
- Changed fuel filters
- Changed cab air filters
- Greased entire machine

Part Number
 AH168783
 AH212295
 AH222225
 H220870
 RE509672
 RE525523

Description
 AIR FILTER
 FILTER ELE
 FILTER ELE
 AIR FILTER
 FILTER ELE
 FILTER ELE

<u>Quantity</u>	<u>List Price</u>
1.00	64.1
1.00	100.9
1.00	140.4
1.00	43.7
1.00	21.39
1.00	88.68