

BTI Bucklin (800) 334-4823 (620) 826-3271 BTI Greensburg (888) 723-3331 (620) 723-3331 BTI Ness City (800) 572-2251 (785) 798-2410 BTI Pratt (800) 573-5606 (620) 672-5606 BTI Hoxie (844) 688-4362 (785) 675-8207 BTI Great Bend (800) 817-9921 (620) 793-3500



Invoice To Account No: 3408	oice To Account No: 3408 Deliver To:		
T L MOSS, INC TIM MOSS 9915 W RD 40 N SELDEN KS 67757	9915 W RD 40 N SELDEN KS 67757		839341 9/26/2024 6 140114 Finance
Bus Phone:	Bus Phone:	Payment Type:	, manos
Prv Phone:	Prv Phone:	Page:	1 of 2
Make/Model:	Meter: Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9770	1H09770SHA073595	54 TLM9770	

## 9770STS/6404/UAD/10 Retail

CORRECTION:

R&I UNLOADING AUGER DRIVE CHAIN

Loosened unloading auger drive chain tensioner Removed unloading auger drive chain Reinstalled drive chain & adjusted tensioner to proper spec

Part Number AXE53952	Description ROLLER CHA	Quantity         List Price           1.00         244.99	Net Price         Extended Price         Taxed Ind           244.99         \$244.99         N
Labor: \$103.25	Parts: \$244.99 OL&M: \$0.0	00 Misc÷-\$0.00	Sub-Total: \$348.24
/SC Retail			
CORRECTION: SC SERVICE CALL DRIVI	NG/TIME		
/	1 DA		
//			
//_			
f			



BTI Bucklin (800) 334-4823 (620) 826-3271 BTI Greensburg (888) 723-3331 (620) 723-3331 BTI Ness City (800) 572-2251 (785) 798-2410 BTI Pratt (800) 573-5606 (620) 672-5606 BTI Hoxie (844) 688-4362 (785) 675-8207

BTI Great Bend (800) 817-9921 (620) 793-3500



Invoice To Account No: 3408	te To Account No: 3408 Deliver To:			
T L MOSS, INC TIM MOSS 9915 W RD 40 N SELDEN KS 67757	T L MOSS, INC 9915 W RD 40 N SELDEN KS 6775	57	Invoice Number: Invoice Date: Location: Work Order Number: Payment Type:	<b>839341</b> 9/26/2024 6 140114 Finance
Bus Phone: Prv Phone:	Bus Phone: Prv Phone:		Page:	2 of 2
Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9770		1H09770SHA07359	54 TLM9770	

/SC Retail

Labor: \$106.75 Parts: \$0.00 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$106.75

Finance Information \$210.00 Labor: **Customer PO No:** Type: Multi-use Acct US Auth. No: 185301 Parts: \$244.99 Tax Exempt No: REC'D22 Merchant No: 37000349 OL&M: \$0.00 Advisor: Kyle Kersenbrock Card No: xxxxxxxxxxxxxx0336 \$0.00 Misc: Bill Code: 705 - JD COMBINE PARTS/SERVICE Sales Tax: \$0.00 Credit Plan: 249 - PURCHASE \* \* \* DOCUMENT COPY \* \* \* **Grand Total:** \$454.99

### **TERMS AND CONDITIONS**

This purchase(s) is subject to the terms of the Multi-Use Account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.

Described to	
Received by:	l late:
. tooon od by:	



**BTI Bucklin** (800) 334-4823 (620) 826-3271 BTI Greensburg (888) 723-3331 (620) 723-3331 **BTI Ness City** (800) 572-2251 (785) 798-2410 **BTI Pratt** (800) 573-5606 (620) 672-5606 **BTI Hoxie** (844) 688-4362 (785) 675-8207

BTI Great Bend (800) 817-9921 (620) 793-3500



Invoice To Account No: 3408	Deliver To:	SEF	RVICE INVOICE	
T L MOSS, INC TIM MOSS 9915 W RD 40 N SELDEN KS 67757	T L MOSS, INC 9915 W RD 40 N SELDEN KS 67757		<b>840030</b> 9/27/2024 6 140007 Finance	
Bus Phone:	Bus Phone:		Payment Type:	
Prv Phone:	Prv Phone:		Page:	1 of 2
Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9770	3017	1H09770SHA0735954	TLM9770	

### 9770STS/3105/90%/10 Retail

CORRECTION:

R&I 90 degree gear case Removed horizontal unloading augers Removed cap screws holding gear case in Pulled gear case up from vertical auger Removed gear case Reassembled in reverse order

	Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
	AXE12921	AUGER	1.00	1,338.61	1,338.61	\$1,338.61	N
	DE19353	GEAR CASE	1.00	-1,854.67	1,854.67	\$1,854.67	N
	E64256	XH 8M) TUA	5.00_	1.62	1.62	\$8.10	N
	H173900	PIVOT	1.00	20.01-	20.01	\$20.01	N
	H218954 /	CAP SCREW,	<del>5</del> .00 /	2.45/	2.45	\$12.25	N
	H222424	EYEBOLT	/1.00	97.08	97.08	\$97.08	N
	Miscellaneous /	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
_	37501	FREIGHT	/ 1/.00	19.25	19.25	\$19.25	N
	Labor: \$1,094,30	Parts: \$3,330.72 OL&M: \$0.00	/ /Misc:	\$19.25	Sub-To	tal: \$4,444.2	7
35-	$\ell$		<u> </u>	1	A. C.	7	

# 9770STS/9002/86 Retail

CORRECTION:

Lubricated combine.

Lubricated all grease points on the machine-

Lubricated all grease points on the machine.

Part Number	<u>Description</u>	SD Polyurea	Quantity	List Price	Net Price	Extended Price	Taxed Ind
TY6341	Grease Multi Purpose		2.00	7.44	7.44	\$14.88	N
Labor: \$249.55	Parts: \$14.88	OL&M: \$0.00	Misc:	\$0.00	Sub-To	otal: \$264.43	

9770STS/1909/FHS/10 Retail

CORRECTION:



BTI Bucklin (800) 334-4823 (620) 826-3271 BTI Greensburg (888) 723-3331 (620) 723-3331 BTI Ness City (800) 572-2251 (785) 798-2410 BTI Pratt (800) 573-5606 (620) 672-5606 BTI Hoxie (844) 688-4362 (785) 675-8207 BTI Great Bend (800) 817-9921 (620) 793-3500



Invoice To Account No: 3408	unt No: 3408 Deliver To:			RVICE INVOICE
T L MOSS, INC TIM MOSS 9915 W RD 40 N SELDEN KS 67757	T L MOSS, INC 9915 W RD 40 N SELDEN KS 67757		Invoice Number: Invoice Date: Location: Work Order Number: Payment Type:	840030 9/27/2024 6 140007 Finance
Bus Phone: Prv Phone:	Bus Phone: Prv Phone:		Page:	2 of 2
Make/Model:	Meter:	Serial Number:	Eq ID:	Fleet No:
JOHN DEERE 9770	3017	1H09770SHA0735954	TLM9770	

## 9770STS/1909/FHS/10 Retail

R&I feeder house speed sensor
Disconnected electrical connection
Loosened nuts and unscrewed sensor
Installed new sensor
Set gap to spec
Connected electrical connection
Verified the operation

Part Number AH221249	Description SPEED SENS	7	Quantity 1.00	List Price 110.79		### Taxed Ind ### N
Labor: \$91.45	Parts: \$110.79	OL&M: \$0.00	Misc: \$0	.00	Sub-Total:	\$202.24
- Andrews						s. Eria
		Finance Information	1-1	7	Labor:	\$1,435.30
Customer PO No:	1 10	Type: Multi-use Acct US	th. No: /24633	34	Parts:	\$3,456.39
Tax Exempt No: RE	C'D22	Merchant No: 37000349		/	OL&M:	\$0.00
Advisor: Kyl	e Kersenbrock	Card No: / xxxxxxxxxxxx0836	11	/	Misc:	\$19.25
	A. march	Bill Code: 705 - JD COMBII	NE PARTS/SE	RVICE	Sales Tax:	\$0.00
* * * DOCUME!	NT COPY * * *	Credit Plan: 249 - PURCHAS	Æ /	_/	Grand Total:	\$4,910.94
	-					

### **TERMS AND CONDITIONS**

This purchase(s) is subject to the terms of the Multi-Use Account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.

ceived by:	
corred by Date Date	



**BTI Bucklin** (800) 334-4823 (620) 826-3271 BTI Greensburg (888) 723-3331 (620) 723-3331 **BTI Ness City** (800) 572-2251 (785) 798-2410 BTI Pratt (800) 573-5606 (620) 672-5606 **BTI Hoxie** (844) 688-4362 (785) 675-8207

BTI Great Bend (800) 817-9921 (620) 793-3500



Invoice To Account No: 3408	Deliver To:	SER	VICE INVOICE
T L MOSS, INC TIM MOSS 9915 W RD 40 N SELDEN KS 67757	T L MOSS, INC 9915 W RD 40 N SELDEN KS 67757	Invoice Number: Invoice Date: Location: Work Order Number: Payment Type:	841585 10/3/2024 6 140300 Finance
Bus Phone:	Bus Phone:		ger 14 b)
Prv Phone:	Prv Phone:	Page:	1 of 3
Make/Model:	Meter: Serial Number:	Eq ID:	Fleet No:

JOHN DEERE 9770 3036 1H09770SHA0735954 TLM9770

## FIELD1 Retail

CORRECTION:

Look at variable speed feeder house issue look up parts and get ordered

Labor: \$264.55 Parts: \$0.00 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$264.55

# /sc Retail

CORRECTION:

SC SERVICE CALL DRIVING TIME

Labor: \$122.10 Parts: \$0.00 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$122.10 9770STS/6822/20 Retail CORRECTION: seperator hours 2172 Recon upper feeder house variable drive Ran feeder house to close lower variable sheave Disconnected hydraulic hose from multi-coupler Removed drive belt Removed piston

Removed variable drive belt

Removed sheaves from countershaft Inspected inner sheave hub for any defects Removed outer seal and back-up ring

Removed barrel from sheave assembly

Turned barrel over and removed inner seal and back-up ring

Removed cap screws and hub Pressed bearing out of sheave

replace shaft and bracket-inner sheave and parts

replace outer bearing and piston

run and check

Part Number	Description	Quantity	List Price	Net Price	Extended Price	Taxed Ind
19M7867	SCREW	6.00	1.28	1.28	\$7.68	N
24H1740	WASHER	1.00	0.72	0.72	\$0.72	Ν



BTI Bucklin (800) 334-4823 (620) 826-3271 BTI Greensburg (888) 723-3331 (620) 723-3331 BTI Ness City (800) 572-2251 (785) 798-2410 BTI Pratt (800) 573-5606 (620) 672-5606 BTI Hoxie (844) 688-4362 (785) 675-8207 BTI Great Bend (800) 817-9921 (620) 793-3500



Invoice To Account No: 3408	A Company of the Comp	Deliver To:			SER\	ICE INV	OICE
T L MOSS, INC TIM MOSS 9915 W RD 40 N SELDEN KS 67757		T L MOSS, INC 9915 W RD 40 N SELDEN KS 67757		L Work Order I	lumber: ce Date: .ocation:		841585 0/3/2024 6 140300 Finance
Bus Phone: Prv Phone:		Bus Phone: Prv Phone:					
Make/Model:		Meter:	Serial Number:	En ID:	Page:	FL (N	2 of 3
JOHN DEERE 9770		3036	1H09770SHA0735954	Eq ID: TLM9770	7.7.100.00	Fleet No:	
<b>9770STS/6822/20 Retail</b> AH136497	SEAL ASSY,		1.0	00 25.6	7 25.67	\$25.67	N
AH165609	BALL BEARI		1.0	00 119.1	3 119.18	\$119.18	Ν
AH204591	HALF SHEAV	ć	1.0	00 726.79	9 726.79	\$726.79	N
AH213758	HYDRAULIC		1.0	00 378.3	1 378.31	\$378.31	N
AXE55405	STRAP		1.0	00 336.09	336.09	\$336.09	N
H203610	BOOT		1.0	00 20.8	1 20.81	\$20.81	N
H77698	TIE BAND	-	1.0	0.79	0.79	\$0.79	N
H97378	HUB.		1.0	00 - 208.6	3 208.63	\$208.63	N
JD10018	BALL BEARI		1.0	00 35.8	35.85	\$35.85	N
R31378	O-RING		1.0	00 4.8	4.85	\$4.85	N
Miscellaneous	Description	3/2	Quant	List Pric	Net Price	Extended Price	Taxed Ind



Labor: \$895.40

BTI Hoxie 1361 West Hwy 24 Hoxie, KS 67740 (844) 688-4362 (785) 675-8207

Parts: \$1,865.37

BTI Bucklin (800) 334-4823 (620) 826-3271 BTI Greensburg (888) 723-3331 (620) 723-3331 BTI Ness City (800) 572-2251 (785) 798-2410 BTI Pratt (800) 573-5606 (620) 672-5606 BTI Hoxie (844) 688-4362 (785) 675-8207

BTI Great Bend (800) 817-9921 (620) 793-3500


Misc: \$14.35



Sub-Total: \$2,775.12

Invoice To Account No: 3408	Deliver To:			SERVIC	CE INVO	ICE
T L MOSS, INC TIM MOSS 9915 W RD 40 N SELDEN KS 67757	T L MOSS, INC 9915 W RD 40 N SELDEN KS 677	57	Invoice Numb Invoice Da Locati Work Order Numb Payment Ty	ate: on: per:	10/	41585 /3/2024 6 140300 Finance
Bus Phone:	Bus Phone:					
Prv Phone:	Prv Phone:		Pa	ge:		3 of 3
Make/Model:	Meter:	Serial Number:	Eq ID:	***************************************	Fleet No:	
JOHN DEERE 9770	3036	1H09770SHA0735954	TLM9770			
9770STS/6822/20 Retail 37501 FREI			.00 14.35	14.35	\$14.35	

OL&M: \$0.00

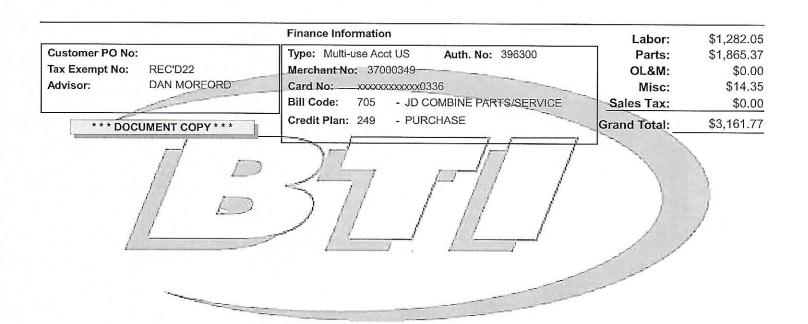

### **TERMS AND CONDITIONS**

This purchase(s) is subject to the terms of the Multi-Use Account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.

Received by:	Date	
·	400	· ····································



BTI Bucklin (800) 334-4823 (620) 826-3271 BTI Greensburg (888) 723-3331 (620) 723-3331 BTI Ness City (800) 572-2251 (785) 798-2410 BTI Pratt (800) 573-5606 (620) 672-5606 BTI Hoxie (844) 688-4362 (785) 675-8207

BTI Great Bend (800) 817-9921 (620) 793-3500



SERVICE INVOICE Invoice To Account No: 3408 Deliver To: T L MOSS, INC T L MOSS, INC Invoice Number: 841587 TIM MOSS 9915 W RD 40 N Invoice Date: 10/3/2024 9915 W RD 40 N SELDEN KS 67757 Location: 6 SELDEN KS 67757 140429 Work Order Number: Payment Type: Finance Bus Phone: Bus Phone: Prv Phone: Prv Phone: 1 of 1 Page: Make/Model: Meter: Serial Number: Eq ID: Fleet No: JOHN DEERE 9770 1H09770SHA0735954 TLM9770

FIELD1 Retail

CORRECTION:


Look over machine and temp bearings

Labor: \$168.35 Parts: \$0.00 OL&M: \$0.00 Misc: \$0.00 Sub-Total: \$168.35

# /sc Retail

CORRECTION:

SC SERVICE CALL DRIVING TIME

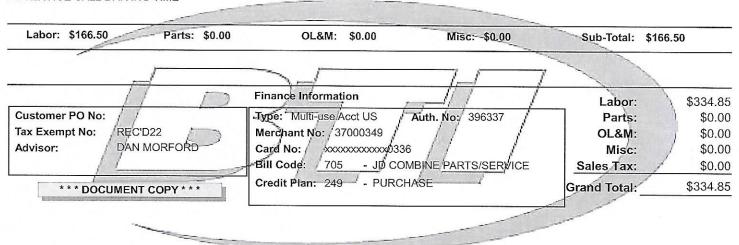

### **TERMS AND CONDITIONS**

This purchase(s) is subject to the terms of the Multi-Use Account, a service of John Deere Financial, f.s.b. I grant the issuer a purchase money security interest, except as limited in that agreement, in the goods described.

Received by:	Date:
--------------	-------



BTI Bucklin (800) 334-4823 (620) 826-3271
BTI Greensburg (888) 723-3331 (620) 723-3331
BTI Ness City (800) 572-2251 (785) 798-2410
BTI Pratt (800) 573-5606 (620) 672-5606
BTI Hoxie (844) 688-4362 (785) 675-8207
BTI Great Bend (800) 817-9921 (620) 793-3500



## \* \* \* PROFORMA INVOICE \* \* \*

Invoice To Account No: 3408	Deliver To:		S	ERVICE INVOICE
T L MOSS, INC TIM MOSS 9915 W RD 40 N SELDEN KS 67757	T L MOSS, INC 9915 W RD 40 N SELDEN KS 67757	9915 W RD 40 N		11/21/2024 6 141385 Account
Bus Phone: Prv Phone:	Bus Phone: Prv Phone:		Page:	1 of 3
Make/Model:	Meter	Serial Number:	EQ ld:	Fleet No:
JOHN DEERE 9770	3036	1H09770SHA07359	954 TLM9770	

# /B200-002 -F-0007088 Retail

## CORRECTION:

diagnose CDU 524189.09 code

recalled and cleared codes. code came back

next followed trouble shooting for .09 code which is communications on can network

checked terminators, swapped them around and had no change

checked voltage, ground, and can voltages they all read within specs

next went and checked voltages at moisture sensor, the power read low

traced it back to round bulk connector on grain tank

i replaced the splice in harness and pin in connector.

kept tracing back to fuse box. found i wasn't getting full power across the fuse

the main power supply cable was corroded also

removed and replaced fuse box

tried installing old one back on and it still wouldn't work.

i was now was getting full power at moisture sensor connector along with power and grounds

installed a reman moisture sensor and couldn't get software to recalibrate it to go through,

opened a dtac case, they had me check a few more wires and voltages.

they then had me perform procedure with the software package along with taking things offline and got software to successfully calibrate. code went away and everything worked properly.

<u>PartNumber</u>	Description		Quantity	Net Price	Extended Price	Taxed Ind
57M8035	NUT		1.00	\$6.27	\$6.27	N
AH220593	FUSE BOX		1.00	\$394.52	\$394.52	N
R44302	TIE BAND		10.00	\$0.37	\$3.70	N
R78068	ELEC. CONN		1.00	\$1.61	\$1.61	N
TY27147	16-14 to 12-10 AWG CS Heat ShrinkMulti-W		1.00	\$19.53	\$19.53	N
Miscellaneous	<u>Description</u>		Quantity	Net Price	Extended Price	Taxed Ind
37501	FREIGHT		1.00	\$14.30	\$14.30	N
Labor: \$2,240.00	Parts: \$425.63 OL&M: \$0.00	Misc	\$14.30	Sub-Total:	\$2,679.93	

## /B010-009 -F-0007068 Retail

### CORRECTION:

Detail Combine per customer or sales request.

<u>PartNumber</u>	<u>Description</u>			Quantity	Net Price	Extended Price	Taxed Ind
TY26352	SHOP CLEAN			1.00	\$11.17	\$11.17	Υ
Labor: \$400.00	Parts: \$11.17	OL&M: \$0.00	Misc:	\$0.00	Sub-Total:	\$411.17	



BTI Bucklin (800) 334-4823 (620) 826-3271 BTI Greensburg (888) 723-3331 (620) 723-3331 **BTI Ness City** (800) 572-2251 (785) 798-2410 **BTI Pratt** (800) 573-5606 (620) 672-5606 **BTI Hoxie** (844) 688-4362 (785) 675-8207 BTI Great Bend (800) 817-9921 (620) 793-3500



### \* \* \* PROFORMA INVOICE \* \* \*

Invoice To Account No:	3408	
TI MOCC INC		

Deliver To:

# SERVICE INVOICE

Fleet No:

L MOSS, INC TIM MOSS 9915 W RD 40 N **SELDEN KS 67757** 

Bus Phone:

T L MOSS, INC 9915 W RD 40 N SELDEN KS 67757

Bus Phone: Prv Phone:

Invoice Number: Invoice Date Location:

Work Order Number:

11/21/2024 141385 Account

Page:

2 of 3

Make/Model: JOHN DEERE 9770

Meter Serial Number: EQ Id: 3036 1H09770SHA0735954 TLM9770

Payment Type:

#### CORRECTION:

Prv Phone:

#### **R&I CHOPPER DRIVE TENSIONER**

Loosened belt Replaced tensioner Adjusted belt to indicator.

Labor: \$94.40

Parts: \$0.00 OL&M: \$0.00 Misc: \$0.00

Sub-Total:

\$94.40

### 9770STS/6927/UN/04 Retail

## CORRECTION:

diagnose unloading auger shearing bolt often removed auger cover and verified the augers were in time.

they were.

found the hydraulic diagram and diagnostics

checked the oil pressure to be sure regulating valve was working properly. it was within specs

pulled the elbow off and found the orifice wasn't in there.

ordered in and installed the orifice.

when running arm down the bolt under the tensioner would hit the tensioner below it

dtac had case to install shorter bolt and install lock nut on outside

installed shorter bolt and test run.

Operated like it should.

<u>PartNumber</u>	<u>Description</u>		Quantity	Net Price	Extended Price	Taxed Ind
19M7821	SCREW		1.00	\$7.28	\$7.28	N
H102013	ORIFICE		1.00	\$35.12	\$35.12	N
Labor: \$297.60	Parts: \$42.40	OL&M: \$0.00	Misc: \$0.00	Sub-Total:	\$340.00	

### 9770STS/5945/10 Retail

#### CORRECTION:

Removed & Installed moisture sensor. Disconnected wiring harness. Removed cap screws. Replaced moisture sensor. Installed software, calibrated and tested.

Installed software, calibrated and tested.

Reinstalled and tested

PartNumber

Description

Quantity

Net Price Extended Price Taxed Ind

CONTINUED ON NEXT PAGE->



**BTI Bucklin** (800) 334-4823 (620) 826-3271 BTI Greensburg (888) 723-3331 (620) 723-3331 **BTI Ness City** (800) 572-2251 (785) 798-2410 **BTI Pratt** (800) 573-5606 (620) 672-5606 **BTI Hoxie** (844) 688-4362 (785) 675-8207 BTI Great Bend (800) 817-9921 (620) 793-3500



CEDVICE INVOICE

## \* \* \* PROFORMA INVOICE \* \* \*

Ε	<b>CE INVOIC</b>	SERVI					Deliver To:		3408	Invoice To Account No:
	11/21/2024 6 141385 Account	e Date cation: Imber: Type:	Work Order Nu Payment	W		40 N	T L MOSS, I 9915 W RD SELDEN KS Bus Phone: Pry Phone:			T L MOSS, INC TIM MOSS 9915 W RD 40 N SELDEN KS 67757  Bus Phone:
	3 of 3	Page:	EQ Id:		Serial Number:	Meter	TTV THORE.			Make/Model:
	et No.	Г	TLM9770	5954	1H09770SHA0735	3036				JOHN DEERE 9770
N	\$0.76	\$0.76	1.00	1				CONN	ELEC.	57M7299
N	\$3,114.22	\$3,114.22	1.00				ın	e Sensor Rema	Moisture	SE502799
N	-\$100.00	\$100.00	1.00	-1			nsor Reman	for:Moisture Se	CORE f	SE502799-CR
	\$3,827.78	Sub-Total:	0	\$0.00	Misc:	\$0.00	OL&M:	\$3,014.98	Parts:	abor: \$812.80
	\$3,844.80	Labor:					1			
	\$3,494.18	Parts:							EC'D22	Customer PO No: Tax Exempt No:
	\$0.00	OL&M:						24		Advisor:
	\$14.30	Misc:						enbrock	le Kerse	Ky
	\$0.95	Sales Tax:						100,000		7.37.38.38.38.38.38.38.38.38.38.38.38.38.38.
	\$7,354.23	Total:								

## **TERMS AND CONDITIONS**

Payment is due upon receipt. A finance charge of 1.5% per month (18% annual percentage rate) will be added to all past due invoices. We accept Cash, Check, John Deere Financial, Visa and Mastercard.

	672
Received by:	Date: