## Inspection Summary



S 780 Combine

Serial #: 1H0S780PNT821489

Stock #:

Inspection Date: 01/17/2025

Repair Order:

Warranty End Date: None

PowerGard Type: PowerGard Extended Warranty

PowerGard End Date: 01/20/2025

Engine Hours: 1072.5 Separator Hours: 685.5 **Declined:** 

Parts:

Approved:

**Needs Replaced:** 

Recommended:

会 \$1,730.13

0

10 10

0

Labor:

\$1,255.70

**Total Parts & Labor:** 

**2,985.83** 

**RUSSELL MULLINS:** 

16935 HWY 39

EUBANK, KY, 42567

H:

**Account Number: 41720** 

Technician:

Billy Johnson

**Inspection Cost:** 

**Total Warranty** Estimate:

\$0.00

\$695.00

\*Subject to warranty approval

**Grand Total:** 

**\$3,680.83** 

Note: tax, service accessories, welding, paint, and repair with no estimated cost are not included in quote

Legend



= Labor

🗒 = Warranty

**Approved** 

**Needs Replaced** 

Recommended

♠ \$1,730.13 ♠ \$1,255.70 \( \mathbb{P}\) \$2,985.83 \( \mathbb{P}\) \$0.00

**Totals** 

♠ \$1,730.13 ♠ \$1,255.70 \( \mathbb{P}\) \$2,985.83 \( \mathbb{P}\) \$0.00

**Declined** 

**Needs Replaced** 

⊕ \$0.00 € \$0.00 ₽ \$0.00

Recommended

⊕ \$0.00 € \$0.00 ₽ \$0.00 \$ \$0.00

**Totals** 

4 Feeder House

ැලි **\$32.00** 

ह्र \$210.25

**\$242.25** 

\$0.00

Right Hand Lower Feeder House Drive

Declined

Approved

Part Estimate

Labor Estimate

Total Estimate

Warranty

GUIDE EACH -- Remove & Install



igoredown

(c) \$32.00 Qty: 1 \$43.50 Job Code: \$780/4177/E/10 \$75.50

Technician Comments: Bottom Plastic Chain Guide Worn



CHAIN FEEDER HOUSE DRIVE -- Adjust





(c) \$0.00

\$43.50 Job Code: \$780/6404/FHD/25 \$43.50

**Technician Comments:** Chain Needs Adjusted

Optional 5 Speed Feeder House Drive

Declined Approved

Part Estimate

Labor Estimate

Total Estimate

Warranty

5 speed lower drive belt -- Adjust





(c) \$0.00 Qty: 1 \$50.75 Job Code: \$780/1357/5SLD/25 \$50.75

Technician Comments: Belt Needs Adjusted Some



Conveyor Chain, Plastic Chain Guides, Eyebolts and Adjustments

Declined

Approved

Part Estimate

Labor Estimate

Total Estimate

Warranty











Technician Comments: Needs slight adjustment





⊚; \$1,698.13

্ \$958.45

₻ \$2,656.58

**\$0.00** 

Unloading Auger Drive Chain, Sprockets and Guides

Declined

Approved

Part Estimate

Labor Estimate

**Total Estimate** 

Warranty

CHAIN UNLOADING AUGER DRIVE -- Adjust





(c) \$0.00 Qty: 1 \$43.50 Job Code: \$780/6404/UAD/25 \$43.50

Technician Comments: Chain Needs Adjustment



Chopper Jack Shaft and Drive Belts

Declined

Approved

Part Estimate

Labor Estimate

**Total Estimate** 


Warranty

Front chopper belt --Remove & Install










\$745.48

Technician Comments: Rip in belt



Chopper	Declined	Approved	Part Estimate	Labor Estimate	Total Estimate	Warranty
KNIFE BANK CHOPPER Remove & Install  Technician Comments: Flip	knives	•	② \$0.00 Qty: 1	\$87.00 Job Code: <b>\$780/6936/CP/10</b>	₩ \$87.00	
Chopper hammers Remove & Install Technician Comments: Ham	nmers worn have	e some life left	(5) \$1,247.00 Qty: 1	\$533.60 Job Code: <b>\$780/6064/CP/10</b>	<b>₽</b> \$1,780.60	

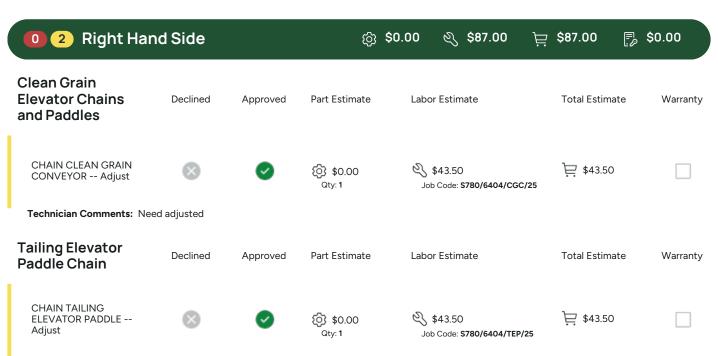

Technician Comments: Chain needs adjusting